


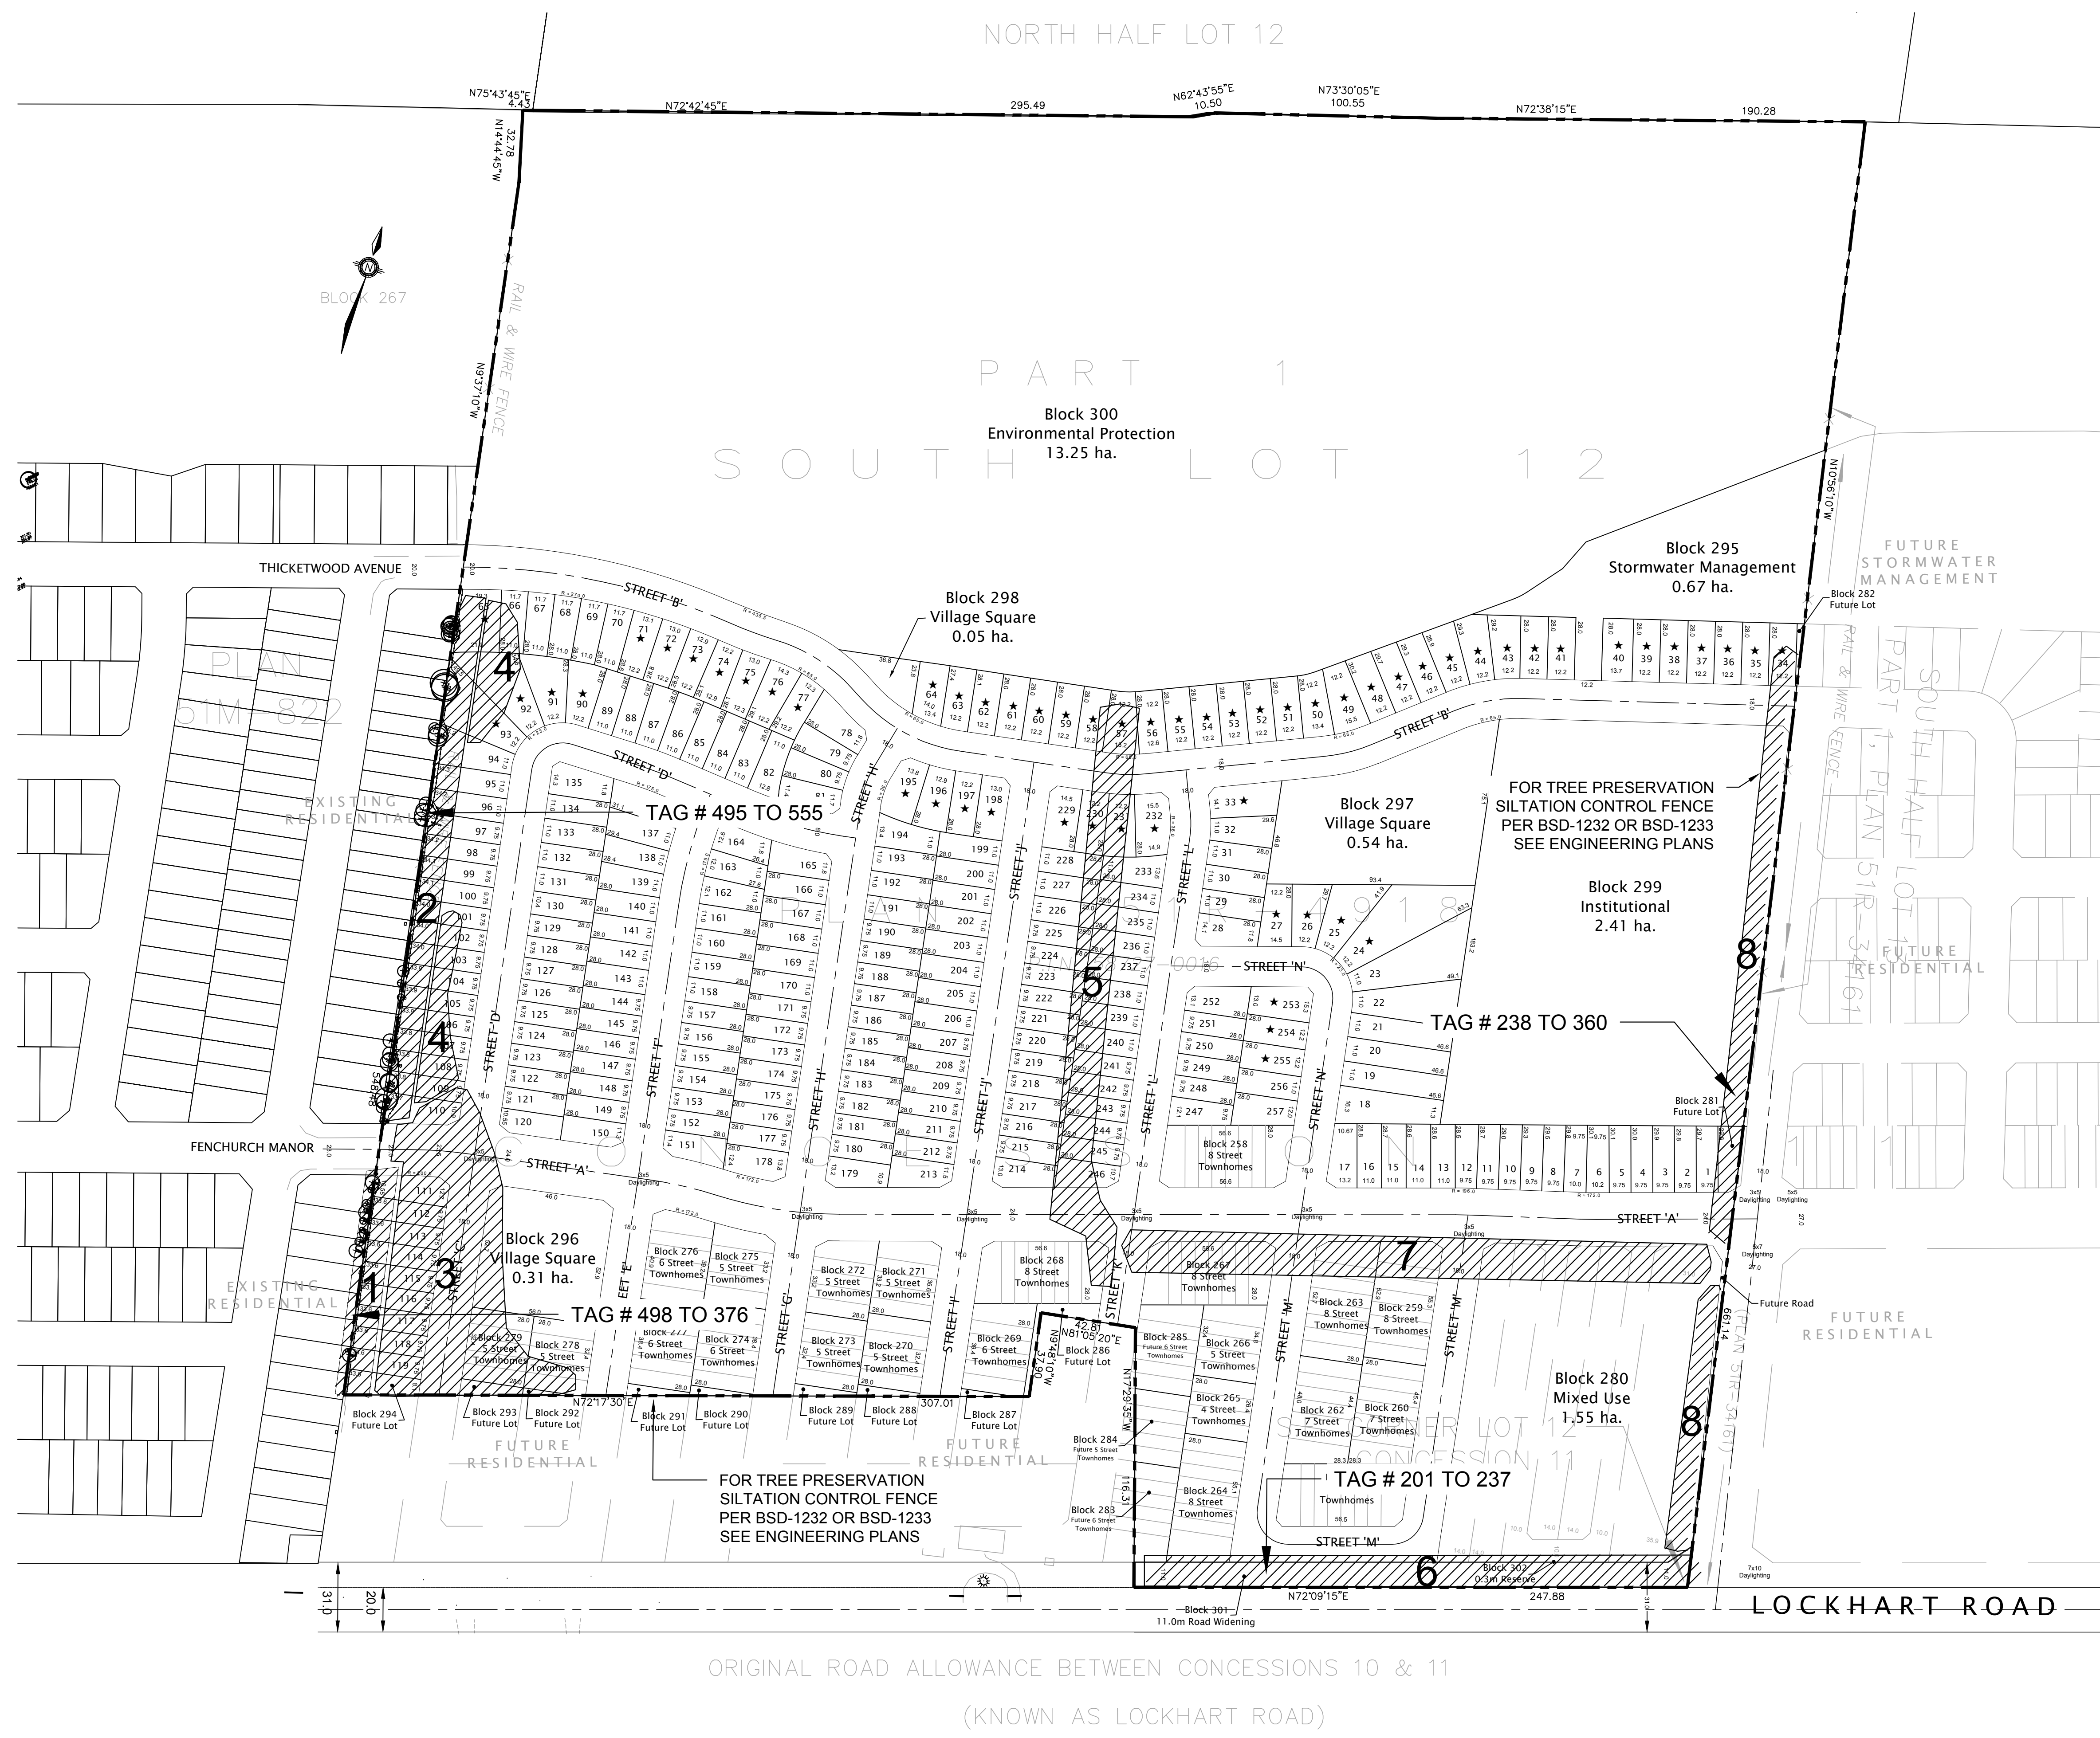

VEGETATION UNITS

VEGETATION UNIT # - RESPONSE

1	VEGETATION UNIT #1 O.L.S SURVEY / DNA INVENTORY
2	VEGETATION UNIT #2 DNA INVENTORY / O.L.S SURVEY
3	VEGETATION UNIT #3 DNA WOODLOT ASSESSMENT
4	VEGETATION UNIT #4 DNA HEDGEROW ASSESSMENT
5	VEGETATION UNIT #5 DNA HEDGEROW ASSESSMENT
6	VEGETATION UNIT #6 DNA HEDGEROW INVENTORY
7	VEGETATION UNIT #7 DNA HEDGEROW ASSESSMENT
8	VEGETATION UNIT #8 DNA HEDGEROW INVENTORY


APPROVED FOR CONSTRUCTION

THIS APPROVAL CONSTITUTES A GENERAL REVIEW AND DOES NOT CERTIFY DIMENSIONAL ACCURACY. THIS APPROVAL IS SUBJECT TO THE FURTHER CERTIFICATION OF THE "AS CONSTRUCTED" WORKS BY A REGISTERED LANDSCAPE ARCHITECT OF THE PROVINCE OF ONTARIO.


DATE: APPROVED BY:

OWNER'S SIGNATURE

DATE: BY:

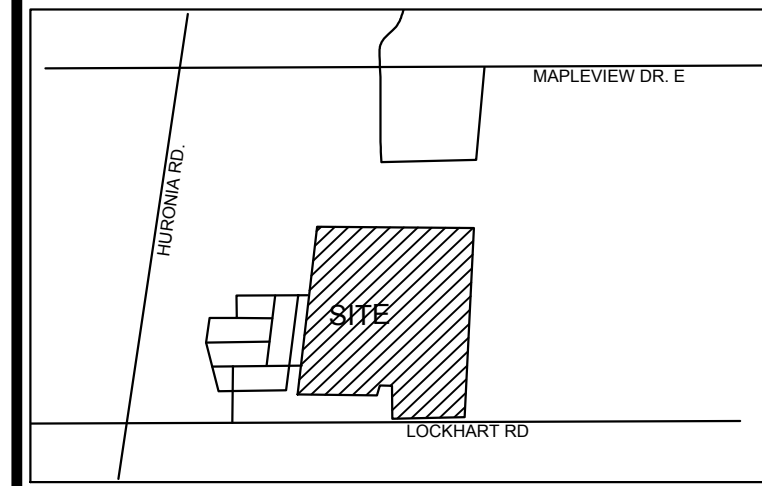

KEY PLAN SCALE: N.T.S.

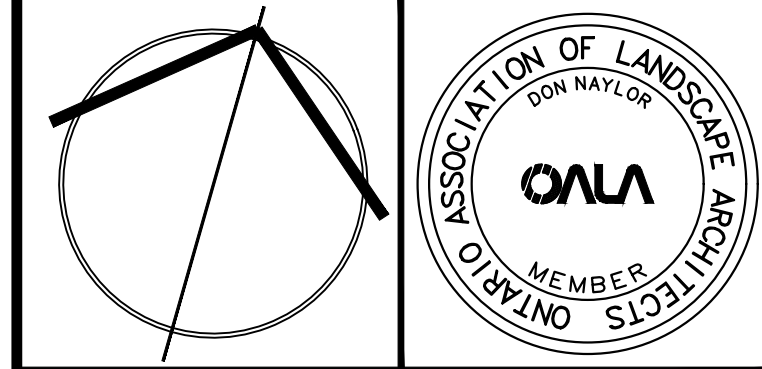

IT IS THE RESPONSIBILITY OF THE CONTRACTOR TO CHECK AND VERIFY ALL DIMENSIONS ON SITE AND REPORT ALL ERRORS AND/OR OMISSIONS TO THE LANDSCAPE ARCHITECT.
CONTRACTOR MUST COMPLY WITH ALL PERTINENT CODES AND BY-LAWS. DO NOT SCALE DRAWINGS.
DRAWINGS MAY NOT BE USED FOR CONSTRUCTION UNTIL SIGNED BY THE LANDSCAPE ARCHITECT.
COPYRIGHT RESERVED. THIS DRAWING IS THE EXCLUSIVE PROPERTY OF DON NAYLOR + ASSOCIATES LTD. AND SHALL NOT BE USED WITHOUT CONSENT.

3.	NEW BASE ADDED	OCT 11 2018
2.	TREE PRESERVATION INVENTORY	SEPT 5 2018
1.	CONFORMITY REVIEW	AUG 15 2018
NO.	REVISIONS	DATE

Don Naylor + Associates Ltd.
Environmental Planning
Landscape Architecture
245 Main Street North
Brampton, Ontario
L6X 1N3
T 905 459 6570
F 905 455 2249
E dnaylor@donnaylorandassociates.com



MUNICIPALITY: CITY OF BARRIE

CLIENT: BARRIE LOCKHART ROAD GP INC.

PROJECT NAME: LOCKHART ROAD SUBDIVISION

SHEET TITLE: VEGETATION UNITS PLAN

SCALE: 1:1500	DATE: JULY 2018
DESIGNED BY: DN	REVIEWED BY: DN
DRAWN BY: NN	DRAWING No. TP-1
PROJECT No. 18-695	

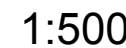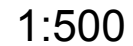

UNIT	DESCRIPTION	STATUS	SITE RESPONSE
3	MIXED DECIDUOUS WOODLOT	GRADING	REMOVE
5	MIXED DECIDUOUS HEDGE ROW	GRADING	REMOVE
7	MIXED DECIDUOUS "SCRUB" HEDGE ROW	GRADING	REMOVE

ITEM	TAG #	COMMON NAME	BOTANICAL NAME	DBH (cm)	HEALTH (G-F)	DIPLINE (m)	STATUS / RECOMMENDATION	SITE RESPONSE
56	501	Sugar Maple	Acer saccharum	25/15	G	4.5	2-STEM	Remove
57	502	Basewood	Tilia americana	19	G	4.0		Remove
58	503	Basewood	Tilia americana	25	G	4.0		Preserve
59	504	Basewood	Tilia americana	26.5	G	4.0		Preserve
60	505	Sugar Maple	Acer saccharum	42	G	4.0	2-STEM	Remove
61	506	Basewood	Tilia americana	15-30	G	4.5	5-STEM	Remove
62	507	Basewood	Tilia americana	17/25	G	4.0	2-STEM	Preserve
63	508	Basewood	Tilia americana	37	G	3.0		Preserve
64	509	American elm	Ulmus americana	19.5	P	3.0	Potential Hazard/ Needs pruning/ Diseased	Preserve
65	510	Basewood	Tilia americana	26	G	3.0		Preserve
66	511	Basewood	Tilia americana	10/12-5/14	G	3.0	3-STEM	Remove
67	512	Croakspue Var.	Malus sp.	27	F	3.0	No Thorns	Remove
68	513	American elm	Ulmus americana	20	D	3.0	DEAD	Remove
69	514	American elm	Ulmus americana	18	G	3.0		Remove
70	515	Sugar Maple	Acer saccharum	16	G	1.5		Preserve
71	516	White Ash	Fraxinus americana	22.5	P	1.5		Remove
72	517	American elm	Ulmus americana	19	G	1.5		Remove
73	518	Basewood	Tilia americana	22	G	1.5		Preserve
74	519	Sugar Maple	Acer saccharum	19.5	G	2.5		Remove
75	520	White Ash	Fraxinus americana	42.5	DEAD		DEAD/ HAZARD	Remove
76	521	American elm	Ulmus americana	17	F	2.5		Remove
77	522	Basewood	Tilia americana	10/10-5/16	G	2.5	4 CLUMP	Preserve
78	523	Basewood	Tilia americana	19/31.5	G-F	2.5	2-STEM	Remove
79	524	Basewood	Tilia americana	24	G	2.0		Remove
80	525	Sugar Maple	Acer saccharum	29	G	3.0		Remove
81	526	Basewood	Tilia americana	49/29	G	4.2	2-STEM	Remove
82	527	Basewood	Tilia americana	25	G	2.0		Remove
83	528	American elm	Ulmus americana	29	G-F	3.0		Remove
84	529	American elm	Ulmus americana	20	G	2.5		Remove
85	530	American elm	Ulmus americana	38	G-F	6.5	HAZARD	Remove
86	531	American elm	Ulmus americana	19.5	F	6.5	HAZARD	Remove
87	532	Basewood	Tilia americana	14	G	1.5		Remove
88	533	Black Cherry	Prunus serotina	13	G	1.5		Remove

NOTE:
SEE TP-3 FOR FULL INVENTORY OF VEGETATION
UNITS 6 AND 8 TAGS 201 TO 360

NOTE:
SEE TP-3 FOR FULL INVENTORY OF VEGETATION
UNITS 6 AND 8 TAGS 201 TO 360

SCALE: 1:500	DATE: DEC 2016
DESIGNED BY: DN	REVIEWED BY: DN
DRAWN BY: LH	DRAWING No.
PROJECT No. 18.695	TP-2

VEGETATION UNIT #6								
ITEM	TAG #	COMMON NAME	BOTANICAL NAME	DBH (cm)	HEALTH (G-F-P)	DRIPLINE (m)	STATUS / RECOMENDATION	SITE RESPONSE
111	201	White Ash	Fraxinus americana	32.21	P		2-STEM	dead / remove
112	202	Clump White Ash	Fraxinus americana	25-10	P		5-stem	dead / remove
113	203	White Ash	Fraxinus americana	22 MAX	P		4-stem	dead / remove
114	204	White Ash	Fraxinus americana	33	P			dead / remove
115	205	White Ash	Fraxinus americana	36.5	P			dead / remove
116	206	Clump White Ash	Fraxinus americana	30, 31.5	P		2-STEM	dead / remove
117	207	White Ash	Fraxinus americana	25.5	P		2-STEM	dead / remove
118	209	Basswood	Tilia americana	15.5	G	2.0		
119	210	Sugar Maple	Acer saccharum	76.5	G	7.0	Preserve	
120	211	White Ash	Fraxinus americana		P		3-stem	dead / remove
121	212	Basswood	Tilia americana	12.5 MAX	G	3.5		
122	213	White Ash	Fraxinus americana		F	3.0		
123	214	Sugar Maple	Acer saccharum	75.5	G	8.5		
124	215	Sugar Maple	Acer saccharum	16	G	5.0		
125	216	Sugar Maple	Acer saccharum	21	G	5.0		
126	217	White Ash	Fraxinus americana		P			dead / remove
127	218	Basswood	Tilia americana	30.5,38, 36.5,21	G	5.0	5-stem	
128	219	Sugar Maple	Acer saccharum	80	P	5.0	Embedded wire, poor trunk	remove
129	220	Sugar Maple	Acer saccharum	27.5	G	2.5		Preserve
130	221	White Ash	Fraxinus americana	25	P	1.0		
131	222	Sugar Maple	Acer saccharum	24.5	G	4.0		
132	223	Sugar Maple Grouping	Acer saccharum	19.5MAX	G	4.0	4 groupings	
133	224	Sugar Maple	Acer saccharum	24	G	3.0		
134	225	Sugar Maple	Acer saccharum	22	G	3.0		
135	226	White Ash	Fraxinus americana	19	P			dead/remove
136	227	White Ash	Fraxinus americana	2	P			dead/remove
137	228	Sugar Maple	Acer saccharum	80	G	8.5		
138	229	Sugar Maple	Acer saccharum	49	G	6.5		
139	230	White Ash	Fraxinus americana	60.5	P			dead/remove
140	231	Crabapple Var.	Malus sp.	17	G	2.0	Poor form	
141	232	sugar Maple	Acer saccharum	31.5	G	4.0	Multistem	
142	233	White Ash	Fraxinus americana		P			dead/remove
143	234	Sugar Maple	Acer saccharum	20	G	3.0	buckthorn Under	
144	235	Basswood	Tilia americana	24.5,19	G	2.0	2-STEM	healthy
145	236	White Ash	Fraxinus americana	42.5	G	4.0	Fair to Good	
146	237	Sugar Maple	Acer saccharum	38	G	6.5		

VEGETATION UNIT #8								
ITEM	TAG #	COMMON NAME	BOTANICAL NAME	DBH (cm)	HEALTH (G-F-P)	DRIPLINE (m)	STATUS / RECOMENDATION	SITE RESPONSE
147	238	Clump Basswood	Tilia americana	25MAX	G	4.0	5-stems	
148	239	Clump Basswood	Tilia americana	21MAX	G	3.0	2-STEM	
149	240	Clump Basswood	Tilia americana	22MAX	G	3.0	6-stem	
150	241	Clump White Ash	Fraxinus americana		P		4-stem	dying
151	242	Clump Basswood	Tilia americana	23.5	G	3.5	8-stem	
152	243	White Ash	Fraxinus americana	22.5	P			dead/remove
153	244	Clump Basswood	Tilia americana	29MAX	G	4.0	8-stem	
154	245	White Ash	Fraxinus americana	20.5	P			dead/remove
155	246	Sugar Maple	Acer saccharum	75	G	5.0		
156	247	Clump White Ash	Fraxinus americana	22ALL	P	6.0		dead
157	248	Basswood	Tilia americana	15,17	G	3.0	3-stem	
158	249	Clump Basswood	Tilia americana	21.5	F	5.0	4-stem	
159	250	Clump Basswood	Tilia americana	40MAX	G	5.0	4-stem	
160	251	Basswood	Tilia americana	21.5,17.5	G	3.0	2-STEM	
161	252	Basswood Grouping	Tilia americana	27.5	G	3.0	4-stem	
162	253	Basswood Grouping	Tilia americana	32	G	5.0	5-stem	
163	254	Linden Var.	Tilia americana	23.5	P		8-stem	poor
164	255	Sugar Maple	Acer saccharum	21.5	G	4.5		
165	256	Clump Basswood	Tilia americana	26MAX	F	3.0	7-stem	
166	257	Basswood	Tilia americana	29,13	G	4.0	2-STEM	
167	258	Basswood	Tilia americana	16,16.5	G	4.0	2-STEM	
168	259	White Ash	Fraxinus americana	68	P			dead/remove
169	260	Sugar Maple	Acer saccharum	44	F	3.0		Hazard/remove
170	261	Sugar Maple	Acer saccharum	80	P	5.0	Wire embedded	remove
171	262	Basswood	Tilia americana	19.5,17.5	F	7.0	2-sTEM	
172	263	Clump White Ash	Fraxinus americana	26.5	D		3-stem	dead/remove
173	264	Black Walnut	Juglans nigra	23	G	3.5		
174	265	Black Cherry	Prunus serotina		P			Poor/remove
175	266	American elm	Ulmus americana	24	F	8.0	buckthorn Under	Hazard/remove
176	267	Sugar Maple	Acer saccharum	31,27	G	8.0		
177	268	White Ash	Fraxinus americana		P		2-STEM	
178	269	American elm	Ulmus americana	24	G	7.0		
179	270	White Ash	Fraxinus americana	27	F	7.5		
180	271	American elm	Ulmus americana	40	F	8.5		
181	272	Basswood	Tilia americana	46,53	G	9.0	2-STEM	
182	273	Sugar Maple	Acer saccharum	37.5	G	7.0		
183	274	Black Walnut	Juglans nigra	35	G	8.0		
184	275	White Ash	Fraxinus americana	21.5	G	2.0		remove
185	276	Basswood	Tilia americana	55	G	7.0	4-stem	
186	277	Clump Basswood	Tilia americana	46	F-P	6.0	5-stem	Fair to Poor
187	278	Sguar Maple	Acer saccharum	30.5	G	6.0		
188	279	White Ash	Fraxinus americana	39	P			dead/remove
189	280	Sugar Maple	Acer saccharum	61	F	5.0		
190	281	White Ash	Fraxinus americana	25	P			Poor/dead
191	282	Aspen Poplar	Populus tremuloides	27	F	4.0		
192	283	White Ash	Fraxinus americana	26	F		Effected	
193	284	White Ash	Fraxinus americana	17	P			dead/remove
194	285	White Ash	Fraxinus americana	20	P			dead/remove
195	286	American elm	Ulmus americana	31	P	4.0		
196	287	American elm	Ulmus americana	62	G	8.0		
197	288	Sugar Maple	Acer saccharum	43.5	G	4.0	Wire embedded	
198	289	Basswood	Tilia americana	58	P	7.0	Trunk Integrity Poor	remove
199	290	Basswood	Tilia americana	55MAX	G	6.0	3-stem	
200	292	White Ash	Fraxinus americana	32	P	3.0	Poor Condition	
201	293	Crabapple Var.	Malus sp.	23	G	6.5	4-stem	
202	294	Crabapple Var.	Malus sp.	26	F	4.5		
203	296	Crabapple Var.	Malus sp.	43	P	4.0		remove
204	295	Basswood	Tilia americana	38.5MAX	G	4.0	4-stem	
205	297	Sugar Maple	Acer saccharum	32	G	4.0		
206	298	Sugar Maple	Acer saccharum	45Avg	G	5.0	2-stem	
207	299	Sguar Maple	Acer saccharum	24.20	G	3.5	2-STEM	
208	300	Sugar Maple	Acer saccharum	26.23	G	3.0	Group of 4	
209	301	Sugar Maple	Acer saccharum	18.5	G	3.0		
210	302	Sugar Maple	Acer saccharum	24	G	3.5		
211	303	Black Walnut	Juglans nigra	24.5	G	4.0		
212	304	Sugar Maple	Acer saccharum	55.5	G	6.0		
213	305	Sugar Maple	Acer saccharum	38	G	5.5	Wire embedded	
214	306	Sugar Maple	Acer saccharum	40	G	5.5		
215	307	Sugar Maple	Acer saccharum	94	F-P	5.0	Wire embedded	
216	308	Sugar Maple	Acer saccharum	55	G	4.0		
217	309	Sugar Maple	Acer saccharum	32	G	4.0	2-STEM	
218	310	Sugar Maple	Acer saccharum	101	F	5.5	Wire embedded	
219	311	Sugar Maple	Acer saccharum	23	G	3.5		
220	312	Basswood	Tilia americana	62, 50	G	8.0	5-stem	
221	313	Sugar Maple	Acer saccharum	26.5	G	5.0		
222	314	Sugar Maple	Acer saccharum	57	G	7.0		
223	315	Sugar Maple	Acer saccharum	67	G	6.5		
224	316	Sugar Maple Grouping	Acer saccharum	21	P	4.0	3-stem Grouping	trunk poor
225	317	Sugar Maple	Acer saccharum	35	P	2.5		
226	318	Basswood	Tilia americana	54	G	6.0	5-stem Clump	
227	319	Sugar Maple	Acer saccharum	64	G	4.5	Wire embedded	
228	320	American elm	Ulmus americana	49	P	7.5	Poor Condition	
229	321	Sugar Maple	Acer saccharum	53	G	5.5		
230	322	Linden Var.	Tilia americana	39-35	G	5.5	5 clumps	
231	323	Sugar Maple	Acer saccharum	40	G	5.5		
232	324	Clump Basswood	Tilia americana	50-26	G	7.0	5-stem	
233	325	Basswood	Tilia americana	25	G	4.5		
234	326	Basswood	Tilia americana	33MAX	G	5.0	2-STEM	
235	327	Sugar Maple	Acer saccharum	44	G	5.5	Embedded wire	
236	328	Linden Var.	Tilia americana	42	G	6.0	4-stem	
237	329	Sugar Maple	Acer saccharum	41	G	4.5		
238	330	Sugar Maple Clump	Acer saccharum	33.5MAX	G	6.0	6-stem	
239	331	Black Cherry	Prunus serotina	34	G	5.5		
240	332	Ironwood	Ostrya virginiana	25	G	4.0		
241	333	Black Cherry	Prunus serotina	45	F	4.0	Trunk Integrity Poor	
242	334	Black Cherry	Prunus serotina	31.5	G	6.0		
243	335	Basswood	Tilia americana	28.5	G	4.0	Wire embedded	
244	336	Basswood	Tilia americana	51	G	7.5		
245	337	Linden Var.	Tilia americana	44.5	G	8.0	3-stem, wire embedded	
246	338	Linden Var.	Tilia americana	43	G	7.0	Wire embedded	
247	339	Linden Var.	Tilia americana	53-25	G	6.5	6-stem, wire embedded	
248	340	American elm	Ulmus americana	26.5	G	3.5		
249	341	Black Cherry	Prunus serotina	33	G	4.0		
250	342	Black Cherry	Prunus serotina	34	G	5.0		
251	343	Black Cherry	Prunus serotina	24	G	4.0		
252	344	Black Cherry	Prunus serotina	22	G	4.0		
253	345	Linden Var.	Tilia americana	17	G	4.0		
254	346	Black Cherry	Prunus serotina	29	G	5.5		
255	347	Linden Var.	Tilia americana	18	G	3.0		
256	348	Linden Var.	Tilia americana	17	G	4.0		
257	349	Black Cherry	Prunus serotina	20	G	3.0	Wire embedded	
258	350	Black Cherry	Prunus serotina	25.5	G	4.0		
259	351	Linden Var.	Tilia americana	62-25	G	6.5	5-stem	
260	352	American Beech	Fagus grandifolia	26.5-22	G	6.0	2-stem, wire embedded	
261	353	American Beech	Fagus grandifolia	27	G	4.0		
262	354	American Beech	Fagus grandifolia	21	G	4.0		
263	355	American Beech	Fagus grandifolia	27	P	2.5	Poor Condition	
264	356	Sugar Maple	Acer saccharum	54	G	5.0	Leaning	
265	357	Linden Var.	Tilia americana	77	F	4.0		Hazard/remove
266	358	American Beech	Fagus grandifolia	20	G	4.0		
267	359	White Ash	Fraxinus americana		P			Dead/remove
268	360	Sugar Maple	Acer saccharum	44-43	F-P	4.5	Poor for the large, fair for the small	


APPROVED FOR CONSTRUCTION

THIS APPROVAL CONSTITUTES A GENERAL REVIEW AND DOES NOT CERTIFY DIMENSIONAL ACCURACY. THIS APPROVAL IS SUBJECT TO THE FURTHER CERTIFICATION OF THE "AS CONSTRUCTED" WORKS BY A REGISTERED LANDSCAPE ARCHITECT OF THE PROVINCE OF ONTARIO.


DATE : _____ APPROVED BY: _____

OWNER'S SIGNATURE

DATE : _____ BY: _____

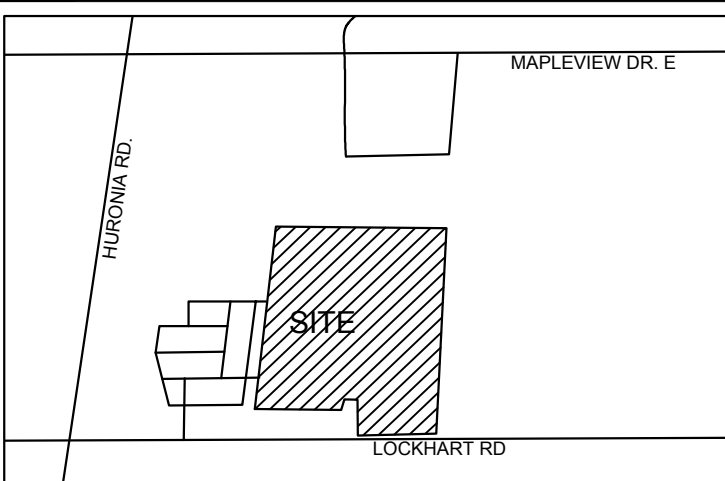

KEY PLAN SCALE: N.T.S.

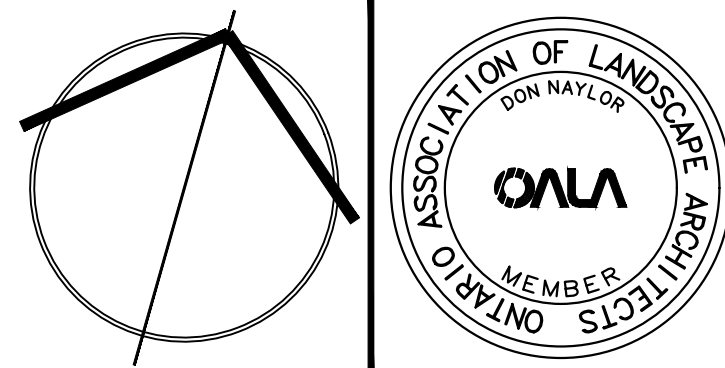

IT IS THE RESPONSIBILITY OF THE CONTRACTOR TO CHECK AND VERIFY ALL DIMENSIONS ON SITE AND REPORT ALL ERRORS AND/OR OMISSIONS TO THE LANDSCAPE ARCHITECT.
CONTRACTOR MUST COMPLY WITH ALL PERTINENT CODES AND BY-LAWS.
DO NOT SCALE DRAWINGS.
DRAWINGS MAY NOT BE USED FOR CONSTRUCTION UNTIL SIGNED BY THE LANDSCAPE ARCHITECT.
COPYRIGHT RESERVED. THIS DRAWING IS THE EXCLUSIVE PROPERTY OF DON NAYLOR + ASSOCIATES LTD. AND SHALL NOT BE USED WITHOUT CONSENT.

3.	NEW BASE ADDED	OCT 11 2018
2	TREE PRESERVATION INVENTORY	SEPT 5 2018
1.	CONFORMITY REVIEW	AUG 15 2018
NO.	REVISIONS	DATE

Don Naylor + Associates Ltd.
Environmental Planning
Landscape Architecture

245 Main Street North
Brampton, Ontario
L6X 1N3

T 905 459 6570
F 905 455 2249
E dnaylor@donnaylorandassociates.com







MUNICIPALITY: **CITY OF BARRIE**


CLIENT: **BARRIE LOCKHART ROAD GP INC.**

PROJECT NAME: **LOCKHART ROAD**

SHEET TITLE: **TREE REMOVAL AND PRESERVATION INVENTORY SCHEDULE**

SCALE: 1:500	DATE: DEC 2016
DESIGNED BY: DN	REVIEWED BY: DN
DRAWN BY: LH	DRAWING No.
PROJECT No. 18-695	TP-3

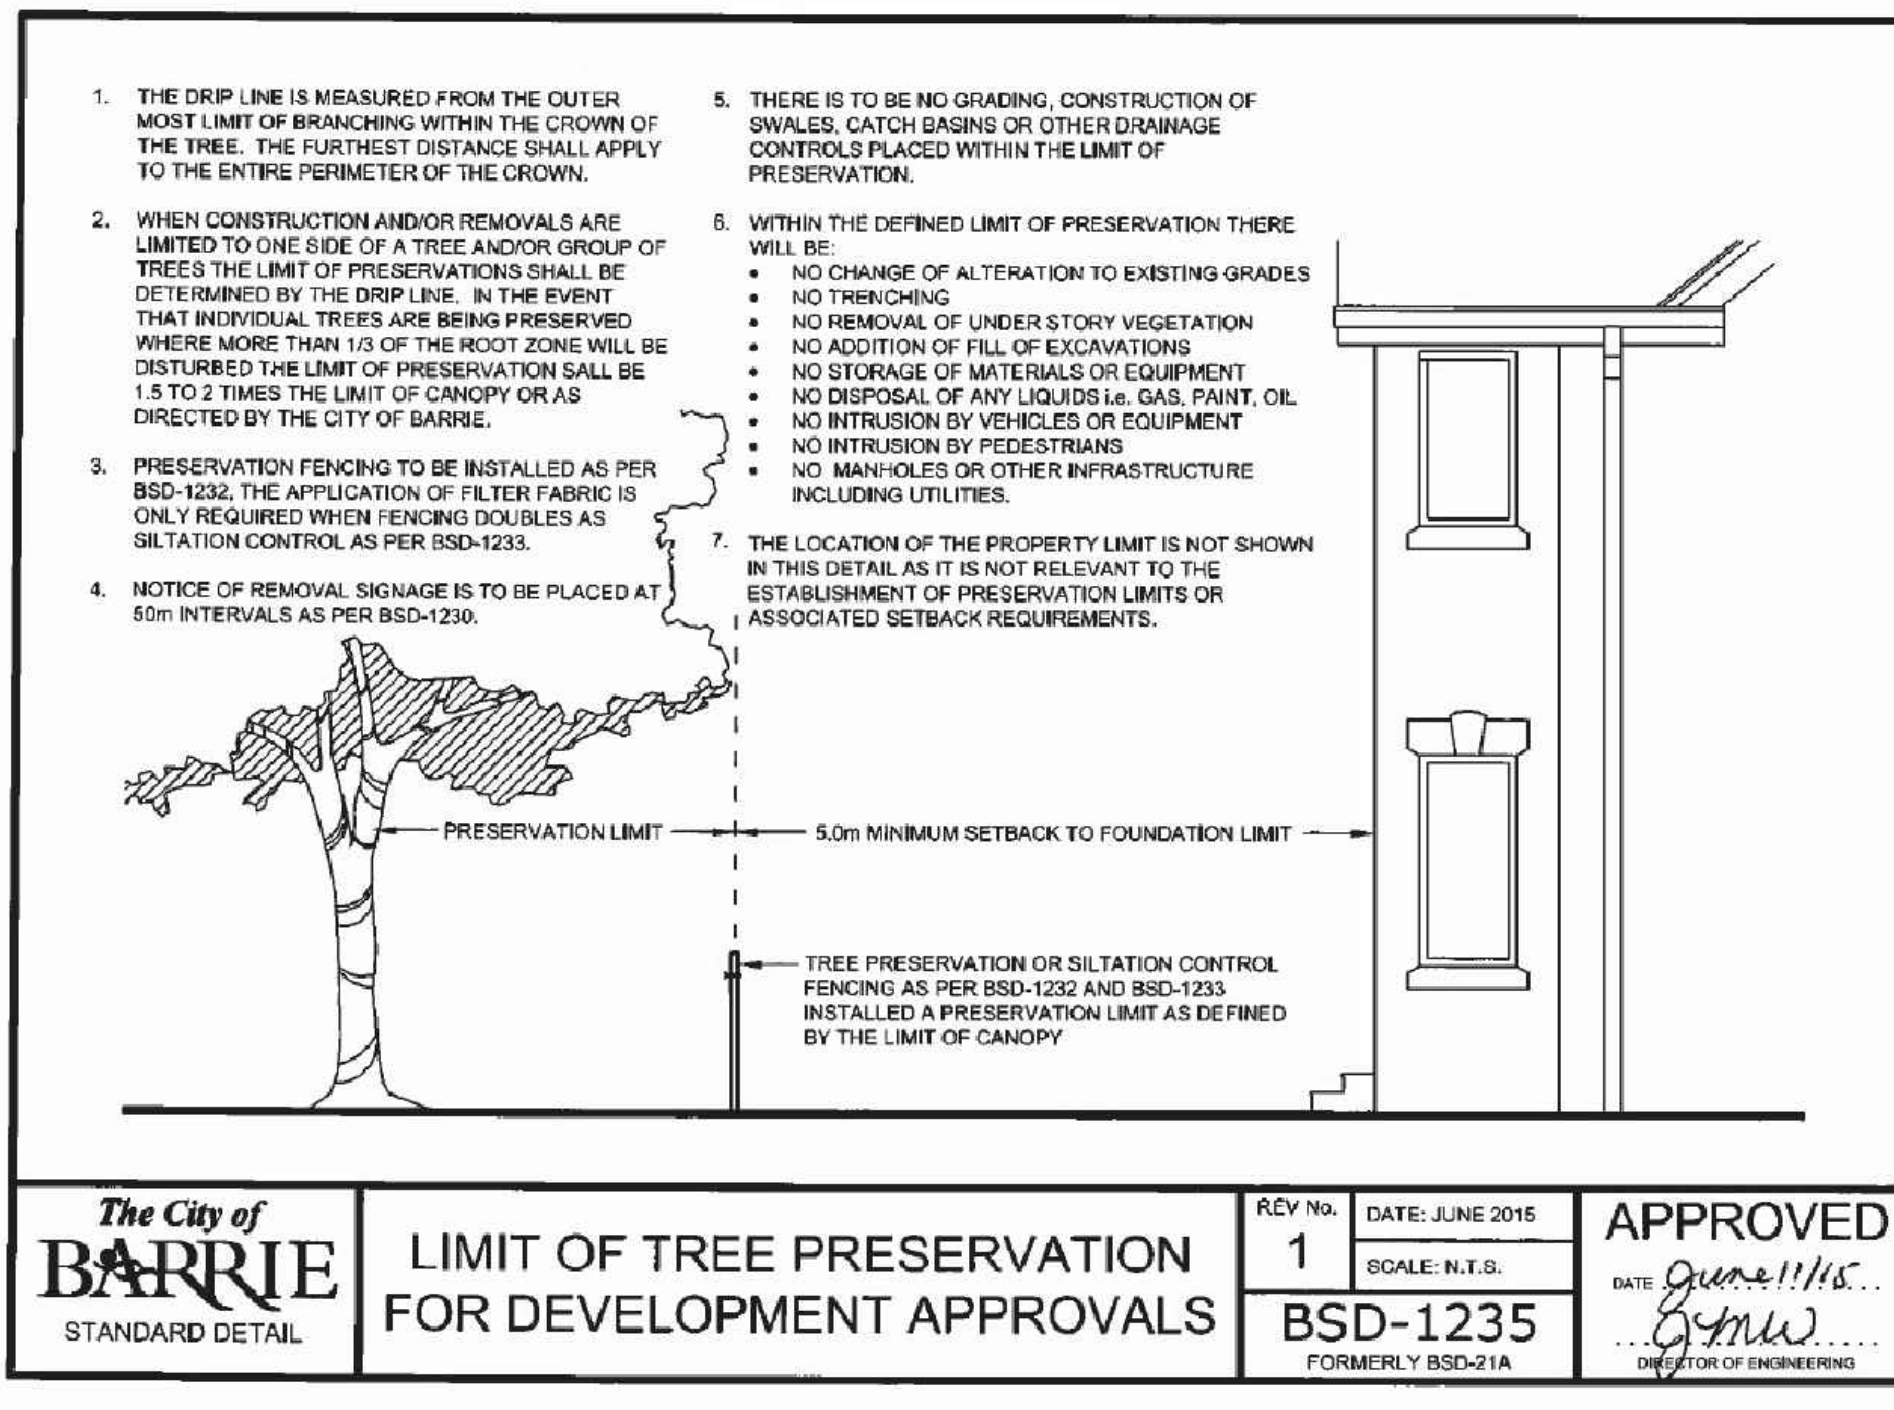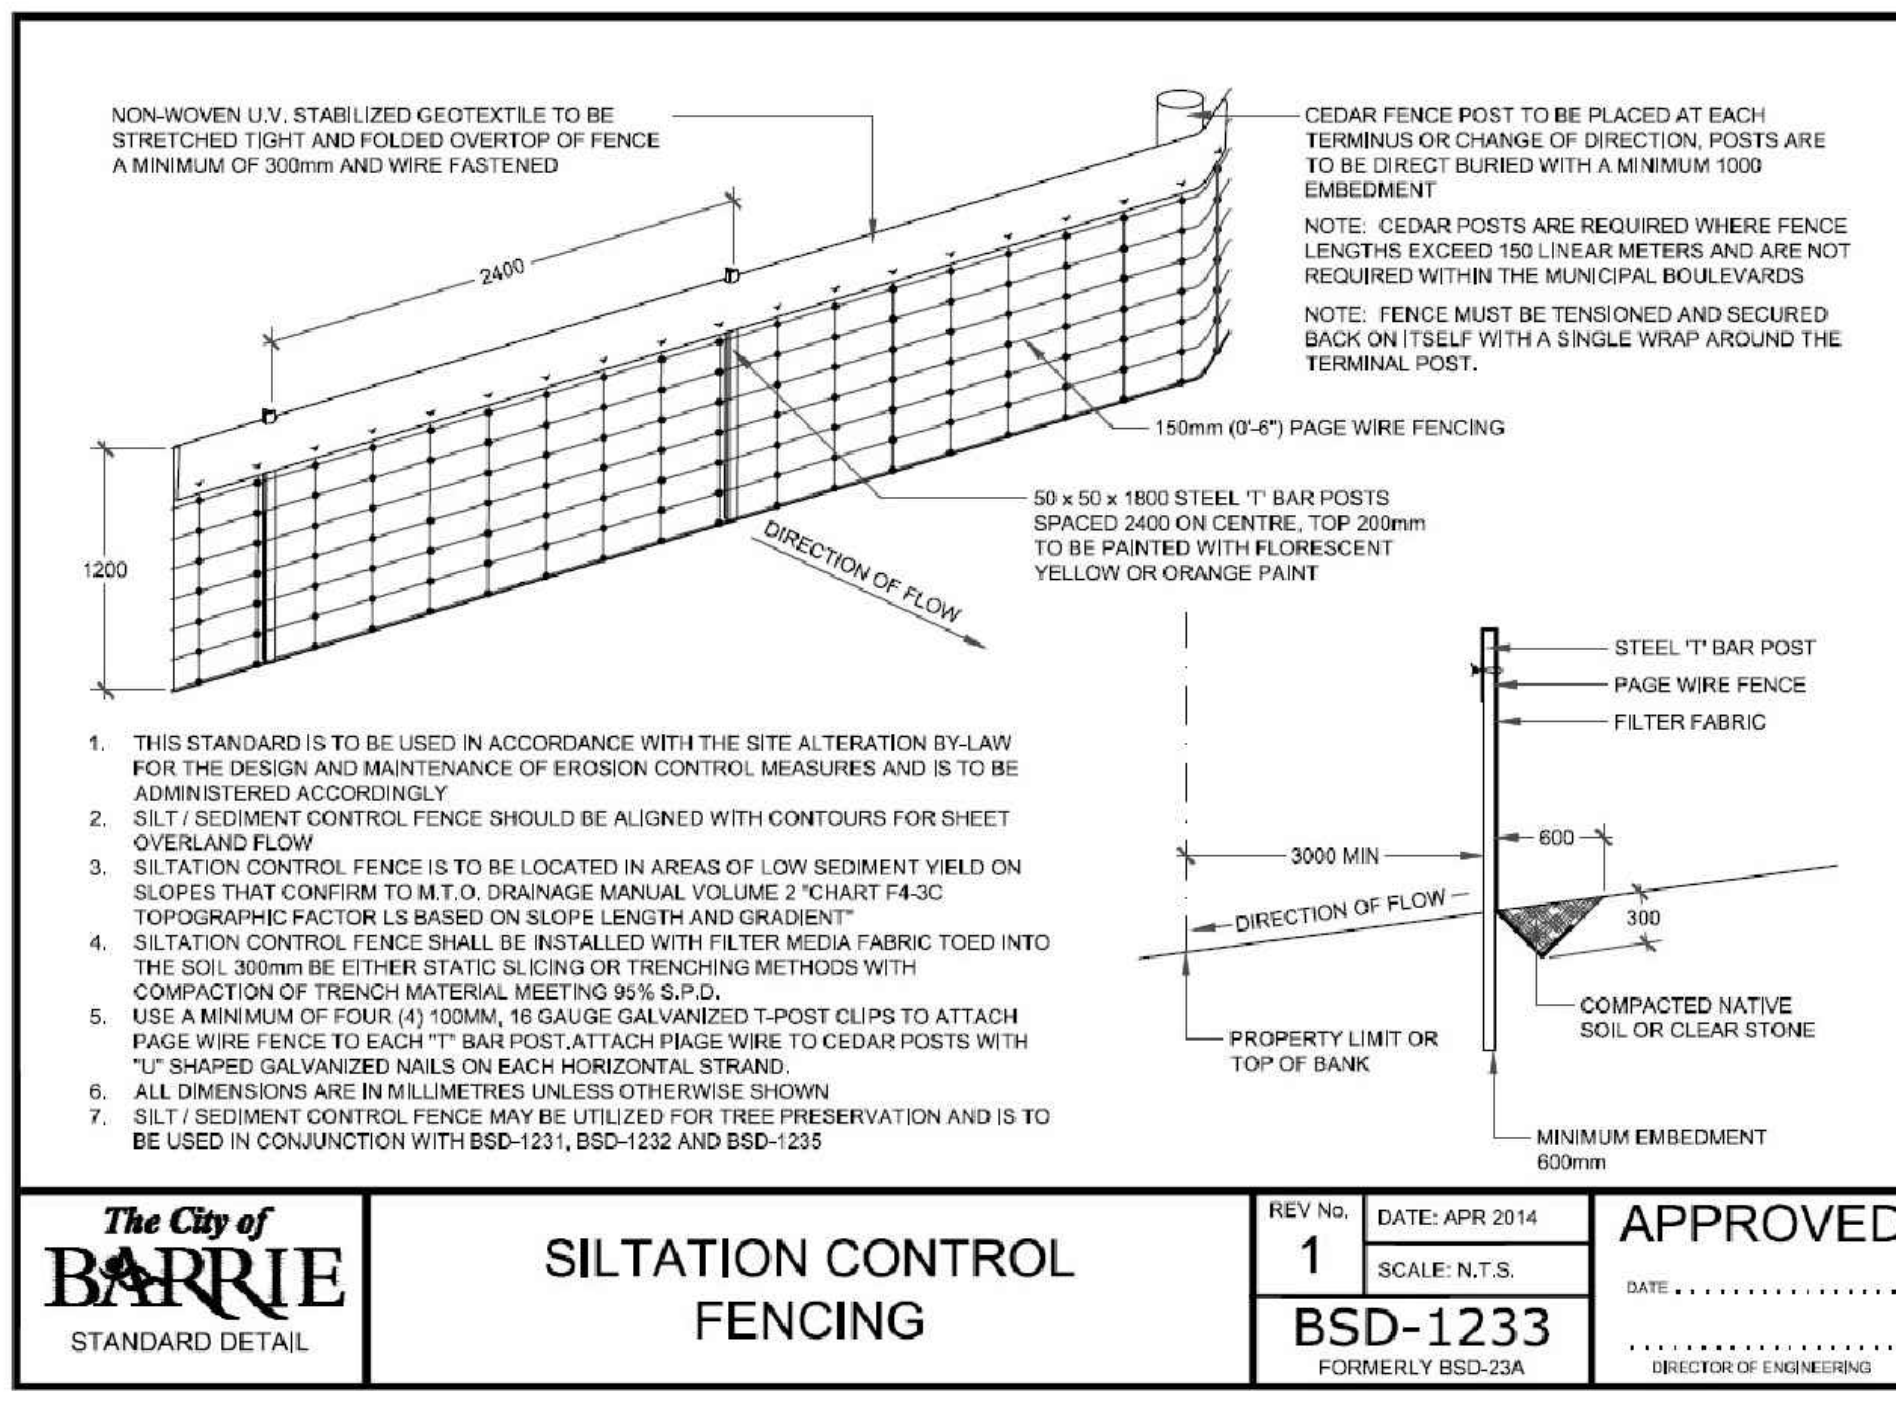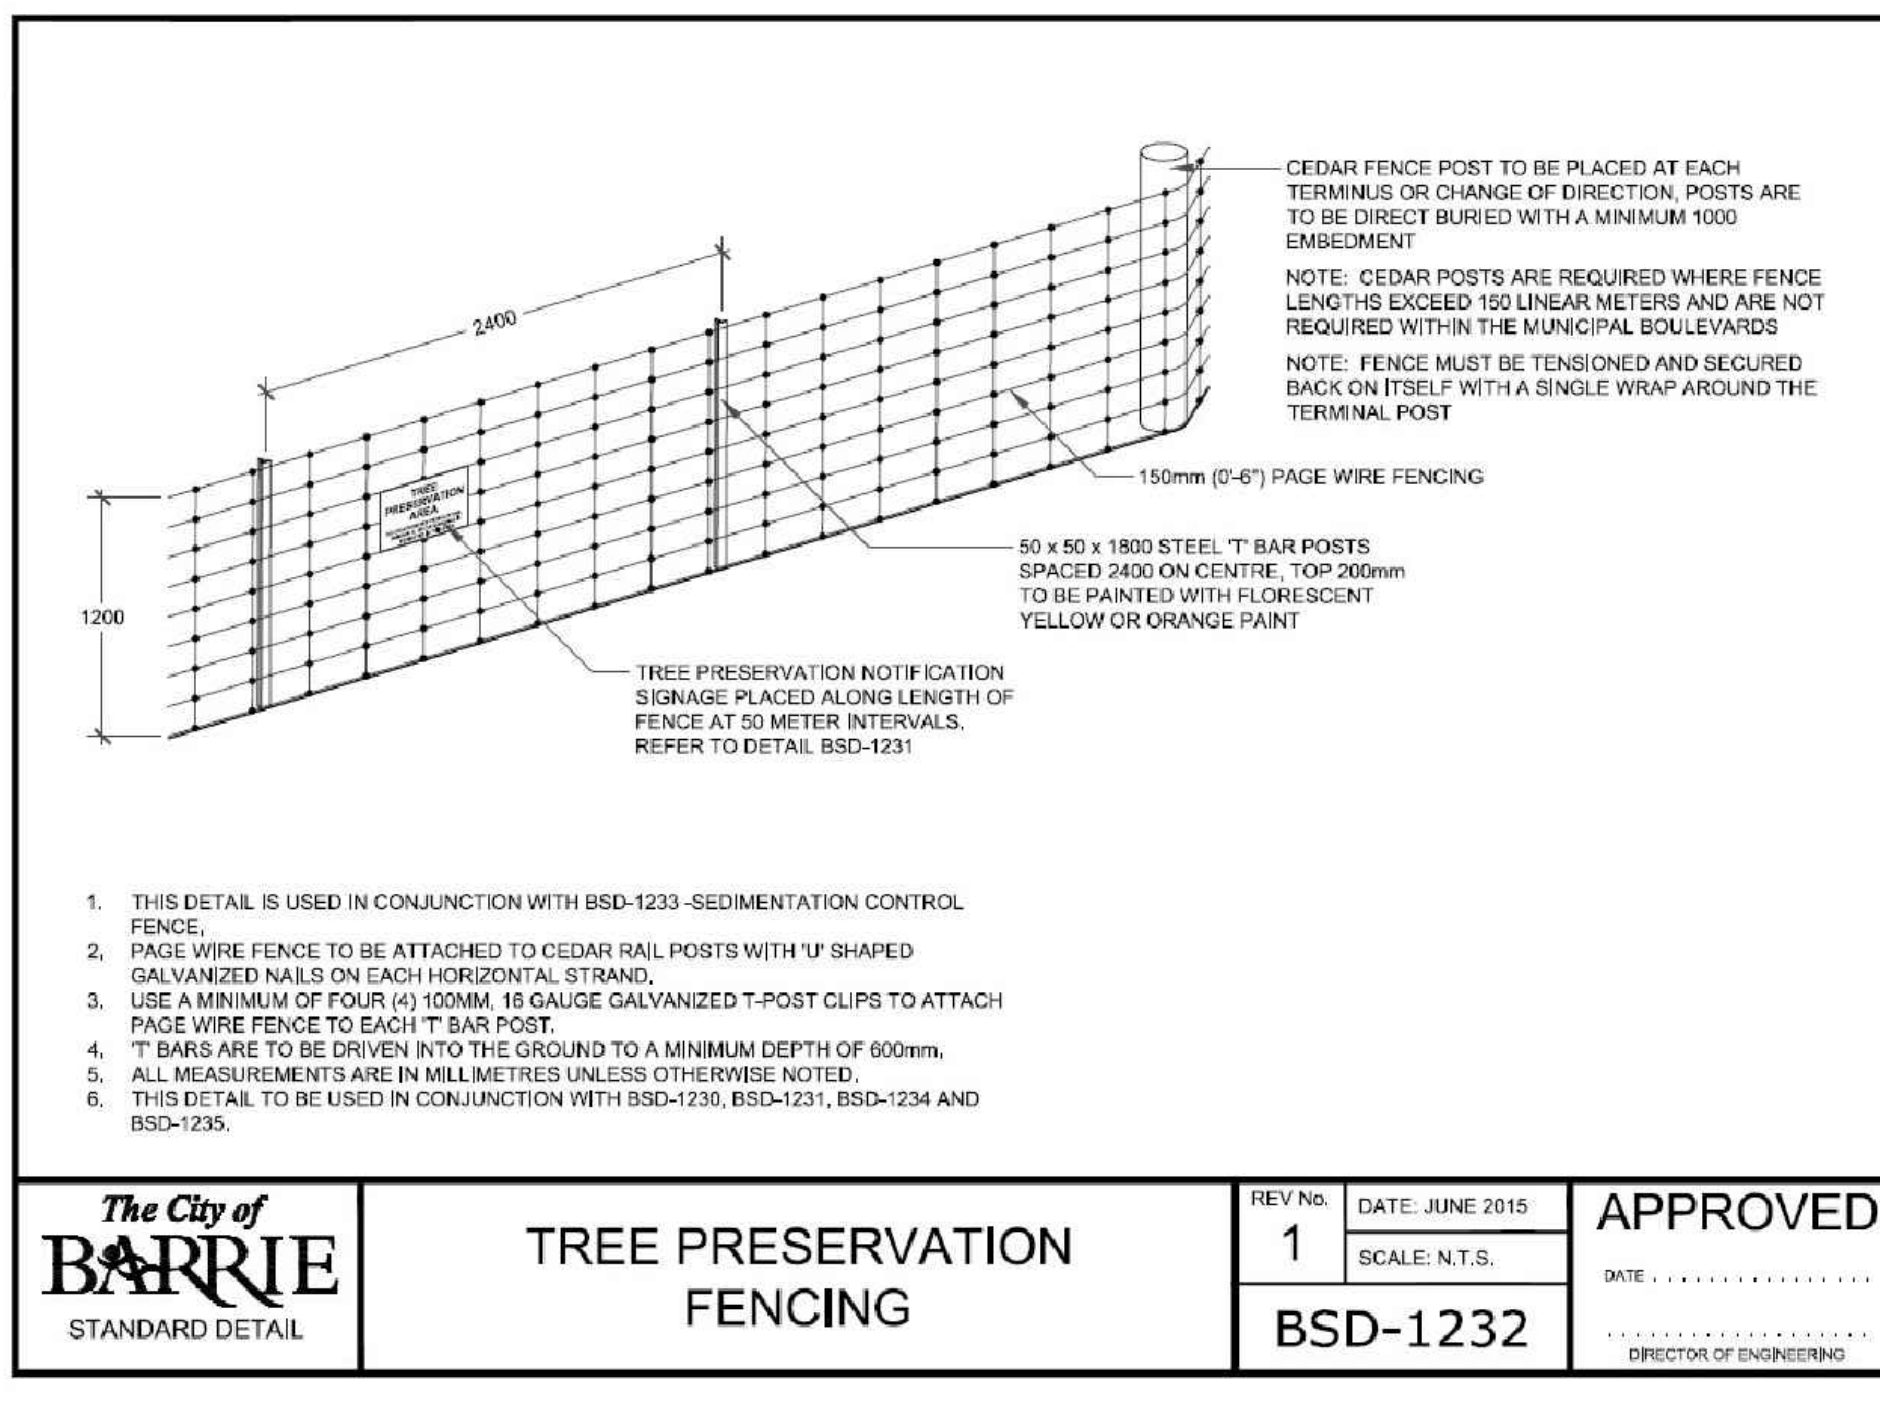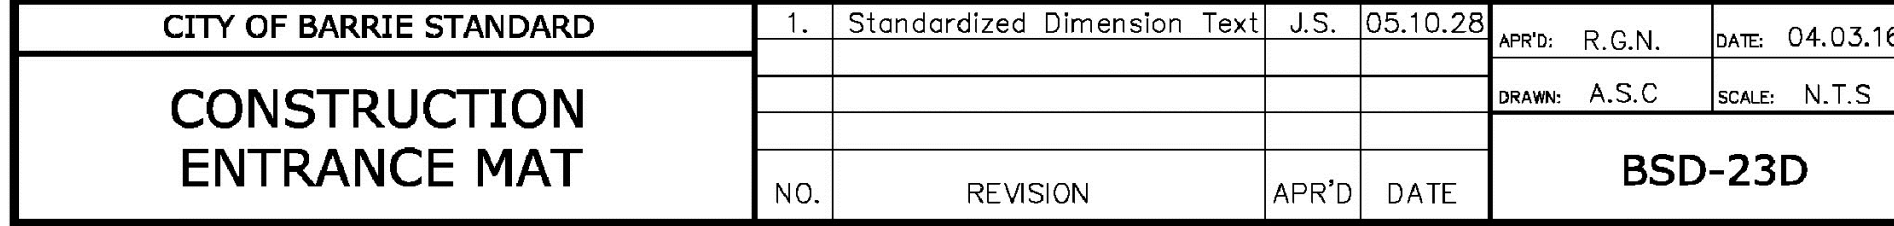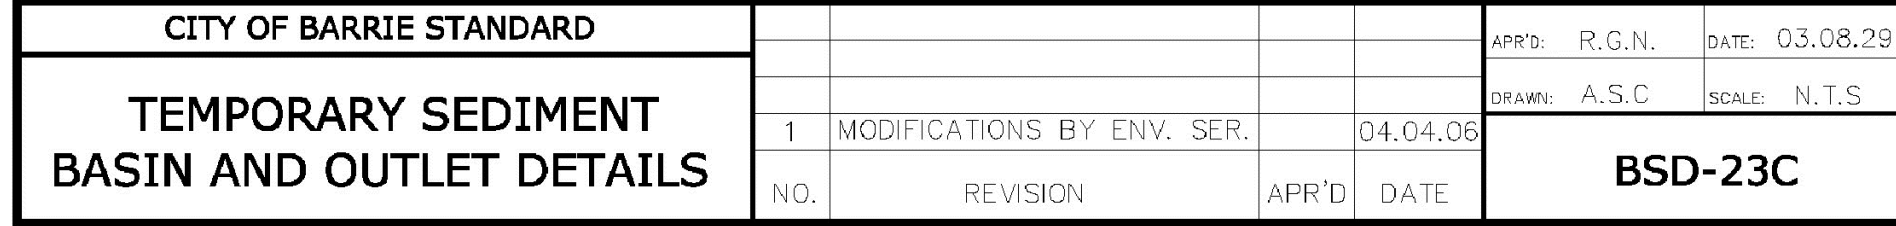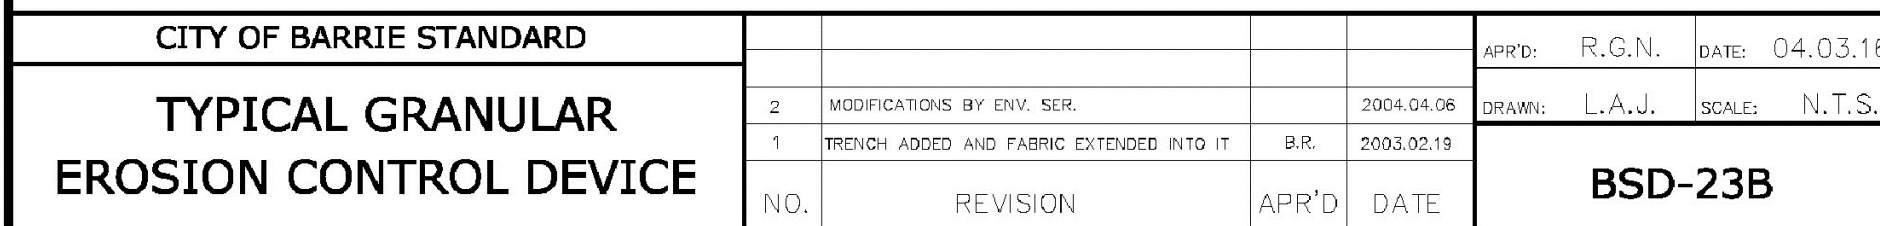

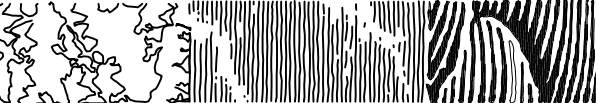OWNER'S SIGNATURE		
DATE : _____		BY: _____
KEY PLAN SCALE: N.T.S.		
		
IT IS THE RESPONSIBILITY OF THE CONTRACTOR TO CHECK AND VERIFY ALL DIMENSIONS ON SITE AND REPORT ALL ERRORS AND/OR OMISSIONS TO THE LANDSCAPE ARCHITECT. CONTRACTOR MUST COMPLY WITH ALL PERTINENT CODES AND BY-LAWS. DO NOT SCALE DRAWINGS. DRAWINGS MAY NOT BE USED FOR CONSTRUCTION UNTIL SIGNED BY THE LANDSCAPE ARCHITECT. COPYRIGHT RESERVED. THIS DRAWING IS THE EXCLUSIVE PROPERTY OF DON NAYLOR + ASSOCIATES LTD. AND SHALL NOT BE USED WITHOUT CONSENT.		
Don Naylor + Associates Ltd. Environmental Planning Landscape Architecture		
		
245 Main Street North Brampton, Ontario L6X 1N3		T 905 459 6570 F 905 458 2248 E dnaylor@donnaylorandassociates.com
MUNICIPALITY: CITY OF BARRIE		
CLIENT: BARRIE LOCKHART ROAD GP INC.		
PROJECT NAME: LOCKHART ROAD		
SHEET TITLE: DETAILS		
SCALE: 1:1500	DATE: DEC 2016	
DESIGNED BY: DN	REVIEWED BY: DN	
DRAWN BY: LH	DRAWING No.	
PROJECT No. 18-695	TP-4	