
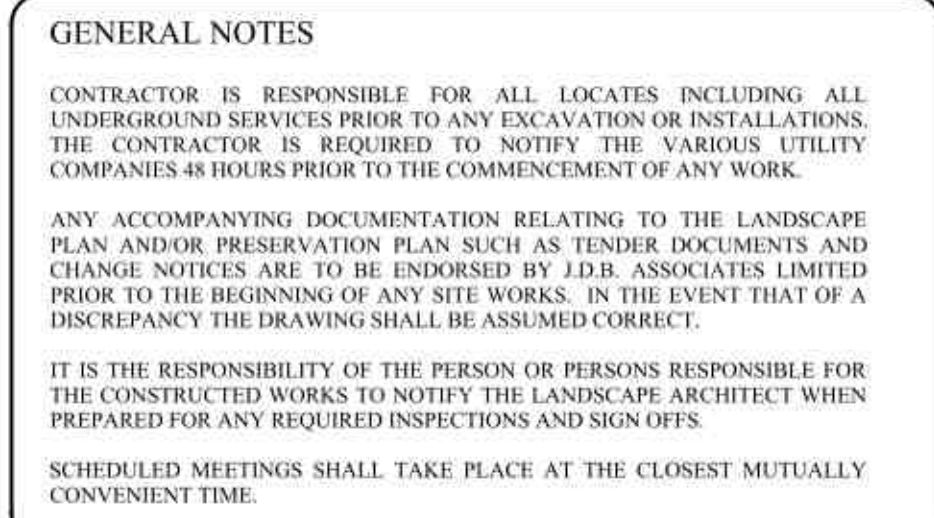


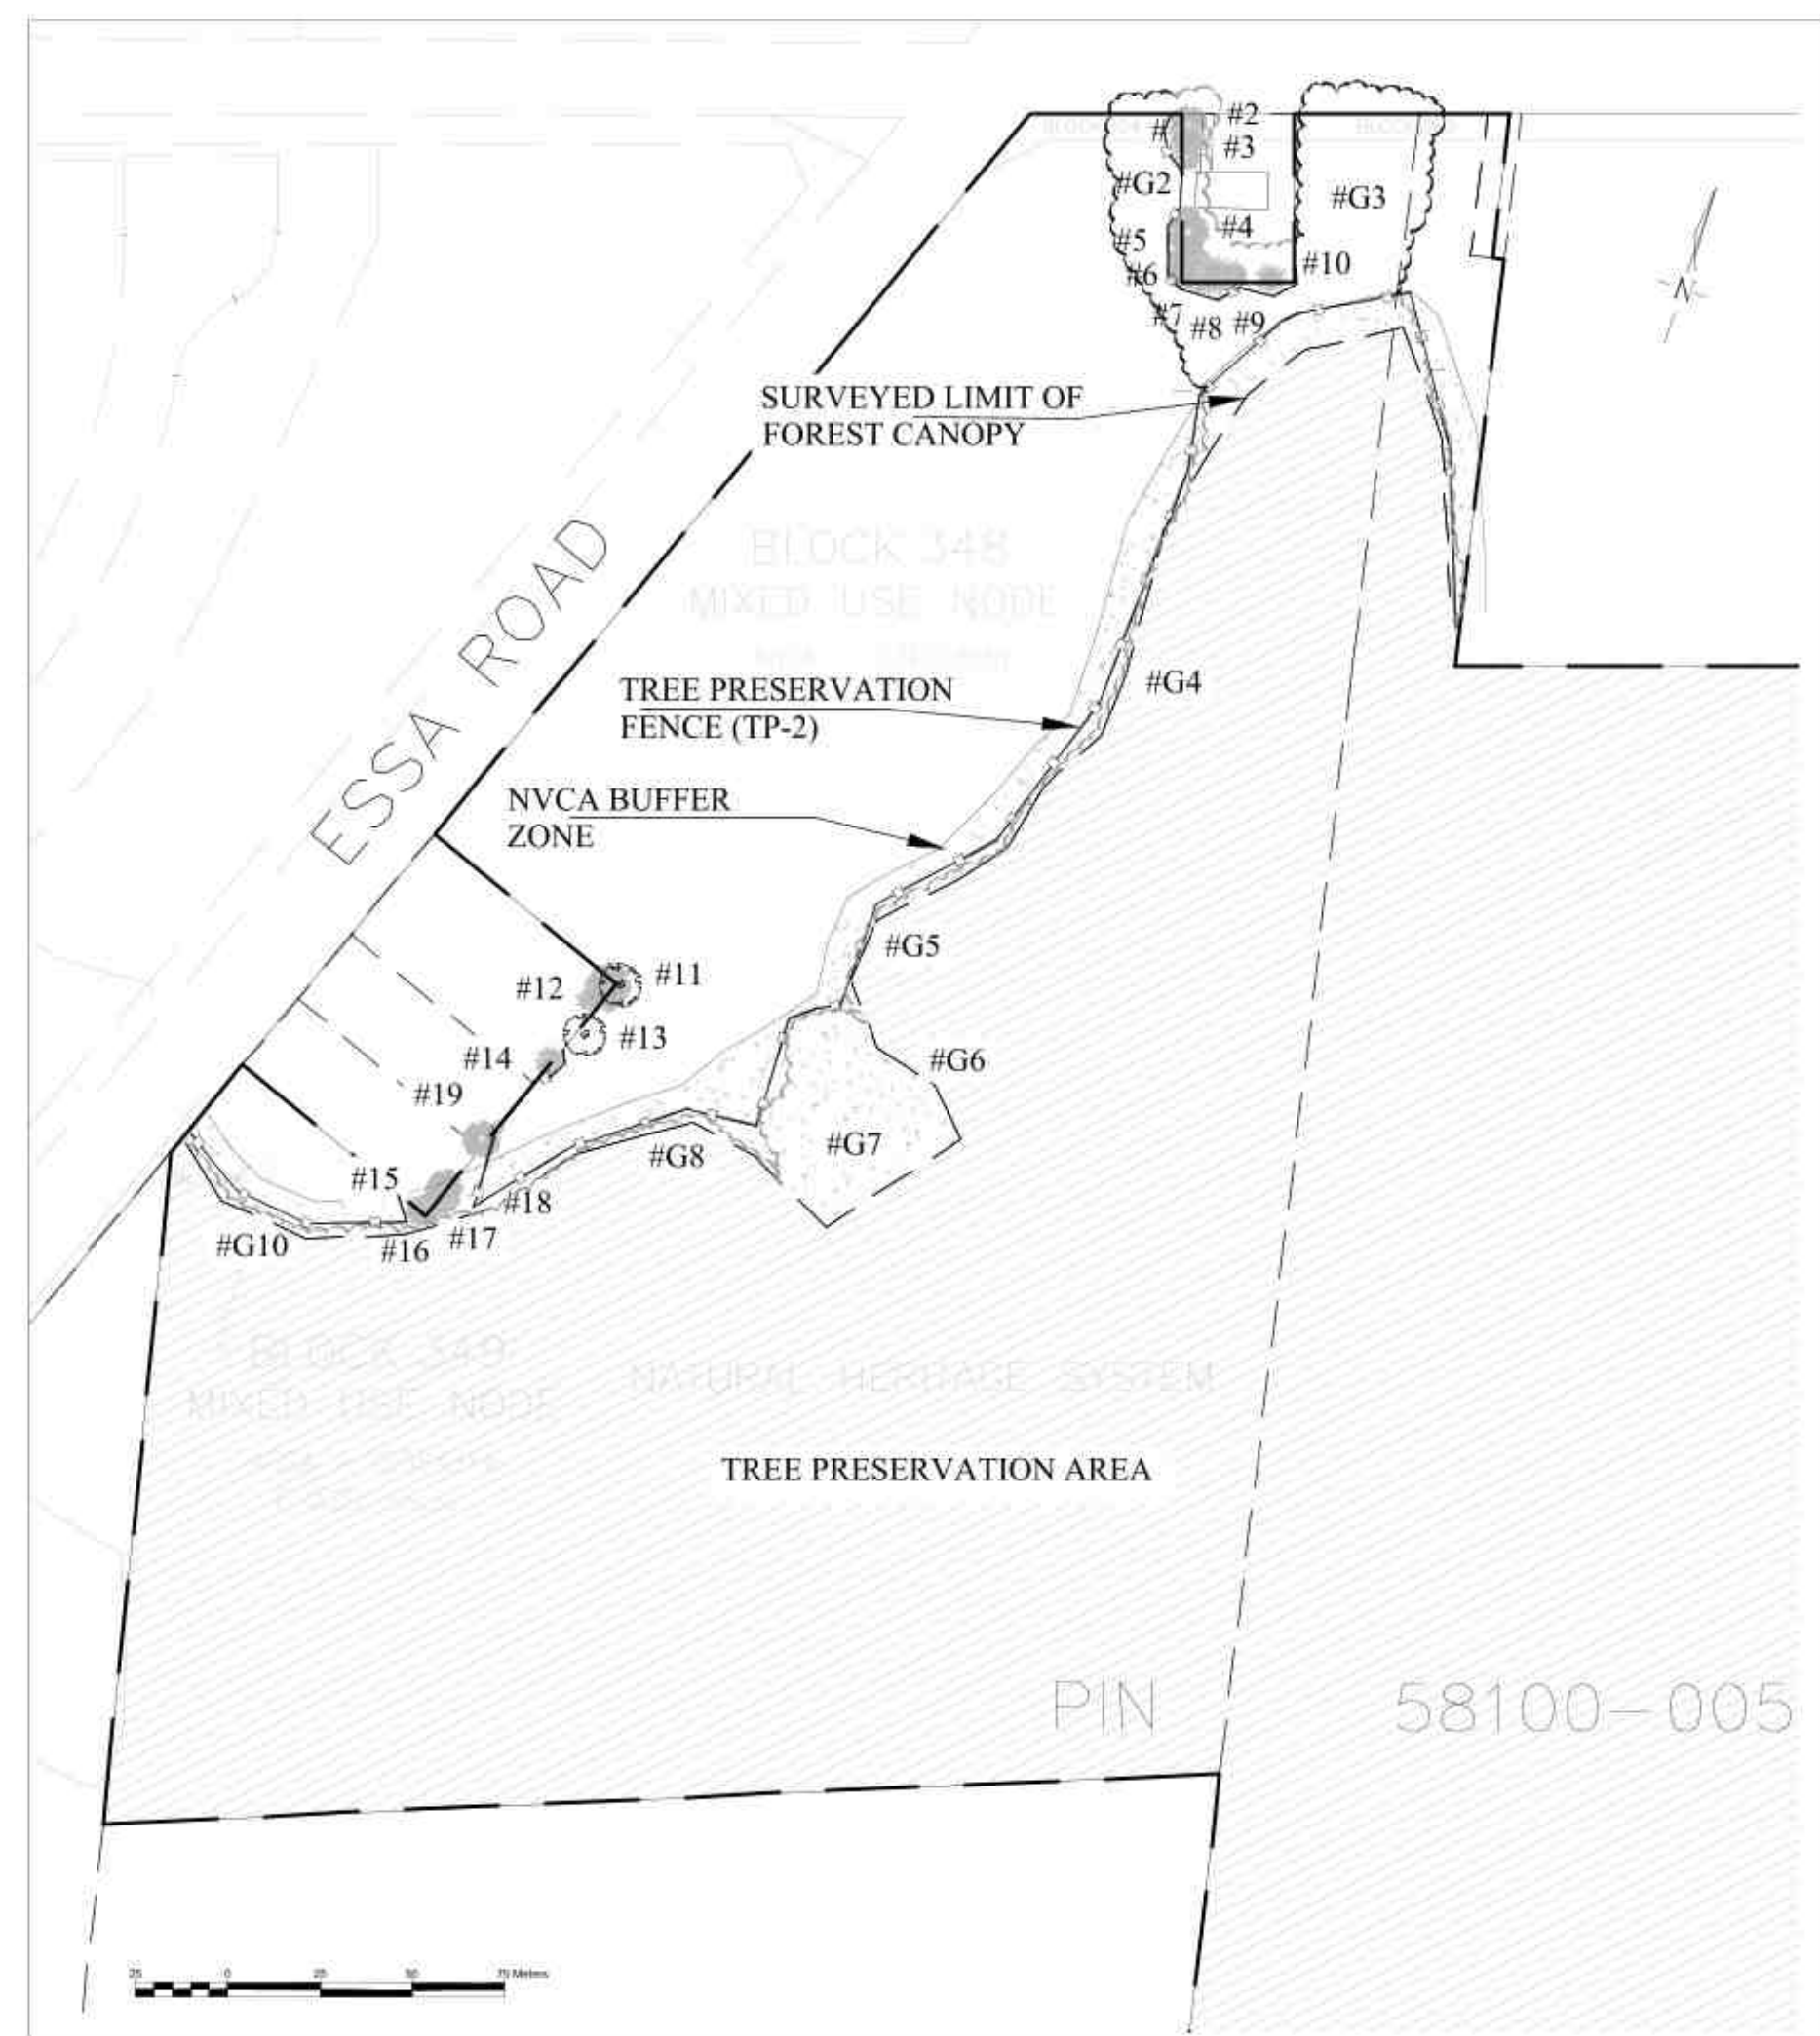

ALL DRAWINGS AND SPECIFICATIONS ARE INSTRUMENTS OF SERVICE, AND THE PROPERTIES OF JOB ASSOCIATES LIMITED DRAWINGS ARE NOT TO BE MODIFIED AND/OR REPRODUCED WITHOUT THE WRITTEN CONSENT OF JOB ASSOCIATES LIMITED. REPRODUCTION OF DRAWINGS IN ANY FORM WITHOUT THE WRITTEN CONSENT OF JOB ASSOCIATES LIMITED WILL BE CONSIDERED A VIOLATION OF THE TERMS OF THE AGREEMENT. JOB ASSOCIATES LIMITED ACCEPTS NO LIABILITY FOR THE DRAWING CONTENT OR WORKS RESULTING FROM SAID REPRODUCTION. DRAWINGS MAY BE REPRODUCED BY MUNICIPAL AND GOVERNMENT AGENCIES RESPONSIBLE FOR APPROVAL FOR THEIR OWN USE. JOB ASSOCIATES RESERVES THE RIGHT TO WITHDRAW ANY DRAWINGS FROM GOVERNMENT OR MUNICIPAL AGENCIES WHETHER APPROVED OR NOT IN THE EVENT THAT ACCOUNTS ARE NOT SETTLED OR REMAIN OUTSTANDING.

IT IS THE RESPONSIBILITY OF THE CONTRACTOR TO VERIFY ALL DIMENSIONS AND LOCATIONS OF EXISTING UTILITIES AND STRUCTURES FROM THE SUPPLIED INFORMATION TO THE LANDSCAPE ARCHITECT WITH THE PROJECT. JOB ASSOCIATES LIMITED IS NOT RESPONSIBLE FOR THE ACCURACY OF SURVEY, ARCHITECTURAL, MECHANICAL, ENGINEERING OR ELECTRICAL DRAWINGS WHICH ARE PROVIDED TO THE CONTRACTOR. THE CONTRACTOR SHALL BE RESPONSIBLE FOR VERIFYING ALL DIMENSIONS AND LOCATIONS OF EXISTING UTILITIES AND STRUCTURES TO APPROPRIATE SURVEY, ARCHITECTURAL, MECHANICAL, ENGINEERING OR ELECTRICAL DRAWINGS PRIOR TO PROCEEDING WITH ANY WORKS.

THIS DRAWING IS NOT TO BE SCALED.

'A'- TREE INVENTORY BLOCK 346 - REFER TO TREE INVENTORY LIST ON TP-2

Tree group	Canopy cover, %	Species	Common Name	Health condition	Freq. %	DBH, cm	Height, m	Comments
G2	15	<i>Pinus sylvestris</i>	Scot Pine	fair	15	≤19	8	Inactive, secondary growth
G3, G8, G10	80	<i>Pinus sylvestris</i>	Scot Pine	fair	65			
		<i>Pinus strobus</i>	White Pine	fair	5			
		<i>Picea glauca</i>	White Spruce	fair	5	≤30	12	Edge of the forest
		<i>Prunus serotina</i>	Black Cherry	fair	5			
		<i>Populus tremuloides</i>	Trembling Aspen	fair	70			
G4, G5, G6	90	<i>Picea glauca</i>	White Spruce	fair-good	5			
		<i>Pinus sylvestris</i>	Scot Pine	fair	5	~20	15	Inactive with red over-deposit in the secondary
		<i>Fraxinus americana</i>	White Ash	poor	5			
		<i>Thuja occidentalis</i>	Eastern White Cedar	fair	5			
		<i>Fraxinus americana</i>	White Ash	dead	-	-	-	all large ashes are dead
G7	50	<i>Pinus strobus</i>	White Pine	fair	5			
		<i>Prunus serotina</i>	Black Cherry	fair	5	~20	10	Inactive, including regeneration with white ash
		<i>Populus tremuloides</i>	Trembling Aspen	fair-poor	5			
		<i>Populus tremuloides</i>	Trembling Aspen	fair	45	~45		
		<i>Fraxinus americana</i>	White Ash	fair, dead	10	~30		
G11	90	<i>Ulmus americana</i>	White Elm	fair	5			
		<i>Betula papyrifera</i>	White Birch	fair	20	~20	16	Mature, all large ashes are dead
		<i>Pinus sylvestris</i>	Scot Pine	fair	5	~20		
		<i>Thuja occidentalis</i>	Eastern White Cedar	fair	5			
		<i>Populus tremuloides</i>	Trembling Aspen	fair	40			
G25	85	<i>Acer saccharum</i>	Sugar Maple	fair	20	~45	16	Mature, North side of the forest
		<i>Tilia americana</i>	Basswood	fair	15			
		<i>Prunus serotina</i>	Black Cherry	fair	10			
		<i>Populus tremuloides</i>	Trembling Aspen	fair	25	~45		
		<i>Fraxinus americana</i>	White Ash	fair	30	≤30		
G26	90	<i>Acer saccharum</i>	Sugar Maple	fair	30	~20	16	Mature, South side of the forest
		<i>Betula papyrifera</i>	White Birch	fair	5			
		<i>Tilia americana</i>	Basswood	fair	30			
		<i>Acer saccharum</i>	Sugar Maple	fair	30	~45	16	Fair, basswood fair-poor
		<i>Populus tremuloides</i>	Trembling Aspen	fair	25			
G27, G28	85	<i>Tilia americana</i>	Basswood	fair	20			
		<i>Acer saccharum</i>	Sugar Maple	fair	30	~45	16	Fair, basswood fair-poor, diobac
		<i>Populus tremuloides</i>	Trembling Aspen	fair	25			
		<i>Tilia americana</i>	Basswood	fair	20			
		<i>Quercus rubra</i>	Red Oak	fair	20	~30	14	Fair, basswood fair-poor, diobac
G29 (i)	60	<i>Acer saccharum</i>	Sugar Maple	fair	20			

TREE HEDGE TO BE REMOVED

SURVEYED LIMIT OF FOREST CANOPY

#G27

#G28

TREE HEDGES TO BE REMOVED

#G26

BN5

BN4

TREE PRESERVATION FENCE (TP-2)

BN3

NVCA BUFFER ZONE

#G26

TREE HEDGE TO BE REMOVED

#G29-1

#G29-2

#G29-3

LETTER OF CONSENT FROM THE ADJACENT DEVELOPER REQUIRED FOR REMOVAL OF THE BOUNDARY TREE HEDGES

STREET

BLOCK 351

BLOCK 352

BLOCK 353

BLOCK 354

BLOCK 355

BLOCK 356

BLOCK 357

BLOCK 358

BLOCK 359

BLOCK 360

BLOCK 361

BLOCK 362

BLOCK 363

BLOCK 364

BLOCK 365

BLOCK 366

BLOCK 367

BLOCK 368

BLOCK 369

BLOCK 370

BLOCK 371

BLOCK 372

BLOCK 373

BLOCK 374

BLOCK 375

BLOCK 376

BLOCK 377

BLOCK 378

BLOCK 379

BLOCK 380

BLOCK 381

BLOCK 382

BLOCK 383

BLOCK 384

BLOCK 385

BLOCK 386

BLOCK 387

BLOCK 388

BLOCK 389

BLOCK 390

BLOCK 391

BLOCK 392

BLOCK 393

BLOCK 394

BLOCK 395

BLOCK 396

BLOCK 397

BLOCK 398


BLOCK 399

BLOCK 400

PIN 58100-0056

0 10 20 30 Meters

0 10 20 30 Feet

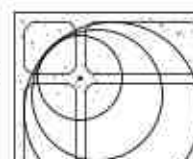	KLM Planning Partners Inc. 64 Jardin Drive, Unit 1B, Concord, Ontario L4K 3P3, TEL. (905) 669-4055 BASE PLAN REVISED: APRIL, 2002
DATE _____	Client info: WATERS AND CONSTRUCTION LTD. <i>c/o DG Group</i> 30 Floral Parkway, Suite 300 Concord, Ontario L4K 4R1  LANDSCAPE ARCHITECTS' STAMP
JDB ASSOCIATES LTD. <i>Urban Designers Landscape Architects Arborists</i> <i>274 Burton Ave., Suite 1201 Barrie, Ontario L4N 5H4</i>	 Fax: 705-722-5660 Tel: 705-722-6278

TREE HEDGES TO BE REMOVED