



647 Welham Road, Unit 14
Barrie, Ontario, L4N 0B7
P: (705) 719-7994
F: (888) 558-9424
www.centralearth.ca

HYDROGEOLOGICAL REPORT

Proposed Townhouse Development
910 Veterans Drive
Barrie, Ontario

Prepared For: 2528286 Ontario Inc.
Type of Document: Final Report
Reference Number: 19-1004A
Prepared By: Alexander Winkelmann, P.Eng
Date Issued: August 16, 2019 (Rev. 1)

Table of Contents

1	Introduction	1
2	Site Setting	1
2.1	Physiography, Surficial and Bedrock Geology	1
2.2	Topography and Drainage	2
2.3	MOECC Well Records	2
2.4	Nearby Boreholes by Other Consultants	3
2.5	Visual Inspection of Site	3
2.6	Regulatory Requirements	4
3	Procedures and Methodology	5
4	Subsurface Conditions	6
4.1	General Overview	6
4.2	Stratigraphy.....	7
4.3	Ground Water	7
5	Discussion and Analysis	9
5.1	Proposed Development Plan	9
5.2	Ground Water Control Methodology	9
5.3	Water Balance	10
5.4	Recommended Mitigation Measures	12
6	Limitations and Conclusion.....	14
6.1	Limitations.....	14
6.2	Conclusion	15

Table of Contents (Cont.)

Figures

Figure 1 – Site Location Plan

Figure 2A – Borehole Location Plan (Existing)

Figure 2B – Borehole Location Plan (Proposed)

Figures 3 – MOECC & Other Well Location Map

Figure 4A – Wellhead Protection Area Map

Figure 4B – Significant Groundwater Recharge Map

Figure 4C – Highly Vulnerable Aquifer Map

Figure 5 – Generalized Subsurface Profile

Appendices

Appendix A – Borehole Logs

Appendix B – Geotechnical Laboratory Data

Appendix C – Golder Borehole Logs

Appendix D – MOECC Well Records

Appendix E – Water Balance Analysis

1 Introduction

Central Earth Engineering Inc. (CEE) was retained by 2528286 Ontario Inc. c/o Innovative Planning Solutions to complete a hydrogeological investigation and report for 910 Veterans Drive in the City of Barrie. The site is bounded by Veterans Drive to the east, a residential property to the south and agricultural land to the north and west. A site location plan is provided as Figure 1. The existing property is approximately 90 metres long (north to south) and 80 metres wide (east to west). The property currently contains a single family detached residential dwelling with a detached shed and garage, with much of the site consisting of manicured lawn with some mature trees.

CEE was provided with the following for the property for review:

- “*Concept Plan ‘A’, 53 Units, Veteran’s Drive and McKay Rd, Salem Secondary Plan*”, File 18-769, dated March 20, 2019 by Innovative Planning Solutions.
- “*910 Veterans Drive, City of Barrie 53 Unit Back to Back Townhouse Development Functional Servicing & Storm Water Management Brief*”, Project No. 18-11393B, dated March 28th, 2019, by Pinestone Engineering Ltd.

Based on our review of the provided drawings and reports, it is proposed to demolish the existing residential buildings on site and construct four blocks of back to back townhouses for a total of 53 units. The townhouses will be 3 to 4 storeys high. A 12-metre-wide road will run north-south through the centre of the property and exit into the proposed low-density residential development that will eventually surround the site. Though the drawings show an 8-metre-wide road, it is understood that the most recent Draft Plan of Subdivision indicates that a 12-metre-wide road is required. Due to the proposed grading surrounding the site in other adjacent subdivisions, it is likely that approximately 3 metres of filling will be required to raise grades to match, though the exact amount of filling may change slightly during detailed design. Based on our correspondence, the townhomes will not have any underground basement levels (i.e. they will be slab-on-grade) and the depth for site servicing will be of typical depth for similar developments.

This revision (Revision 1, dated August 16, 2019) is prepared to address comments provided by both the Lake Simcoe Region Conservation Authority and the City of Barrie. Further details on the exact comments/questions and are responses are provided in the following letter report: “*Response to Geotechnical and Hydrogeological Comments Proposed 56 Unit Townhouse Development 910 Veterans Drive, Barrie, Ontario*”, Reference No. 19-1004A, dated August 16, 2019, by Central Earth Engineering Inc.

2 Site Setting

2.1 Physiography, Surficial and Bedrock Geology

The site is located within the physiographic area denoted as the Peterborough Drumlin Field (Chapman & Putnam, 1984). Based on surficial and bedrock geology mapping of the site by the Ontario Geological Survey, the surficial geology consists of stony, sandy silt to silty sand-textured till on Paleozoic terrain. Near the site, the surficial geology consists of ice-contact stratified deposits (sand and gravel, minor silt, clay and till). At depth, limestone bedrock of the Lindsay Formation is present.

2.2 Topography and Drainage

Topographic mapping by the MNRF and County of Simcoe show the site and surrounding area is generally flat, with a geodetic elevation near 310 metres. The topography gradually slopes to the southeast to Elevation 300 metres over approximately 850 metres.

This site is in the Lovers Creek subwatershed, which is part of the Lake Simcoe watershed. The Ontario Flow Assessment Tool (OFAT) by MNRF shows the site drains to the southeast into a tributary of Lovers Creek, about 650 metres southeast of the site. The tributary flows into Lovers Creek, which generally flows north and outlets into Kempenfelt Bay of Lake Simcoe.

It is understood that the post-development drainage direction will change and all run-off will be directed to the southwest corner of the site towards a storm water management pond located within the larger adjacent residential development. The proposed change in drainage area will not affect the water balance calculations included in this report but will need to be addressed in the storm water management report that will be prepared for the site by others.

2.3 MOECC Well Records

Ministry of the Environment and Climate Change water well records were obtained within 300 metres of the site area to assess the general nature of the ground water resource in near vicinity of the site, and historical/current uses of wells in the area. Nine (9) well records were found, and a summary of the data obtained from this review is presented below. The approximate well locations are shown on Figure 3.

One (1) of the wells within 300 metres of the site has been abandoned, with the remaining eight (8) either still in use, or not in use but have not been formally abandoned yet. The wells were originally installed for domestic drinking water supply with one of the wells installed for monitoring purposes. The boreholes for the wells were generally advanced to depths of 40 to 58 metres below grade, and the wells were screened where ground water was encountered around 35 to 57 metres below grade. One well record indicates the borehole was advanced to 14 metres below grade and ground water was encountered at a depth of 13 metres. Water levels from these well records generally provide information for deeper aquifers and may not accurately reflect shallower water levels near the site.

The stratigraphic descriptions within monitoring wells are typically inaccurate due to the methodology in which they are determined (observations of cuttings and no consistency between descriptions of soil between different drillers). Though this is the case, an overall sense of the deep stratigraphy can be determined by looking at commonalities between most stratigraphic descriptions and where the wells were terminated in an aquifer. In the area surrounding the site, the well records generally indicate that “sands” extend to depths of greater than 58 metres below grade. Some zones of “clay” were noted in some locations.

It is expected that the private, domestic drinking water wells are still in use in the 300-metre radius because the area is not serviced by municipal water.

2.4 Nearby Boreholes by Other Consultants

Three (3) boreholes with monitoring well installations were advanced within 300 metres of the site by Golder Associates in 2016. The borehole locations are shown on Figure 3.

BH16-4 was advanced to a depth of 11 metres below grade. It encountered a 200 mm thick topsoil layer, underlain by silty sand to 1.4 metres below grade, underlain by silty clay to 2.1 metres below grade, underlain by silt sand to sand that extended beyond the vertical depth of investigation at a depth of 11 metres. BH16-14 encountered 150 mm of topsoil underlain by silty sand to silt and sand glacial till that extended beyond the vertical depth of investigation at 5 metres below grade. BH16-16 encountered 130 mm of topsoil underlain by silty sand that extended beyond the vertical depth of investigation at 5 metres below grade.

The boreholes were dry upon completion of drilling. Monitoring wells were installed in the boreholes, summarized below.

Monitoring Well	Depth of Screen (m)	Strata Screened	Ground Water Level on May 4, 2016	
			Depth (m)	Elev. (m)
BH16-4	9.1 to 10.6	Silty sand to sand	Dry	
BH16-14	3.0 to 4.5	Silt & Sand Glacial Till	Not measured	
BH16-16	3.0 to 4.5	Silty sand	Dry	

Monitoring wells installed by Golder Associates about 1 km west of the site encountered ground water at about 2 to 4 metres below existing grade, however, they were installed near a marshy area which is likely a ground water recharge zone.

2.5 Visual Inspection of Site

The site is currently developed with a residential dwelling, two detached garages, a shed, and a paved driveway. The northern and western property edges are vegetated with mature coniferous trees, and the remaining property is partially vegetated with grass lawn and partially vegetated with mature deciduous, coniferous trees, and some shrubs. A shallow drainage swale runs along the eastern property limit, parallel to Veterans Drive.

Based on our preliminary visual estimates, it appears the following hard cover and soft cover surfaces exist:

- Hard Cover (5%):
 - Paved driveway: 2%
 - Buildings: 3%
- Soft Cover (95%):
 - Lawn: 46%
 - Trees/Shrubs: 49%

In general, surface drainage occurs as sheet drainage across the site, but channelized flow is expected in the drainage swale along Veterans Drive.

2.6 Regulatory Requirements

2.6.1 Source Water Protection

The following documents should be used in determination of the regulatory requirements when it comes to maintaining hydrogeological function at this site:

- “Lake Simcoe Protection Plan”, dated July 2009, by MOECC, MNR & LSRCA.
- “Approved South Georgian Bay Lake Simcoe Source Protection Plan”, dated January 26, 2015, by LSRCA.
- “Lake Simcoe Protection Plan Water Budget Policy for LSPP 4.8-DP and 6.40-DP,” dated November 2018, by LSRCA.

The Lake Simcoe Protection Plan (LSPP) Designated Policy (DP) 6.36 builds on the Provincial Policy Statement (PPS) and *Clean Water Act, 2006*, to define a Significant Groundwater Recharge Area (SGRA). The definition from the LSPP is below.

- “6.36-DP: A significant groundwater recharge area is an area identified,
 - as a significant groundwater recharge area by any public body for the purposes of implementing the PPS;
 - as a significant groundwater recharge area in the assessment report required under the *Clean Water Act, 2006*, for the Lake Simcoe and Couchiching/Black River Source Protection Area; or
 - by the LSRCA in partnership with MOE and MNR as an ecologically significant groundwater recharge area in accordance with the guidelines developed under policy 6.37.”

Based on Simcoe County and LSRCA mapping, the site is located in the following areas:

- Significant Groundwater Recharge Area (SGRA): The site is not located within a SGRA (Figure 4A);
- Wellhead Protection Area (WHPA): The site is located within a WHPA classified as Q2 (Figure 4B); and
- Highly Vulnerable Aquifer (HVA): The site is located within an HVA (Figure 4C).

“Lake Simcoe Protection Plan Water Budget Policy for LSPP 4.8-DP and 6.40-DP,” (by LSRCA, dated November 2018) Section 6.0 describes the policy hierarchy for water balance required for Lake Simcoe Watershed. The policies from most to least stringent are described below:

1. Source Protection Plan Land Use Policy (SPP LUP) 12: “Planning Approval Authorities shall only permit new major development (excluding single detached residential, barns and non-commercial structures that are accessory to an agricultural operation) in a WHPA-Q2 where the activity would be a significant drinking water threat, where it can be demonstrated through the submission of a hydrogeological study that the existing water balance can be maintained through the use of best management practices such as low impact development. Where necessary, implementation and maximization of off-site recharge enhancement within the same WHPA-Q2 to compensate for any predicted loss of recharge from the development.”
2. Designated Policy (DP) 6.40: “Outside of the Oak Ridges Moraine area, an application for major development within a significant groundwater recharge area (SGRA) shall be accompanied by an

environmental impact study that demonstrates that the quality and quantity of groundwater in these areas and the function of the recharge areas will be protected, improved or restored.”

3. Designated Policy (DP) 4.8 d): *“An application for major development shall be accompanied by a stormwater management plan that demonstrates: through an evaluation of anticipated changes in the water balance between pre-development and post-development, how such changes shall be minimized.”*

The proposed development is within a WHPA-Q2, therefore SPP LUP-12 applies. Due to the residential nature of the proposed development, no significant contaminating activities are expected to occur as per O.Reg 287/07 under the Clean Water Act, 2006 which prescribes 21 threats (with the exception of Threat 20: An activity that reduces the recharge of an aquifer). As the development is not within an SGRA as defined by the LSPP, DP-6.40 does not apply and an environmental impact study is not required. The proposed development at the site is considered a major development by the Lake Simcoe Protection Plan (LSPP) since more than 500 m² of impervious surface (buildings, parking lot) will be created. As the development is considered a “major” development, DP-4.8 also applies. As such, infiltration based low impact development measures are required to match pre and post-development water balances. This would also ensure that the requirements within SPP LUP-12 are met.

Based on Table 2 in “*Lake Simcoe Protection Plan Water Budget Policy for LSPP 4.8-DP and 6.40-DP*,” infiltration-based practices are permitted for low-density residential land for impervious (paved) areas. It is noted that runoff from vegetated areas and rooftops are always permitted and runoff from pollution hotspots are never permitted

In addition, the following policy will also apply at the site: “*Phosphorous Offsetting Policy*”, dated September 2017, by LSRCA. Section 4.4 Phosphorous Offsetting Policies in the above document discusses the applicable policies, including that the application for a major development “... *shall be accompanied by a Preliminary Phosphorous Budget as part of an overall Functional Servicing Report or Preliminary Stormwater Management Report.*” Phosphorous offsetting must be carried out as part of the stormwater management report to be completed for the site by others. Some additional details are provided in Section 5.4.3 of this report.

2.6.2 Temporary Groundwater Dewatering

The volume of water entering the excavation will be based on both ground water infiltration and precipitation events. Construction dewatering is governed by the following regulations:

- Ontario Water Resources Act, R.S.O. 1990, C. O.40;
- O. Reg. 387/04: Water Taking and Transfer; and
- O. Reg. 63/16: Registrations Under Part II.2 of the Act - Water Taking

Based on the regulations, the following dewatering limits and requirements are as follows:

- Construction Dewatering less than 50,000 L/day: The takings of both ground water and storm water does not require a hydrogeological report nor a Permit to Take Water (PTTW) from the Ministry of the Environment, Conservation and Parks (MECP).
- Construction Dewatering greater than 50,000 L/day and less than 400,000 L/day: The taking of ground water and/or storm water requires a hydrogeological report and registration to the Environmental Activity Sector Registry (EASR) but does not require a Permit to Take Water (PTTW) from the Ministry of the Environment, Conservation and Parks (MECP).

- Construction Dewatering greater than 400,000 L/day: The taking of ground water and/or storm water requires a hydrogeological report and requires a Category 3 Permit to Take Water (PTTW) from the Ministry of the Environment, Conservation and Parks (MECP).

3 Procedures and Methodology

Prior to the commencement of drilling activities, the locations of underground utilities including natural gas, electrical, telephone, water, etc. were marked out by public and private utility locating companies. The fieldwork for the drilling program was carried out on February 11, 2018. A total of three boreholes (Borehole 1 through 3) were advanced on site by Drilltech Drilling using a track-mounted drill rig. To advance the boreholes, continuous flight solid stem augers and standard soil sampling equipment was utilized. All samples were collected as per ASTM D1586 to assess the strength characteristics of the substrate.

The boreholes were advanced to 6.6 metres below existing grade (Elev. 94.3 to 93.52 metres). The horizontal locations were laid out in the field by Central Earth Engineering prior to the drilling operations and were spread evenly across the site. Geodetic elevation measurement of the ground surface of the borehole were measured based off a temporary benchmark chosen by CEE with an assumed Elev. 100.00 metres (centre line of road at centre of driveway to 910 Veterans Dr.) using a laser level. GPS measurements measured with a handheld GPS unit and referenced to the NAD 83 geodetic datum.

The field staff examined and classified characteristics of the soils encountered in the boreholes, including the presence of fill materials, made groundwater observations during and upon completion of the drilling, recorded observations of borehole construction, and processed the recovered samples. Soil sampling was conducted at regular intervals for the full depth of the borehole. The boreholes were backfilled upon completion. All recovered soil samples were logged in the field, carefully packaged and transported to the laboratory for more detailed examination and classification. In the laboratory, the samples were classified as to their visual and textural characteristics. Stabilized groundwater levels were measured in the three installed monitoring wells on February 13 and March 7, 2019.

4 Subsurface Conditions

4.1 General Overview

The detailed soil profiles encountered in the boreholes are indicated on the attached borehole logs in Appendix A. The borehole locations are shown on both an existing aerial photograph and the proposed site plan on Figures 2A and 2B, respectively. A generalized subsurface profile showing site-specific boreholes is provided as Figure 5. The results of geotechnical laboratory testing carried out on selected soil samples are provided in Appendix B.

It should be noted that the conditions indicated on the borehole logs are for specific locations only and can vary between and beyond the borehole locations. It should be noted that the soil boundaries indicated on the borehole logs are inferred from non-continuous sampling and observations during drilling. These boundaries are intended to reflect approximate transition zones and should not be interpreted as exact planes of geological change.

In addition, the descriptions provided in the borehole logs are inferred from a variety of factors, including: visual observations of the soil samples retrieved, laboratory testing, measurements prior to and after drilling, and the

drilling process itself (speed of drilling, shaking/grinding of the augers, etc.). The passage of time also may result in changes in conditions interpreted to exist at locations where sampling was conducted.

4.2 Stratigraphy

All the boreholes encountered a nominal surficial topsoil layer ranging in thickness between 150 to 600 mm. Underneath the surficial topsoil layer, all three boreholes encountered a sand and silt glacial till deposit with some gravel and trace clay that extended beyond the vertical extent of the investigation for Boreholes 1 and 2 (Elev. 94.2 to 93.6 metres) and to a depth of 3.1 metres below existing grade in Borehole 3 (Elev. 97.9 metres). The glacial till stratum was noted to contain a higher silt content in Boreholes 1 and 2 at a depth of 4.6 metres below existing grade (Elev. 95.6 and 96.2 metres, respectively). The deposit was noted to be brown in color and generally in a moist in-situ state.

SPT “N” Values measured in the deposit ranged between:

- 0 to 1.2 metres below existing grade: 6 to 37 blows per 300 mm of penetration.
- 1.2 to 6.6 metres below existing grade: 33 blows per 300 mm to greater than 50 blows per 150 mm of penetration.

Base on the above information the upper 1.2 metres has a loose to dense relative density, while below 1.2 metres below existing grade the sand and silt glacial till deposit has a dense to very dense relative density.

In Borehole 3 below the sand and silt glacial till deposit a deposit of fine sand with some silt, trace clay and trace gravel was encountered at 3.1 metres below existing grade (Elev. 97.9 metres) and extended to 6.1 metres (Elev. 94.8 metres). The deposit was noted to be brown and moist. SPT “N” Values obtained in the deposit were greater than 50 blows per 150 mm of penetration indicating a very dense relative density. Below the fine sand deposit, the same sand and silt glacial till stratum that was present above the fine sand deposit was encountered at 6.1 metres below existing grade (Elev. 94.8 metres) and extended beyond the depth of the investigation at 6.6 metres below existing grade (Elev. 94.4 metres). The glacial till deposit was noted to be brown and moist. SPT “N” Values obtained in the deposit was greater than 50 blows per 150 mm of penetration indicating a very dense relative density.

4.3 Ground Water

It is noted that no groundwater was encountered in the three monitoring wells installed on site. The ground water is significantly deep in this area of Barrie, and the components of the hydrogeological report that require ground water level measurements (i.e. ground water levels and flow direction, ground water chemical quality, single head response tests, etc.) are not considered warranted for the type of development proposed.

4.3.1 Ground Water Levels

Unstabilized ground water level measurements and cave measurements were taken upon completion of drilling of each borehole. These measurements provide a rough estimate of the possible excavation and temporary ground water control constructability considerations that may arise. All three boreholes were dry upon completion of drilling.

Monitoring wells were installed in each borehole consisting of 50 mm diameter PVC piping with 1.5 metre slotted screens. Well sand was used to backfill around the screens, and they were sealed with bentonite. The monitoring wells were noted to be dry on both February 13 and March 7, 2019. A summary of the groundwater level measurements is presented below.

Monitoring Well	Screened Location		Strata Screened	Ground Water Level on February 13, 2019		Ground Water Level on March 7, 2019	
	Depth (m)	Local Elev. (m)		Depth (m)	Local Elev. (m)	Depth (m)	Local Elev. (m)
1	4.6 to 6.1	95.5 to 94.0	Silt & Sand (Glacial Till)	Dry		Dry	
2	4.6 to 6.1	96.2 to 94.7	Silt & Sand (Glacial Till)	Dry		Dry	
3	4.7 to 6.2	96.2 to 94.7	Fine Sand	Dry		Dry	

Based on the results of the water levels and the moisture contents of the soil within the boreholes, the prevailing ground water table is expected to be relatively deep and beyond 6.2 metres below existing grade (beyond local Elevation 94.0 metres). The well records within a 300-metre radius encountered water at a depth of 35 metres or more below grade, however these levels generally reflect deeper aquifer levels and not shallower water levels. It is expected that the static ground water table is likely between 10 to 15 metres below existing grade.

Subsequent monthly monitoring ground water level readings were conducted until June 25, 2019, with details provided in the following report: “*Monthly Water Level Readings, Proposed 56 Unit Townhouse Development, 910 Veterans Drive, Barrie, Ontario*”, Reference No. 19-1004A, dated August 6, 2019, by Central Earth Engineering. No ground water was noted in any of the monitoring wells during this monitoring, and therefore the seasonal high ground water level is also considered to be beyond 6.2 metres below existing grade (beyond local Elevation 94.0 metres) as the monitoring was conducted during the spring months.

The monitoring wells are recommended to be decommissioned following MOECC Ontario Regulation 903 once they are no longer in use and prior to development.

4.3.2 Permeability and Infiltration

Rising head tests could not be completed at the site because the monitoring wells were dry. The hydraulic conductivities of site soils were estimated from grain size distribution curves (as provided in Appendix B). According to Freeze and Cherry (1979), the typical hydraulic conductivity of the strata investigated are:

- Silt and Sand Glacial Till: 10^{-7} m/s to 10^{-8} m/s
- Sand, Some Silt: 10^{-4} m/s to 10^{-5} m/s

Determination of percolation rate are based on the “*Ontario Ministry of Municipal Affairs and Housing (OMMAH), Supplementary Guidelines to the Ontario Building Code 1997. SG-6 Percolation Time and Soil Descriptions, 1997*”. The near surface soils at this site would be characterized as an M.L. under the Unified Soil Classification System. Based on this document and the soil type, the estimated percolation rate for the near surface soils would be 20

mins/cm (infiltration rate of 30 mm/hr). Grain size analysis is not typically sufficiently accurate and in-situ percolation testing using a Guelph Permeameter may be required in the vicinity of any proposed infiltration based Low Impact Development facilities to more accurately determine the percolation rate for detailed design.

It is noted that the grade of the site will be raised by approximately 3 metres. Based on this, infiltration based Low Impact Development measures will likely be within imported soils and should only be tested once confirmation of the material make up of soils being brought to site have been confirmed. In-situ percolation testing using a Guelph Permeameter of the native underlying soils may not be necessary.

4.3.3 Baseline Groundwater Chemical Testing

No groundwater was encountered within the monitoring wells. As such, no baseline chemical testing was conducted.

5 Discussion and Analysis

5.1 Proposed Development Plan

CEE was provided with the following for the property for review:

- “*Concept Plan ‘A’, 53 Units, Veteran’s Drive and McKay Rd, Salem Secondary Plan*”, File 18-769, dated March 20, 2019 by Innovative Planning Solutions.
- “*910 Veterans Drive, City of Barrie 53 Unit Back to Back Townhouse Development Functional Servicing & Storm Water Management Brief*”, Project No. 18-11393B, dated March 28th, 2019, by Pinestone Engineering Ltd.

Based on our review of the provided drawings and reports, it is proposed to demolish the existing residential buildings on site and construct four blocks of back to back townhouses for a total of 53 units. The townhouses will be 3 to 4 storeys high. A 12-metre-wide road will run north-south through the centre of the property and exit into the proposed low-density residential development that will eventually surround the site. Though the drawings show an 8-metre-wide road, it is understood that the most recent Draft Plan of Subdivision indicates that a 12-metre-wide road is required. Due to the proposed grading surrounding the site in other adjacent subdivisions, it is likely that approximately 3 metres of filling will be required to raise grades to match, though the exact amount of filling may change slightly during detailed design. Based on our correspondence, the townhomes will not have any underground basement levels (i.e. they will be slab-on-grade) and the depth for site servicing will be of typical depth for similar developments.

5.2 Ground Water Control Methodology

5.2.1 Temporary Construction Ground Water Control

The volume of water entering the excavation will be based on both ground water infiltration and precipitation events. As excavations are expected to be above the prevailing ground water table, there should be limited ground water control issues present. During times of high precipitation, some water may collect at the base of the excavation. Local sumps placed at the base of the excavation can typically control groundwater seepage in this scenario.

As per O.Reg. 63/16, as construction dewatering will be less than 50,000 L/day, the takings of both ground water and storm water does not require a hydrogeological report nor a Permit to Take Water (PTTW) from the Ministry of the Environment, Conservation and Parks (MECP).

As no groundwater will be taken as part of the construction activities due to the depth of the seasonally high groundwater table, no temporary drawdown of the groundwater table will occur that would adversely effect the groundwater quantity of neighbouring properties that utilize drinking water wells as the source of their potable water.

5.2.2 Building Permanent Drainage

Where possible, the ground surface should be sloped on a positive grade away from the proposed townhouses to promote surface water run-off and to reduce groundwater infiltration adjacent to underground levels and foundations. To minimize infiltration of surface water, the upper 150 mm of backfill should comprise compacted relatively impervious soil material, where possible.

Perimeter drainage at the foundation level is not required, provided that the underside of concrete slab is at least 200 mm above the prevailing grade of the site and the surrounding surfaces slope away from the building at a gradient of at least 2 percent. For the portions of the slab below prevailing grade, and for any pits or chambers made below grade level, perimeter drainage or waterproofing is required.

It is noted that City of Barrie engineering standards require that there be at least a 0.5 metre separation between the seasonal high groundwater level and the invert of the proposed floor slabs of the building. It is noted that:

- All monitoring wells were measured to be dry during the spring months, indicating that the seasonally high groundwater level is beyond 6 metres below existing grade;
- Grade is to be raised by approximately 3 metres;
- The buildings are currently proposed to be slab-on-grade buildings.

Based on the above, there is therefore a minimum of 9 metres (or more) of grade separation between the seasonally high groundwater level and the invert of the proposed floor slabs.

5.3 Water Balance

5.3.1 Water Balance Components

A water balance is an accounting of the water resources within a given area. The water balance equates the precipitation (P) over a given area to the summation of the change in ground water storage (S), evapotranspiration/evaporation (ET), surface water runoff (R) and infiltration (I) using the following equation:

$$P = S + I + ET + R$$

The components of the water balance vary in space and time and depend on climatic conditions as well as the soil and land cover conditions (i.e., rainfall intensity, land slope, soil hydraulic conductivity and vegetation). For example, runoff occurs at a higher percentage during periods of snowmelt when the ground is frozen or during intense rainfall events.

Precise measurement of the water balance components is difficult, and as such, approximations and simplifications are made to characterize the water balance of a property. Field observations of the drainage conditions, land cover and soil types, groundwater levels and local climatic records are important inputs to the water balance calculations.

- Precipitation (P): For the purposes of approximating the annual precipitation at this site, the monthly rainfall between 1981 and 2010 was used based on data Government of Canada historical weather data for the Barrie WPCC weather station (Climate ID 6110557 – 44.38 N, Longitude 79.69 W, Elevation 229 metres).
- Storage (S): Although there are groundwater storage gains and losses on a short-term basis, the net change in groundwater storage on a long-term basis is assumed to be zero.
- Evapotranspiration/Evaporation (PET): The evapotranspiration and evaporation components vary based on the characteristics of the land surface cover (i.e., type of vegetation, soil moisture conditions, perviousness of surfaces, etc.). Potential evapotranspiration refers to the water loss from a vegetated surface to the atmosphere under conditions of an unlimited water supply. Evaporation occurs from a hard surface (such as flat rooftops, asphalt, etc.).
- Water Surplus (R + I): The difference between the mean precipitation and evapotranspiration is referred to as the water surplus. The water surplus is divided into two parts: as surface or overland runoff (R) and the infiltration into the surficial soil (I). The infiltration is comprised of two end member components: one component that moves vertically downward to underlying aquifers (referred to as percolation, deep infiltration or net recharge) and a second component that moves laterally through the near surface soil profile or shallow soils as interflow that re-emerges locally to surface (i.e., as runoff) at some short distance and time following precipitation.

5.3.2 Approach and Methodology

The analytical approach to calculate the water balance involves monthly soil-moisture balance calculations to determine the pre-development (based on existing land use) infiltration volumes. The detailed water balance calculations are provided in Appendix E, which are summarized in this and subsequent sections of the report. The following assumptions were used as part of the soil-moisture balance calculations:

- A soil moisture balance approach assumes that soils do not release water as potential recharge while a soil moisture deficit exists.
- During wetter periods, any excess of precipitation over evapotranspiration first goes to restore soil moisture. Considering the nature of the predominantly cohesionless near surface soils in the area and grassed lawn, a soil moisture storage capacity of 150 mm was used.
- Once the soil moisture deficit is overcome, any further excess water can then pass through the soil as infiltration and either become interflow (indirect runoff) or recharge (deep infiltration).

Monthly potential evapotranspiration calculations accounting for latitude, climate and the actual evapotranspiration and water surplus components of the water balance based on the monthly precipitation and soil moisture conditions was calculated. The MOECC SWM Planning and Design Manual (2003) methodology for calculating total infiltration based on topography, soil type and land cover was used, and a corresponding infiltration factor was calculated. The water surplus was multiplied by the infiltration factor to determine both the pre-existing and post-condition annual volumes for run-off and infiltration for the property.

A post-development water balance scenario was also calculated based on the proposed land development plan. Based on the proposed development plan provided to CEE, it was estimated that there would be an increase to approximately 85% of the ground surface being covered in hard surfaces such as buildings, roads or driveways.

It is noted that the infiltration and runoff values presented in Appendix E are estimates only. Single values are used for the water balance calculations, but it is important to understand that infiltration rates are dependent upon the hydraulic conductivity of the surficial soils which may vary over several orders of magnitude. As such, the margins of error for the calculated infiltration and runoff component values are potentially quite large. These margins of error are recognized, but for the purposes of this assessment, the numbers used in the water balance calculations are considered reasonable estimates based on the site-specific conditions and useful for comparison of pre- to post-development conditions.

5.3.3 Pre and Post Water Balance

The pre-development water balance calculations based on the existing land use considering 5% hard cover and 95% soft cover of the site. The pre-development average annual infiltration volume on the property was calculated to be about 1,745 m³/year and the total runoff volume from the property was calculated to be about 725 m³/year.

Based on the proposed development plan, a post-development water balance was calculated considering an increase in hard cover from 5% to 85% which would consider the townhouses, sidewalks, roadways and driveways being constructed at this site. The post-development average annual infiltration volume on the property was calculated to be about 275 m³/year and the total runoff volume from the property was calculated to be about 5,025 m³/year.

These calculations suggest that, without mitigation such as low impact development measures, the proposed development will increase the surface water runoff volume by about 7 times and reduce shallow infiltration to about 15%. The potential impacts of these changes and recommended mitigation measures are discussed below.

5.4 Recommended Mitigation Measures

5.4.1 Runoff Quantity

Urban development of an area affects the natural water balance. The most significant difference is the addition of impervious surfaces as a type of surface cover (i.e., roads, parking lots, driveways, and rooftops). Impervious surfaces prevent infiltration of water into the soils and the removal of the vegetation reduces the evapotranspiration component of the natural water balance. The evaporation component from impervious surfaces is relatively minor (estimated to be 15% of precipitation) compared to the evapotranspiration component that occurs with vegetation in this area (up to two thirds of precipitation). So, the net effect of the urbanization of the site is that most of the precipitation that falls onto impervious surfaces increases the surplus water resulting in more direct runoff from developed areas and reduced natural infiltration.

In conjunction with increased run-off, there is a reduction in infiltration to the shallow groundwater system. A reduction in infiltration can potentially lead to a lowering of the local water table and reduce the potential for this seasonal water table intersection and discharge.

Methods which do not necessarily increase infiltration rate, but decrease the volume and concentration of surface water run-off can be considered at this site:

- Increasing the topsoil thickness by about two times the normal thickness (up to 30 cm) to retain more water in storage; and
- Implementation of rainwater harvesting which intercepts, diverts and stores roof runoff (i.e. cisterns) for future use.

5.4.2 Mitigation Measures for Maintaining Infiltration

The increases in surface water runoff that will occur with urban development and mitigation of the potential impacts to the local water table due to reduction of infiltration may be minimized by using appropriate stormwater management and using low impact development (LID) measures to promote infiltration. These measures can be implemented on-site, or within the larger residential development that this site will be integrated into to the west where more land space may be available to build these LID measures.

The basic premise for low impact development is to try to minimize changes to runoff and infiltration. As outlined in the MOECC SWMP Design Manual (2003) and Low Impact Development Stormwater Management Planning and Design Guide published by the CVC and TRCA (2010), there are a suite of techniques that may be considered to promote infiltration and reduce runoff. In order to maintain ground water function at the site the following typical LID measures can be considered as part of typical site developments:

- Collection of run-off from the building rooftops and redirection to grass areas and overland flow. It must be demonstrated that there will be a minimum 5 metre flow path over pervious areas to allow this mitigation method to be effective;
- Provision of gentle slopes in open areas or along drainage ditches in order to allow time for water infiltration.
- Construction of engineered infiltration measures such as soakaway pits, infiltration galleries or bioswales (subsurface infiltration methods can only be considered in areas where there is sufficient soil permeability and depth to water table to accommodate the systems within the unsaturated zone); and
- Construction of grass channels or filter strips which allow infiltration, discharge at a lower rate and direct roof runoff to overland flow.

Implementation of LID measures will not only allow for infiltration of the surface water into the near-surface groundwater regime but allow for increase in natural filtration of surficial run-off, prevent sedimentation transport and potential erosion, and help reduce flooding by increasing the transit time for water on the site. These types of LID techniques promote natural infiltration by providing additional water volumes in the pervious areas. This is particularly effective in the summer months, when natural infiltration would not generally occur because the additional water overcomes the natural soil moisture deficit.

It is understood that stormwater from the roof areas and pervious areas for the site will be infiltrated, and details will be provided by others in a stormwater management report for the site (by others). This includes demonstrating through plans and sections (including all dimensions, materials used and including the seasonal high groundwater level) how this infiltration deficit will be mitigated. In addition, the stormwater management report will need to

include calculations to demonstrate that the LID facilities will be adequately sized both volumetrically and for area to allow completed drawdown within a 24 to 48 hours time period.

As it is a requirement of maintaining the same levels of infiltration post construction, no appreciable change in the groundwater table elevation should occur over the long-term condition. As such, the no adverse effects to the groundwater quantity of neighbouring properties that utilize drinking water wells as the source of their potable water.v

5.4.3 Groundwater Quality

Depending on land use, runoff from urban developments may contain a variety of dilute contaminants such as suspended solids, chloride from road salt, oil and grease, metals, pesticide residues, bacteria and viruses. For groundwater, generally except for the dissolved constituents such as nitrogen and salt, most contaminants are attenuated by filtration during groundwater flow through the soils.

The potential for effects on groundwater quality from infiltration in the proposed development area is expected to be limited due to the residential nature of the site and will not effect local drinking water wells in the vicinity of the site. Any potential changes to the shallow groundwater quality are not expected to influence the surface water quality in the flow to either Lake Simcoe or the minor watercourses further south considering the limited groundwater discharge volumes.

Phosphorous removal will need to be addressed in the stormwater management report to be prepared for the site by others. “*LSRCA Technical Guidelines for Stormwater Management Submissions*” (dated September 1, 2016, by LSRCA) states that 80% removal of annual Total Phosphorous is required and provides a list of typical phosphorous removal rates for various stormwater management best management practices. LID measures are recommended for this site to maintain the pre to post development water balance. LID’s used in a treatment train approach remove phosphorous, and some typical removal rates are 60% for infiltration trenches, 65% for vegetated filter strips, and 87% for perforated pipe infiltration / exfiltration system based on the LSRCA guidelines.

6 Limitations and Conclusion

6.1 Limitations

The investigation and comments are necessarily on-going as new information of underground conditions becomes available. More specific information with respect to the conditions between samples, or the lateral and vertical extent of materials may become apparent during excavation operations. The interpretation of the borehole information must, therefore, be validated during excavation operations. Consequently, during the future development of the property, conditions not observed during this investigation may become apparent. Should this occur, Central Earth Engineering should be contacted to assess the situation and additional testing and reporting may be required.

Central Earth Engineering should be retained for a general review of the final design drawings and specifications to verify that this report has been properly interpreted and implemented. If not accorded the privilege of making this review, Central Earth Engineering will assume no responsibility for interpretation of the recommendations in the report. For example, it should be appreciated that modifications to bearing levels may be required if unforeseen

subsoil conditions are revealed after the excavation is exposed to full view or if final design decisions differ from those assumed in this report.

The comments given in this report are intended only for the guidance of the design engineers. The number of boreholes required to determine the localized underground conditions between boreholes affecting construction costs, techniques, sequencing, equipment, scheduling, etc. could be greater than has been carried out for design purposes. Contractors bidding on or undertaking the works should, in this light, decide on their own investigations, as well as their own interpretations of the factual borehole results, so that they may draw their own conclusions as to how the subsurface conditions may affect them.

This report was prepared by Central Earth Engineering for the account of 2528286 Ontario Inc. Any use which a third party makes of this report, or any reliance on or decisions to be made based on it, are the responsibility of such third parties. Central Earth Engineering accepts no responsibility for damages, if any, suffered by any third party as a result of decisions made or actions based on this project.

6.2 Conclusion

It is recognized that municipal/regional governing bodies, in their capacity as the planning and building authority under Provincial statutes, will make use of and rely upon this report, cognizant of the limitations thereof, both as are expressed and implied.

We trust this report is complete within our terms of reference, and the information presented is sufficient for your present purposes. If you have any questions, or when we may be of further assistance, please do not hesitate to contact our office.

Yours Truly,

Central Earth Engineering Inc.



Alexander Winkelmann, P.Eng.
President



Figures


SITE LOCATION PLAN

BOREHOLE LOCATION PLANS

MECP & OTHER WELL LOCATION PLAN

REGULATORY MAPPING

GENERALIZED SUBSURFACE PROFILE

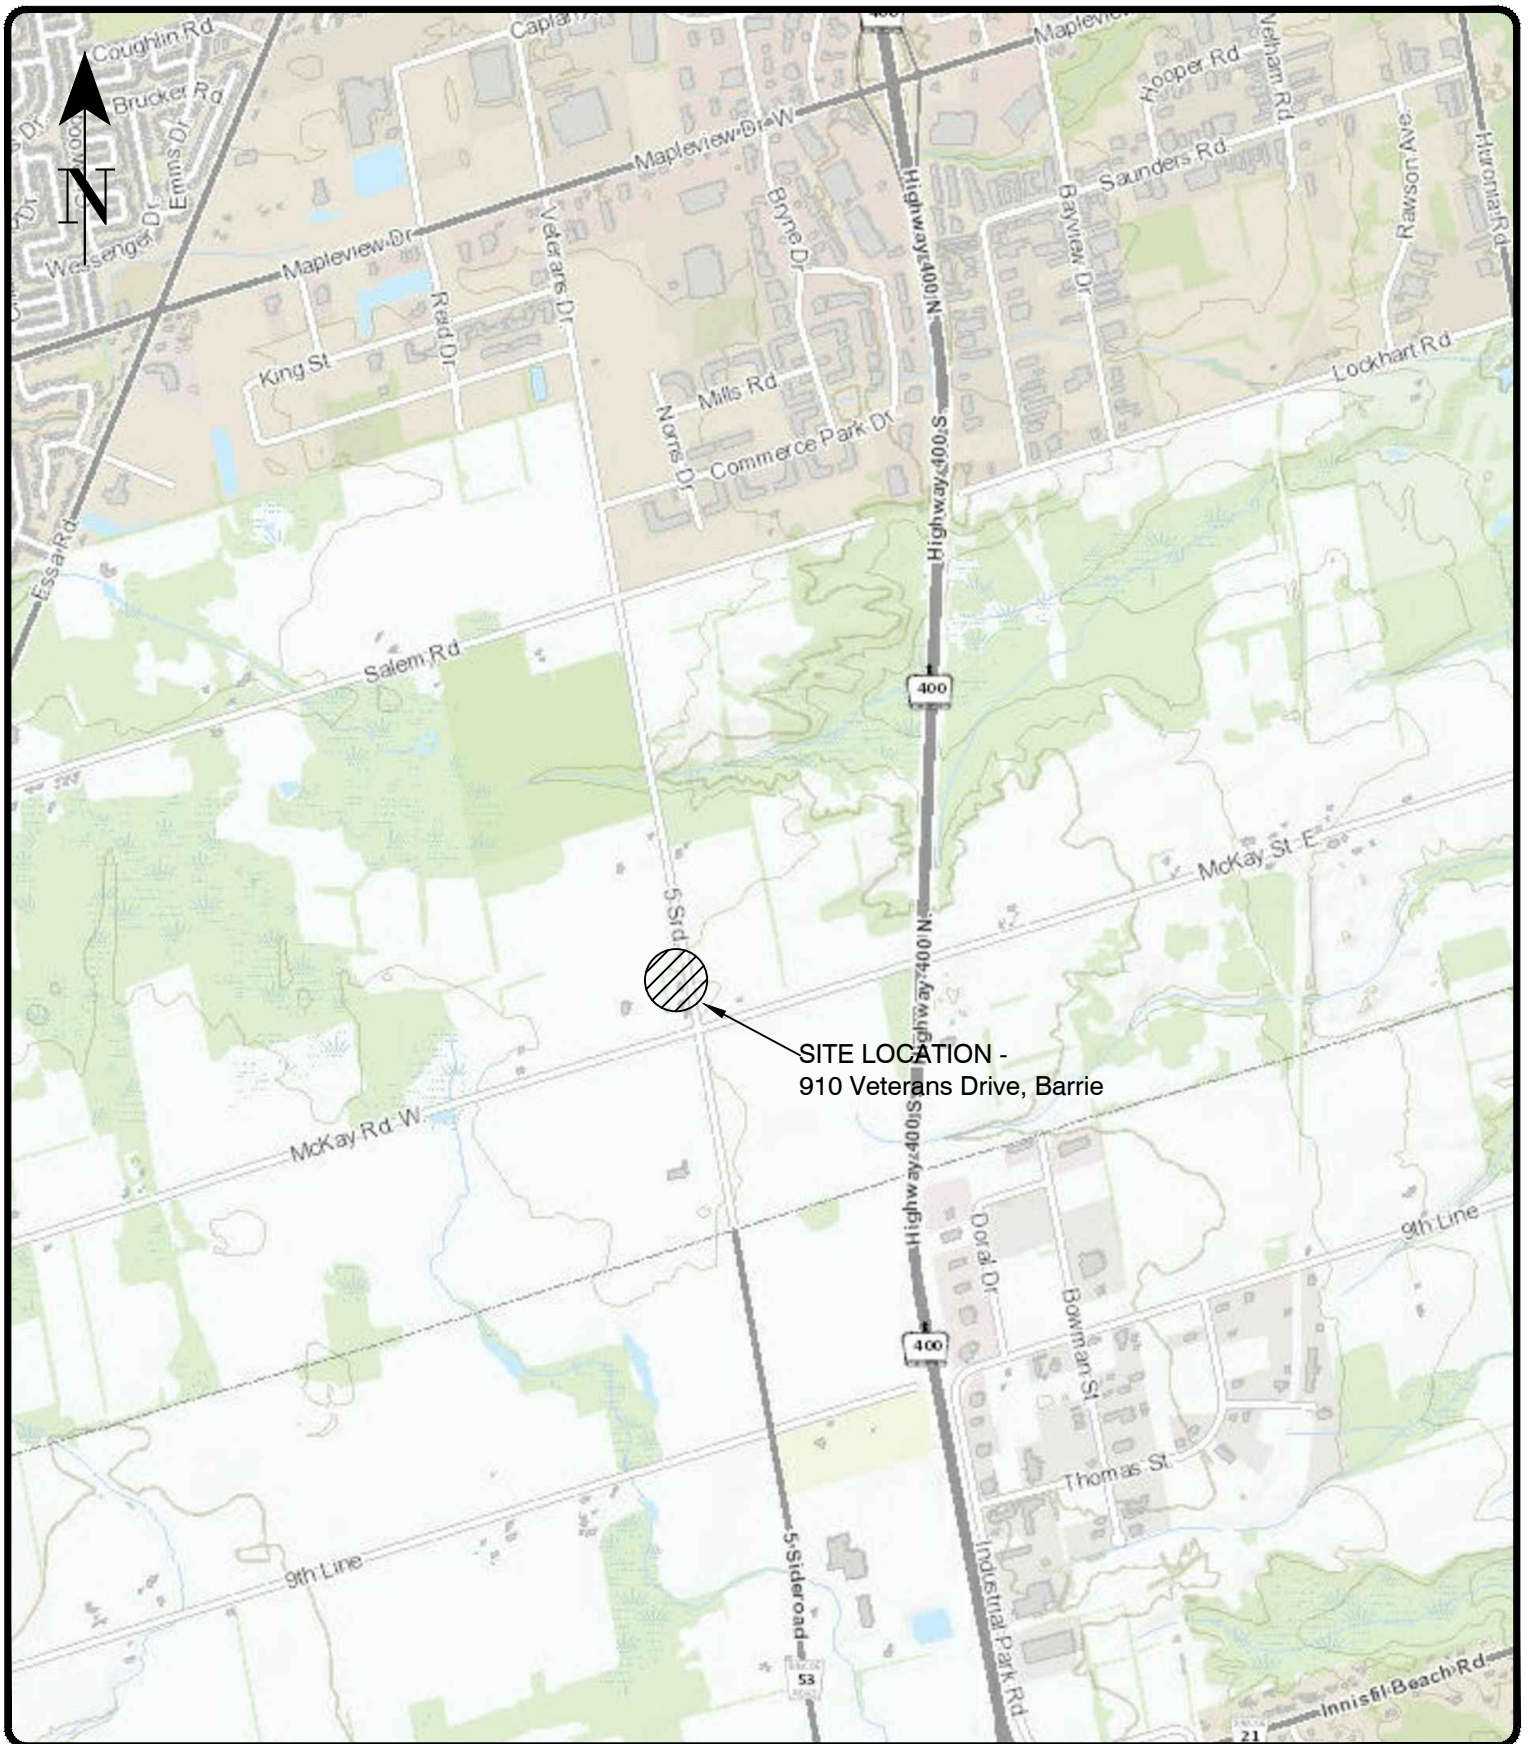


SITE LOCATION -
910 Veterans Drive, Barrie



Geotechnical Engineering and Construction
Materials Testing & Inspection

647 Welham Rd, Unit 14, Barrie, ON, L4N 0B7
P: (705) 719-7994 | E: info@centralearth.ca


Project:		910 Veterans Drive, Barrie	
Title:		SITE LOCATION PLAN	
Approved by:	AW	Date:	Jan. 2019
Project No.:	19-1004A		
Drawn by:	AW	Scale:	N.T.S
Figure No.:	1		

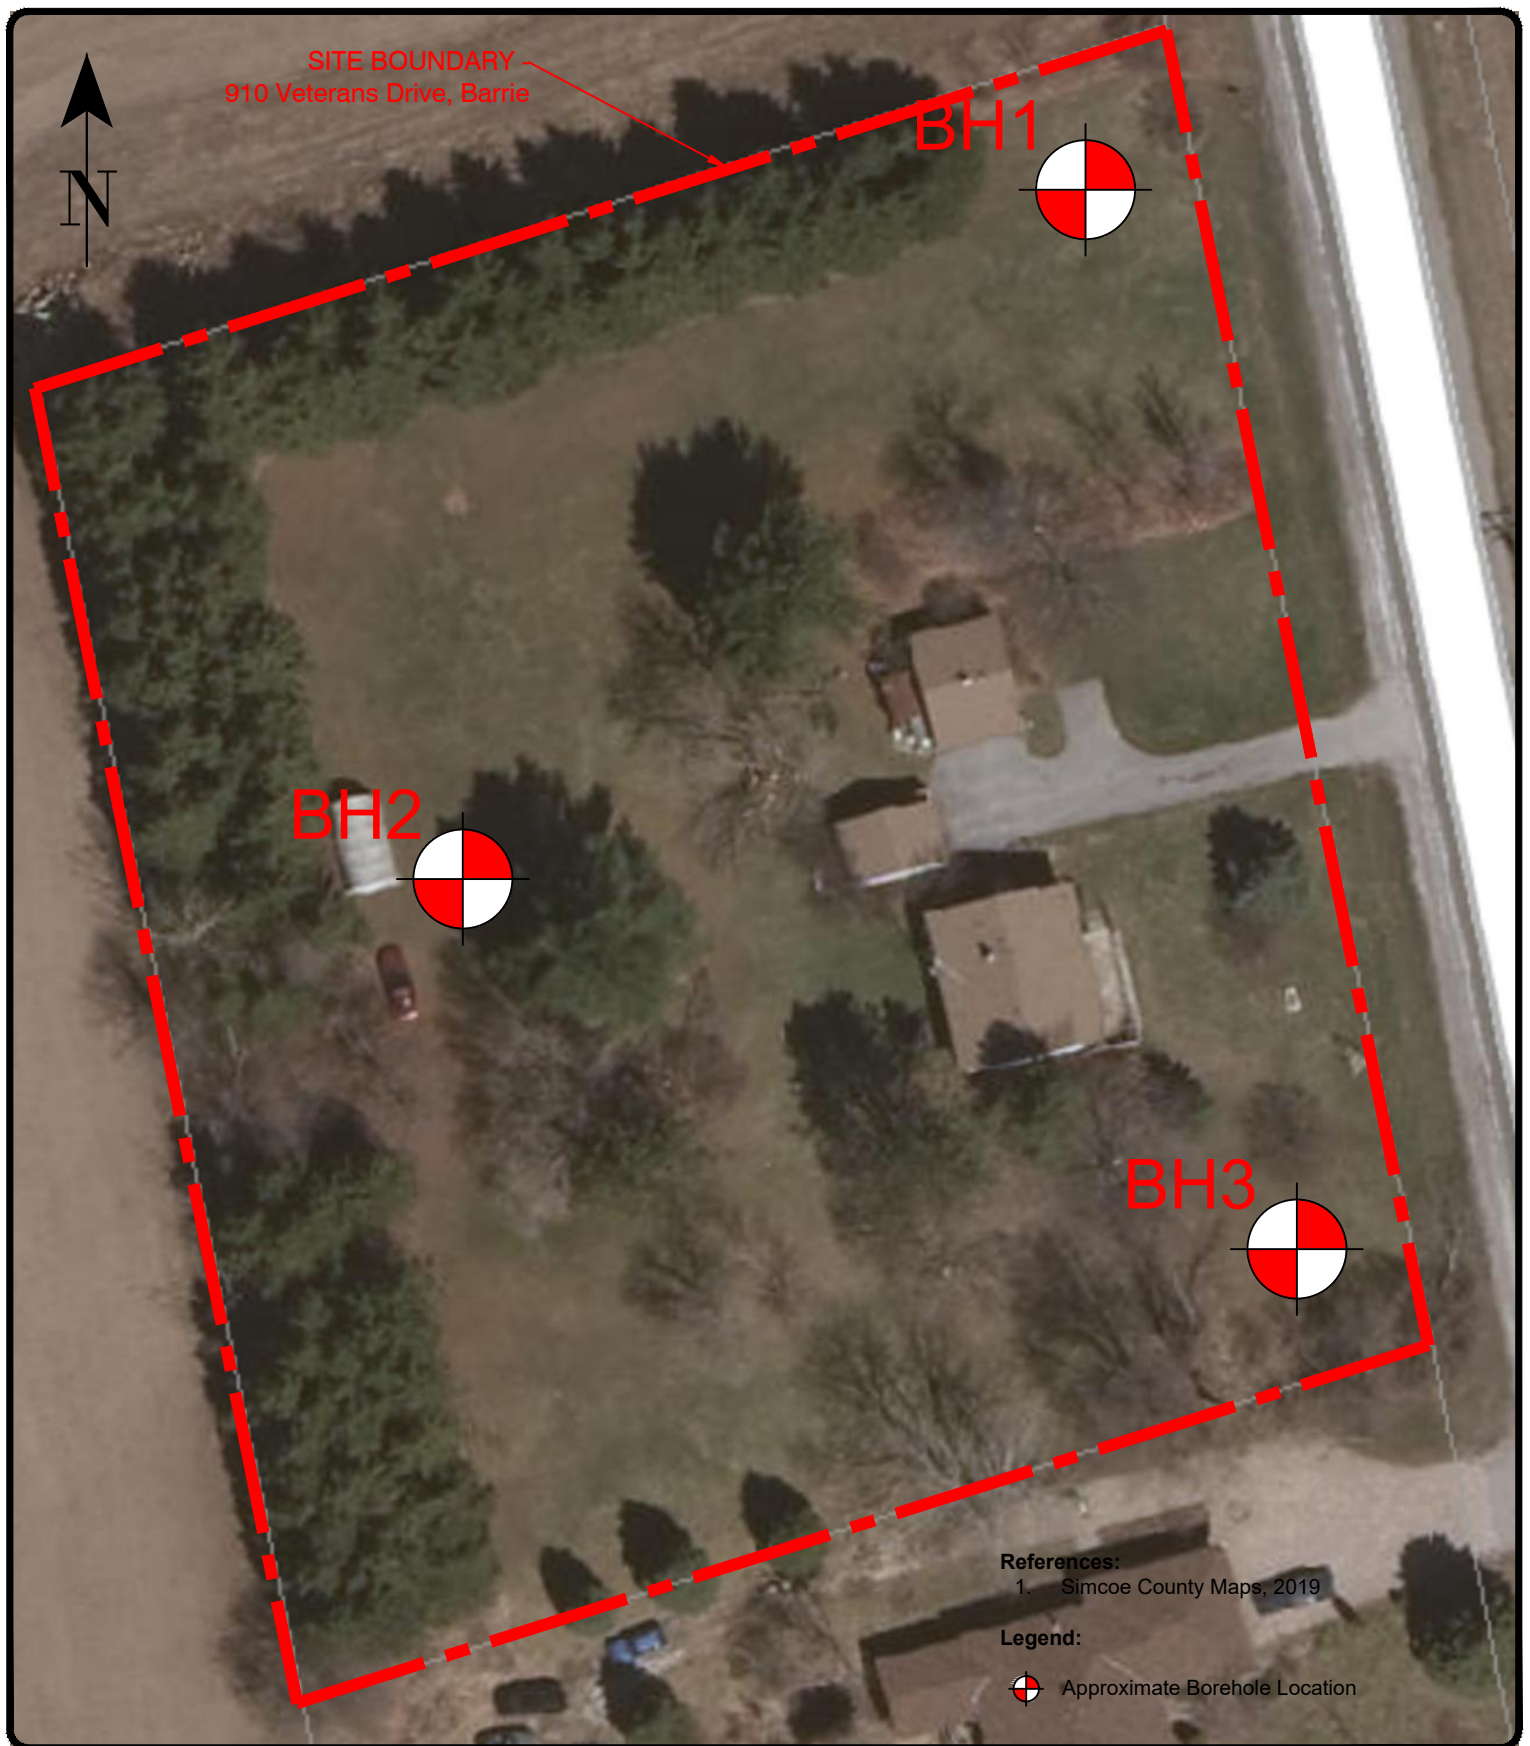

Geotechnical Engineering and Construction
Materials Testing & Inspection

647 Welham Rd, Unit 14, Barrie, ON, L4N 0B7
P: (705) 719-7994 | E: info@centralearth.ca

Project: 910 Veterans Drive, Barrie			
Title: BOREHOLE LOCATION PLAN - EXISTING CONDITIONS			
Approved by:	A.W.	Date:	Mar. 2019
Project No.:	19-1004A		
Drawn by:	E.P.	Scale:	N.T.S
Figure No.:	2A		

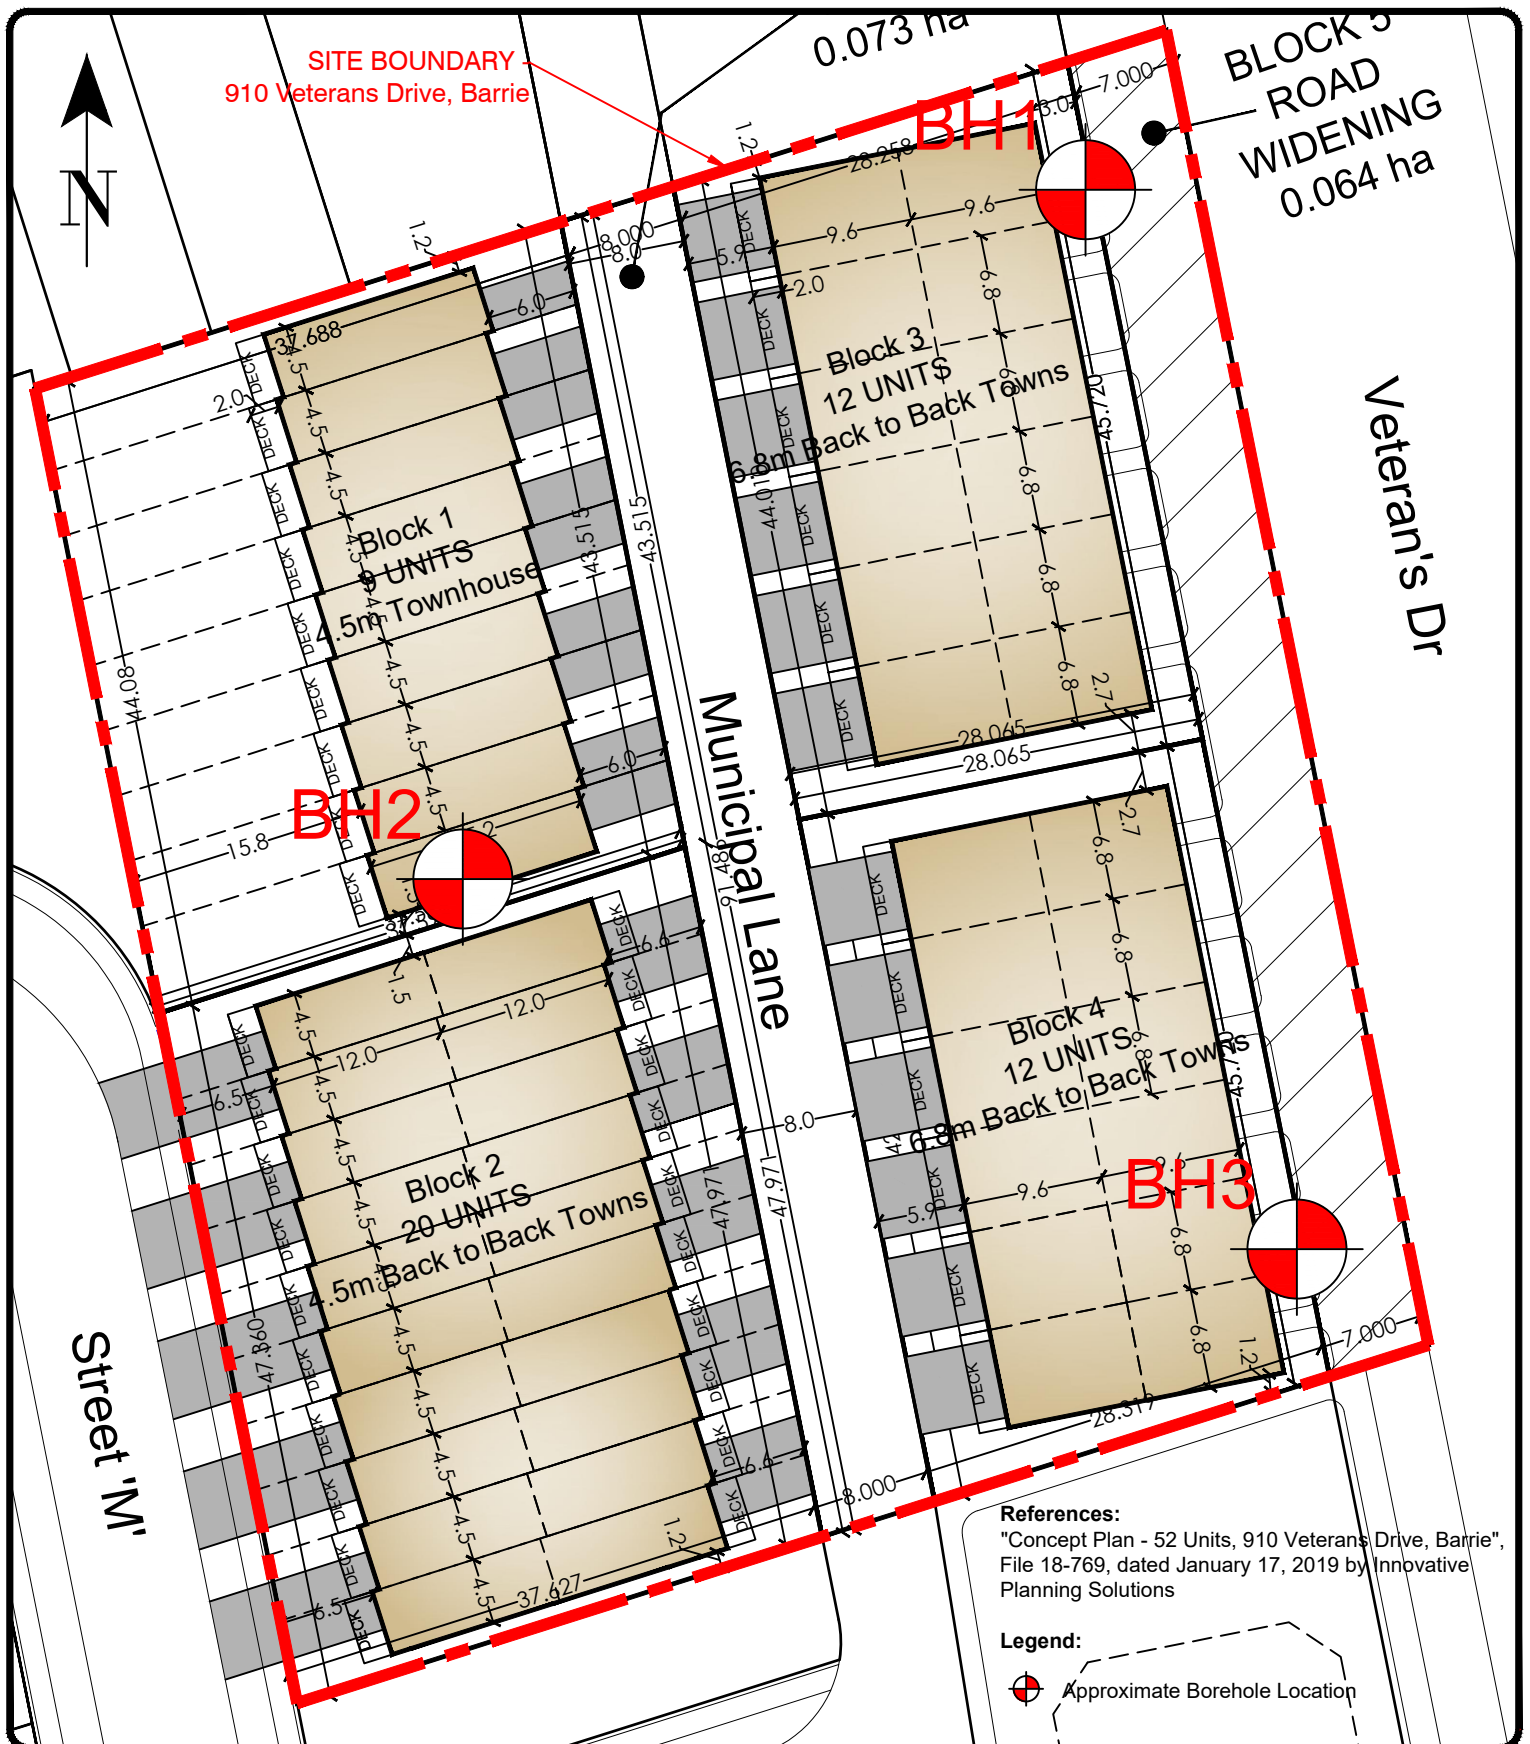

Geotechnical Engineering and Construction
Materials Testing & Inspection

647 Welham Rd, Unit 14, Barrie, ON, L4N 0B7
P: (705) 719-7994 | E: info@centralearth.ca

Project:

910 Veterans Drive, Barrie

Title:

BOREHOLE LOCATION PLAN - PROPOSED CONDITIONS

Approved by:

A.W.

Date:

Mar. 2019

Project No.:

19-1004A

Drawn by:


E.P.

Scale:

N.T.S

Figure No.:


2B

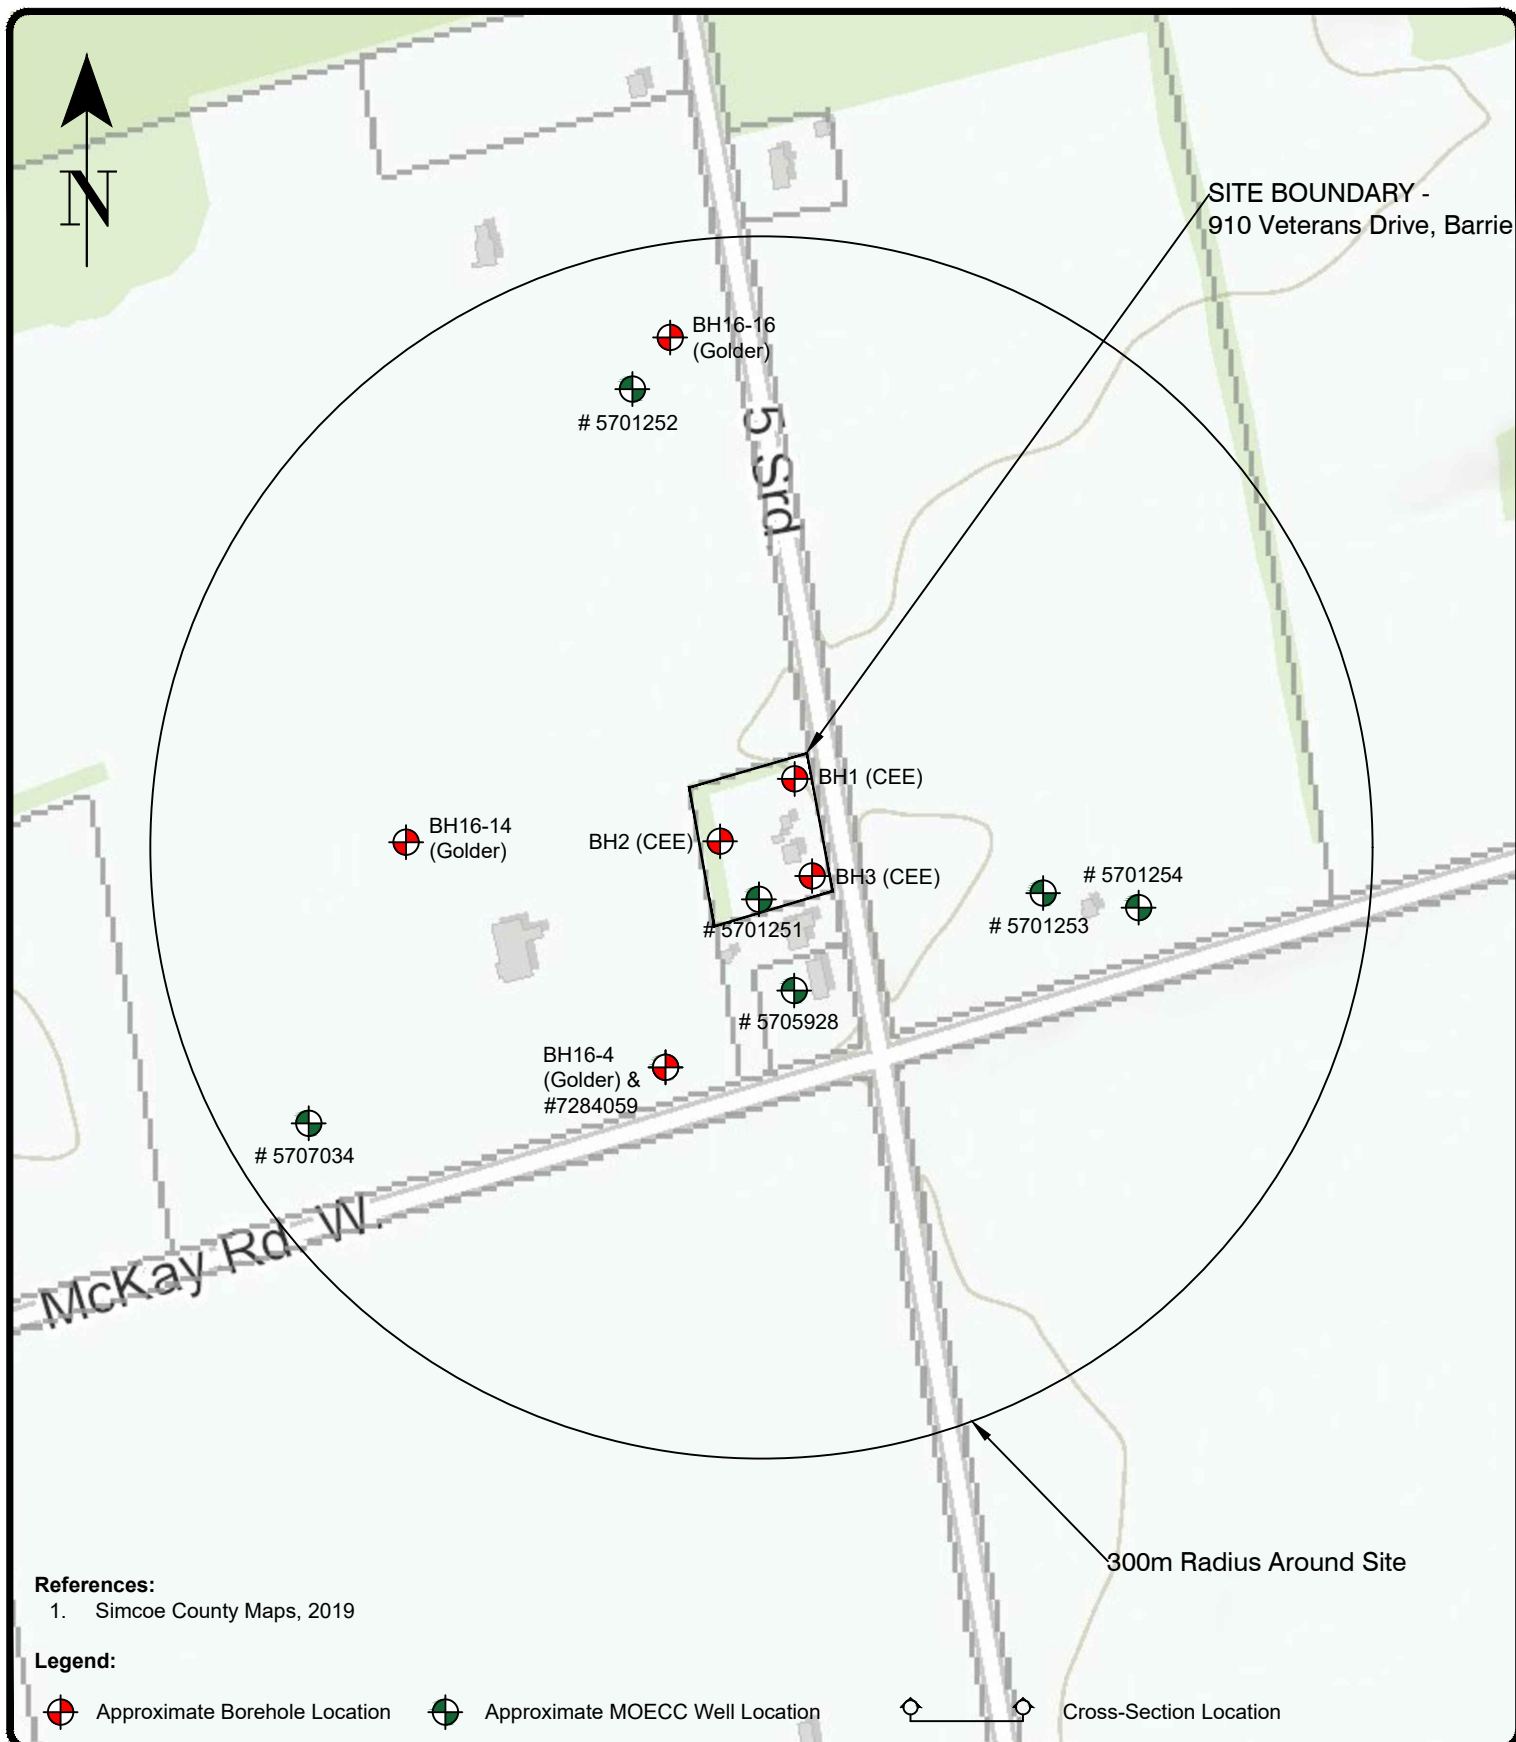

Geotechnical Engineering and Construction
Materials Testing & Inspection

647 Welham Rd, Unit 14, Barrie, ON, L4N 0B7
P: (705) 719-7994 | E: info@centralearth.ca


Project: 910 Veterans Drive, Barrie			
Title: MOECC & OTHER WELL LOCATION PLAN			
Approved by:	A.W.	Date:	Mar. 2019
Drawn by:	E.P.	Scale:	N.T.S
Project No.:		19-1004A	
Figure No.:		3	

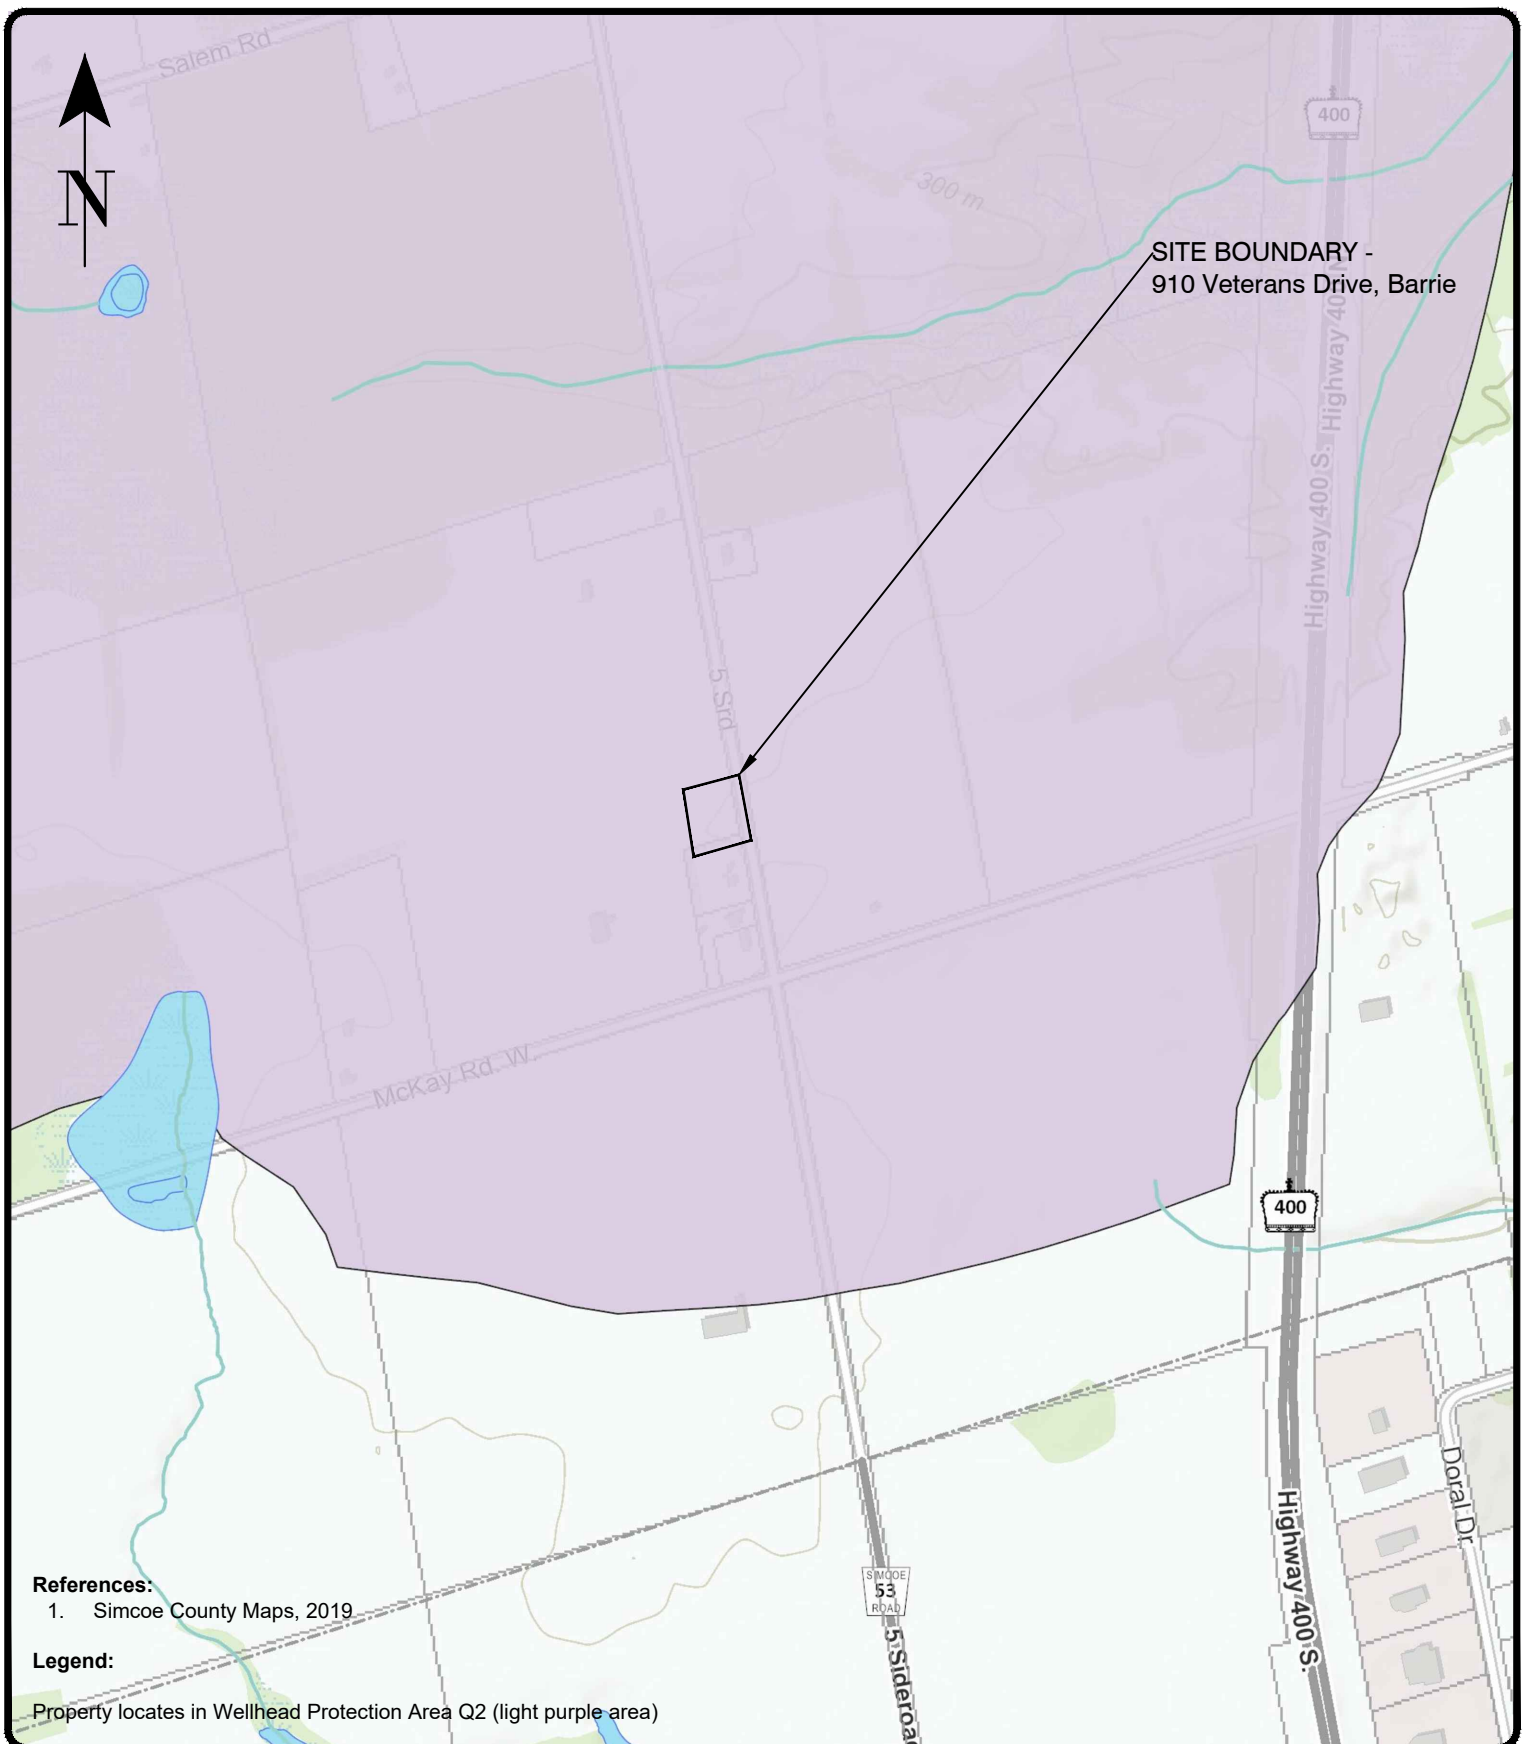

Geotechnical Engineering and Construction
Materials Testing & Inspection

647 Welham Rd, Unit 14, Barrie, ON, L4N 0B7
P: (705) 719-7994 | E: info@centralearth.ca


Project: 910 Veterans Drive, Barrie			
Title: WELLHEAD PROTECTION AREA MAP			
Approved by:	A.W.	Date:	Mar. 2019
Drawn by:	E.P.	Scale:	N.T.S
Project No.:		19-1004A	
Figure No.:		4A	

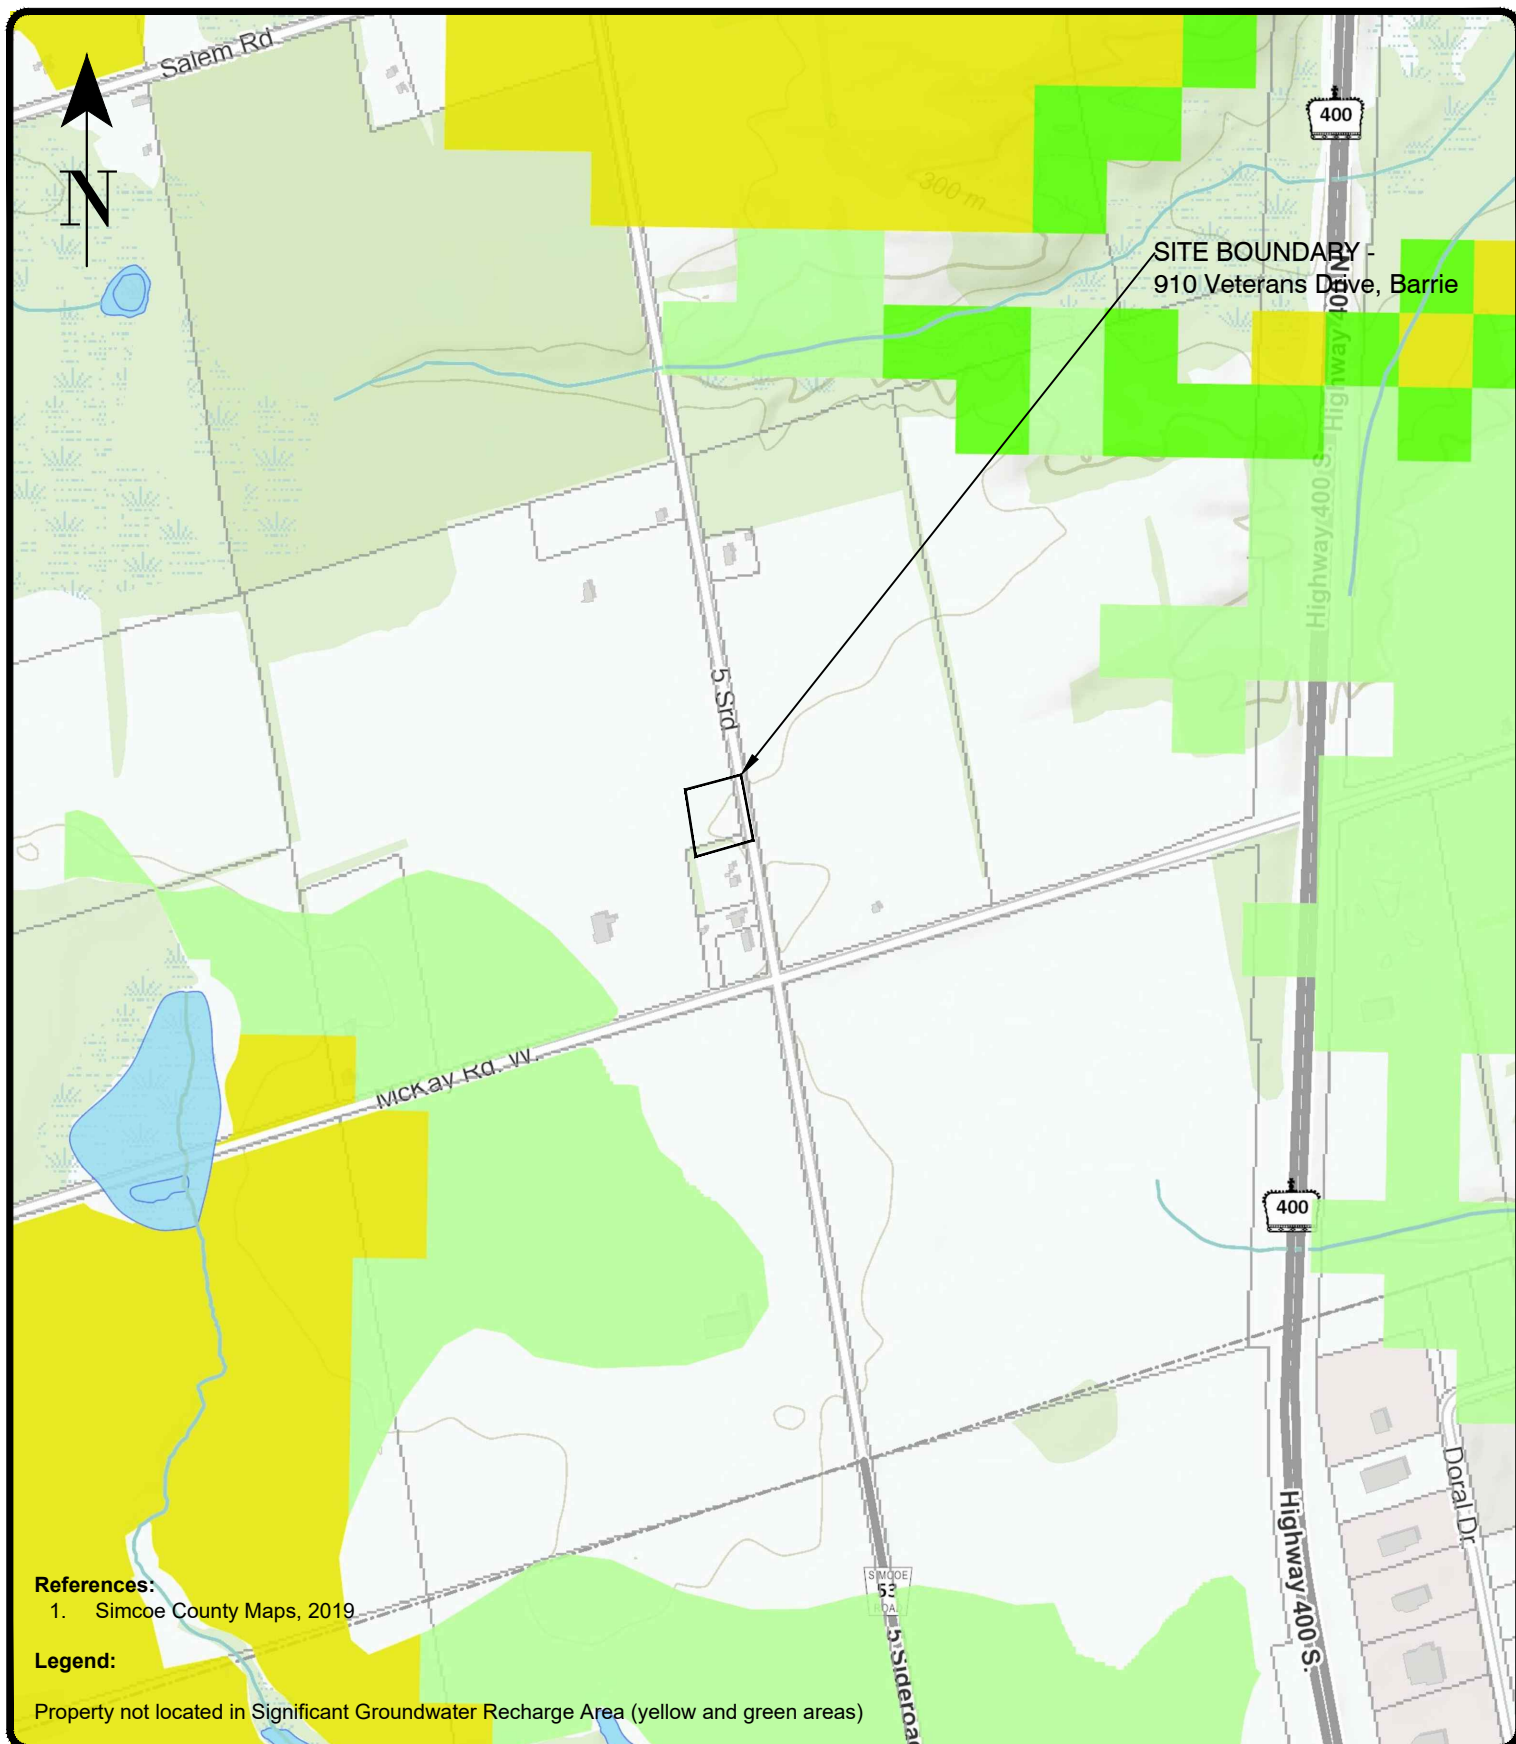

Geotechnical Engineering and Construction
Materials Testing & Inspection

647 Welham Rd, Unit 14, Barrie, ON, L4N 0B7
P: (705) 719-7994 | E: info@centralearth.ca

Project: 910 Veterans Drive, Barrie			
Title: SIGNIFICANT GROUNDWATER RECHARGE AREA MAP			
Approved by:	A.W.	Date:	Mar. 2019
Drawn by:	E.P.	Scale:	N.T.S
Project No.:		19-1004A	
Figure No.:		4B	

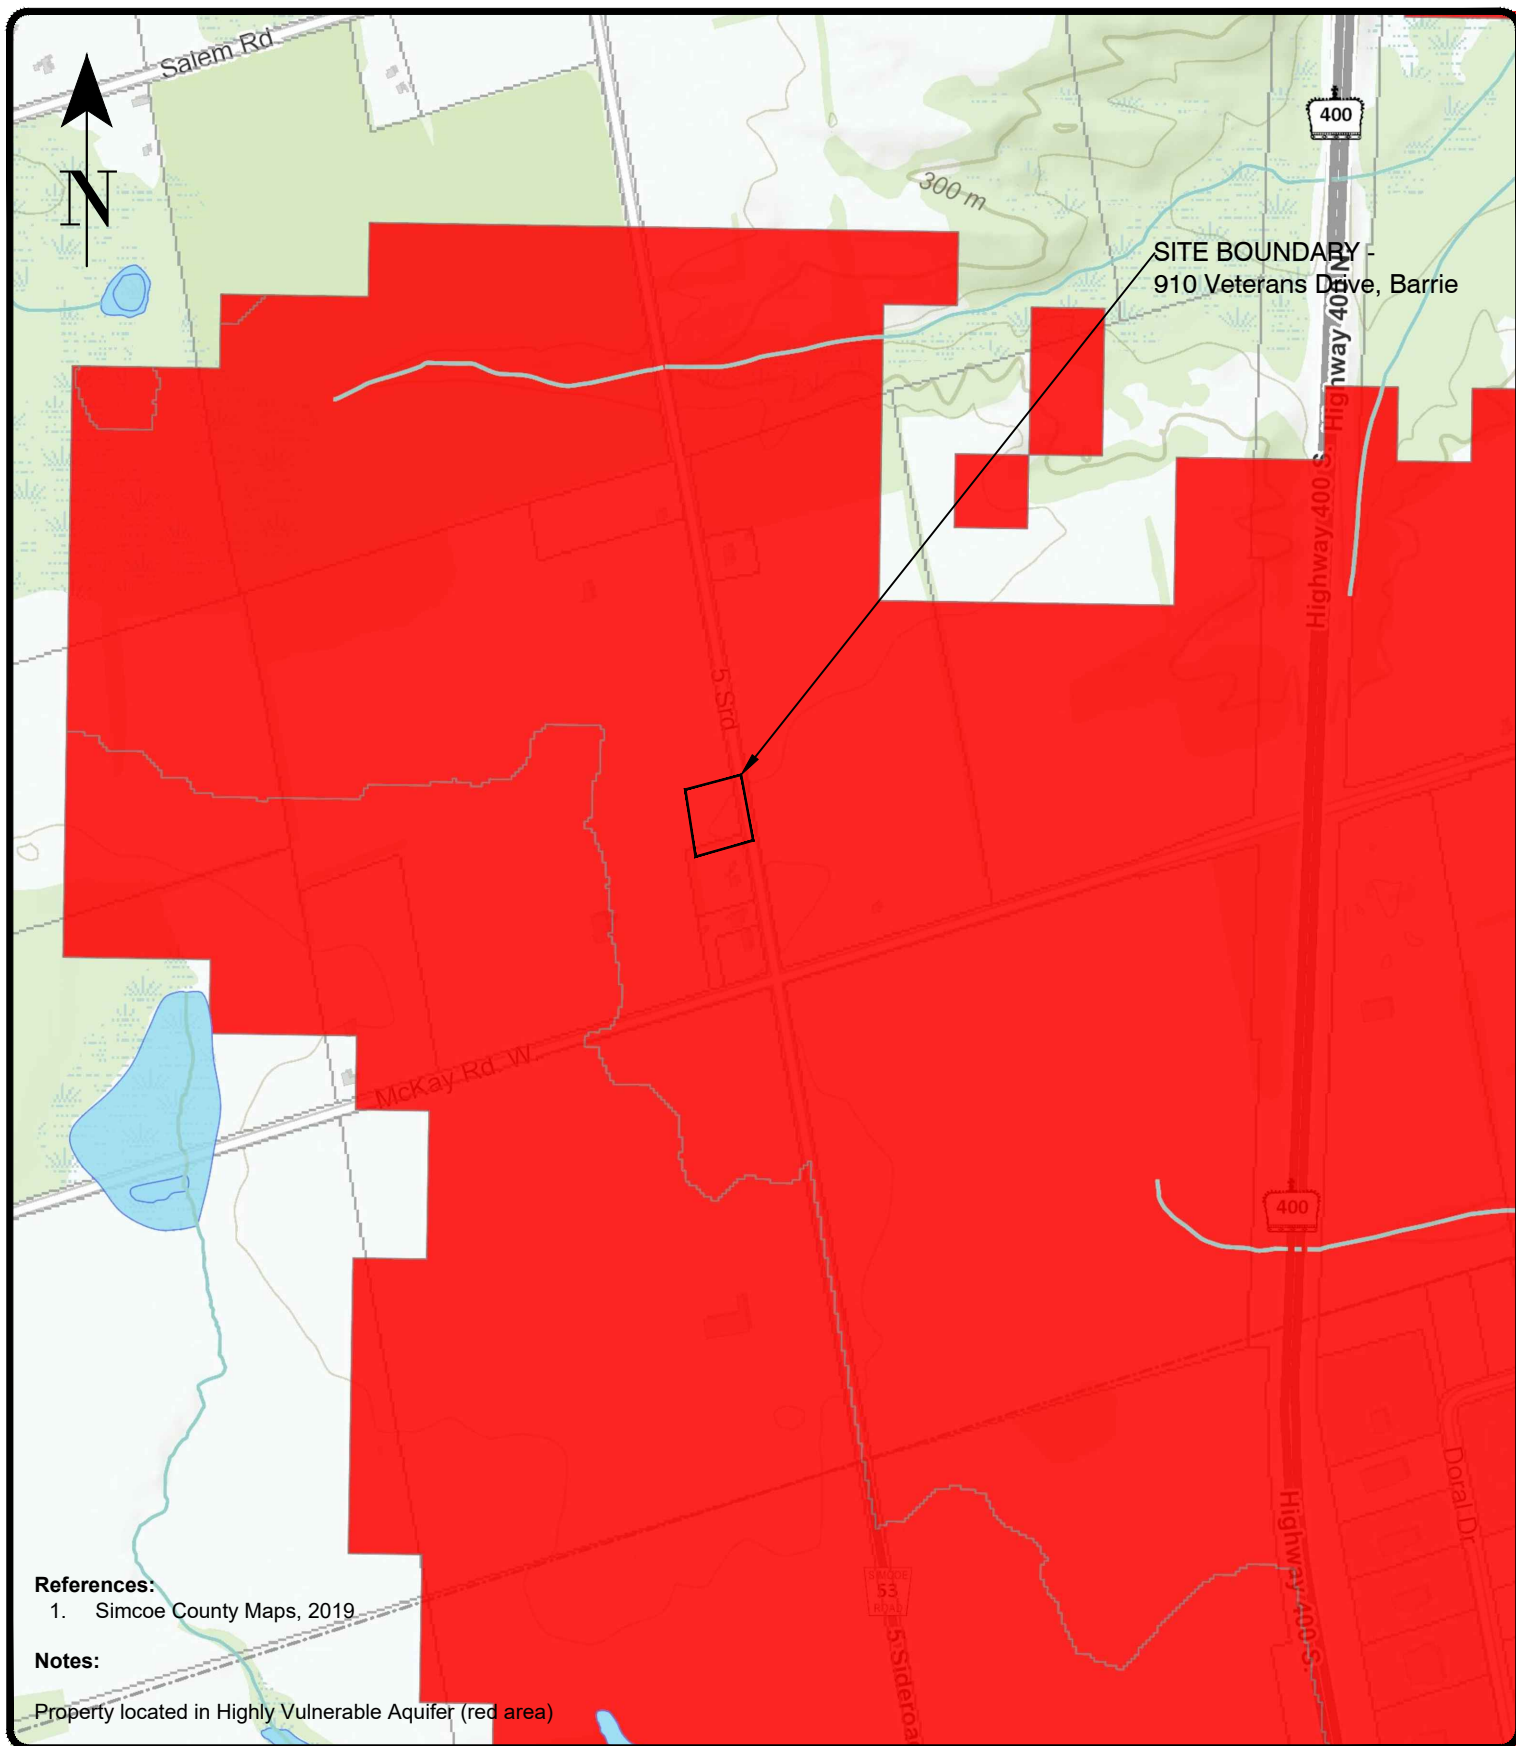

Geotechnical Engineering and Construction
Materials Testing & Inspection

647 Welham Rd, Unit 14, Barrie, ON, L4N 0B7
P: (705) 719-7994 | E: info@centralearth.ca

Project: 910 Veterans Drive, Barrie			
Title: HIGHLY VULNERABLE AQUIFER MAP			
Approved by:	A.W.	Date:	Mar. 2019
Drawn by:	E.P.	Scale:	N.T.S
Project No.:		19-1004A	
Figure No.:		4C	

Appendix A – **BOREHOLE LOGS**

RECORD OF BOREHOLE No. 1



Project Number: **19-1004A**
 Project Client: **Innovative Planning Solutions**
 Project Name: **910 Veteran's Drive**
 Project Location: **Barrie, Ontario**
 Drilling Location: **North Side Front Yard**

Drilling Method: **Solid Stem Augers** Drilling Machine: **Track Mount**
 Logged By: **RD** Northing: **4907069** Date Started: **2019-02-11**
 Reviewed By: **AW** Easting: **604214** Date Completed: **2019-02-11**

LITHOLOGY PROFILE		SOIL SAMPLING				DEPTH (m)	ELEVATION (m)	FIELD TESTING	LAB TESTING	Instrumentation Installation	COMMENTS & GRAIN SIZE DISTRIBUTION (%)				
Lithology Plot	DESCRIPTION	Sample Type	Sample Number	Recovery (%)	SPT "N" Value			Shear Strength Testing (kPa) × Other Test + Pocket Penetrometer ▲ Field Vane (Intact) △ Field Vane (Remolded) 40 80 120 160 Penetration Testing ○ SPT ● DCPT 10 20 30 40	△ Combustible Organic Vapour (ppm) ▲ Combustible Organic Vapour (%LEL) * Total Organic Vapour (ppm) 100 200 300 400 Atterberg Limits PL Water Content (%) LL 10 20 30 40		GR	SA	SI	CL	
Local	100.12m														
	Topsoil = 600mm	SS	1	92	37	0	100								
	0.6 SAND & SILT GLACIAL TILL, Some Gravel, Trace Clay, Dense, Brown, Moist	SS	2	100	33	0.5	99.5								
						1	99	33	10						
						1.5	98.5	36	9						
	--- Very Dense ---					2	98								
		SS	4	100	80/5"	2.5	97.5	80/5"	9						
						3	97	50/4"	8						
		SS	5	100	50/4"	3.5	96.5								
						4	96								
	4.6 SILT & SAND GLACIAL TILL, Some Clay, Trace Gravel, Hard, Brown, Moist	SS	6	100	50/5"	4.5	95.5	50/5"	10						
					5	95									
					5.5	94.5									
					6	94	50/3"	6							
6.6	93.6	SS	7	100	50/3"	6.5									
End of Borehole @ 6.6m															

CENTRAL EARTH
ENGINEERING

647 Welham Road, Unit 14
Barrie, Ontario
L4N 0B7
T : (705) 719-7994
W : www.centralearth.com

Groundwater depth encountered on completion of drilling: **Dry**

Cave depth after auger removal: **Open**

Groundwater depth observed on **Feb. 13/19** at a depth of: **Dry**

Observed on **Mar. 7/19** at a depth of: **Dry**

Borehole details presented do not constitute a thorough understanding of all potential conditions present and require interpretative assistance from a qualified geotechnical engineer. Also, borehole information should be read in conjunction with the geotechnical report for which it was commissioned and the accompanying 'Explanation of Boring Log'.

Scale: **1 : 50**


Page: **1 of 1**

RECORD OF BOREHOLE No. 2



Project Number: **19-1004A**
 Project Client: **Innovative Planning Solutions**
 Project Name: **910 Veteran's Drive**
 Project Location: **Barrie, Ontario**
 Drilling Location: **Back Yard, Centre at Rear**

Drilling Method: **Solid Stem Augers** Drilling Machine: **Track Mount**
 Logged By: **RD** Northing: **4907009** Date Started: **2019-02-11**
 Reviewed By: **AW** Easting: **604163** Date Completed: **2019-02-11**

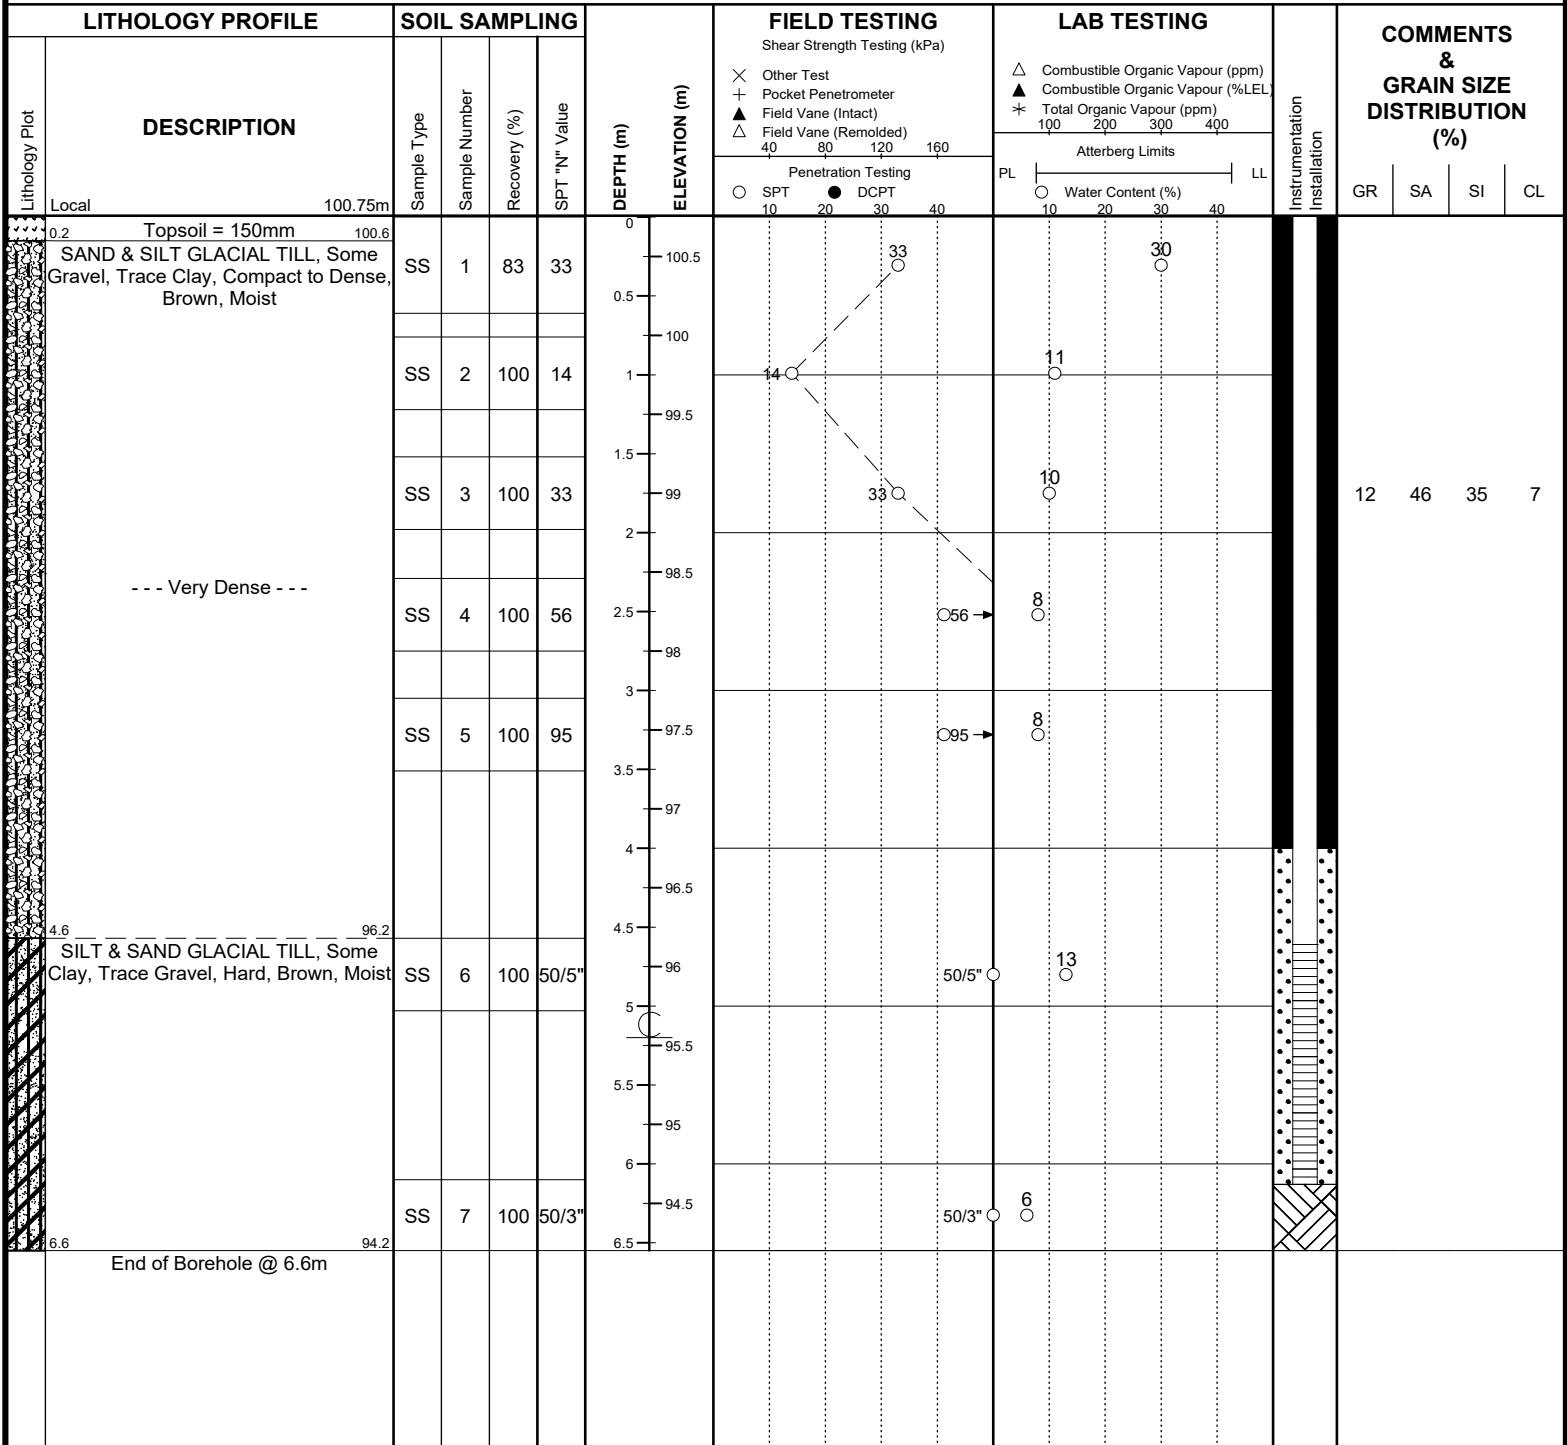

CENTRAL EARTH ENGINEERING

647 Welham Road, Unit 14
 Barrie, Ontario
 L4N 0B7
 T : (705) 719-7994
 W: www.centralearth.com

Groundwater depth encountered on completion of drilling: **Dry**

Groundwater depth observed on **Feb. 13/19** at a depth of: **Dry**

Cave depth after auger removal: **5.2m**

Observed on **Mar. 7/19** at a depth of: **Dry**

Borehole details presented do not constitute a thorough understanding of all potential conditions present and require interpretative assistance from a qualified geotechnical engineer. Also, borehole information should be read in conjunction with the geotechnical report for which it was commissioned and the accompanying 'Explanation of Boring Log'.

Scale: **1 : 50**

Page: **1 of 1**

RECORD OF BOREHOLE No. 3



Project Number: **19-1004A**
 Project Client: **Innovative Planning Solutions**
 Project Name: **910 Veteran's Drive**
 Project Location: **Barrie, Ontario**
 Drilling Location: **South Side Front Yard**

Drilling Method: **Solid Stem Augers** Drilling Machine: **Track Mount**
 Logged By: **RD** Northing: **4907005** Date Started: **2019-02-11**
 Reviewed By: **AW** Easting: **604230** Date Completed: **2019-02-11**

LITHOLOGY PROFILE		SOIL SAMPLING				DEPTH (m)	ELEVATION (m)	FIELD TESTING		LAB TESTING		Instrumentation Installation	COMMENTS & GRAIN SIZE DISTRIBUTION (%)			
Lithology Plot	DESCRIPTION	Sample Type	Sample Number	Recovery (%)	SPT "N" Value			Shear Strength Testing (kPa)		Atterberg Limits			Grain Size Distribution (%)			
Local	100.90m							Penetration Testing		Water Content (%)						
								○ SPT	● DCPT	○ PL	○ LL					
								10	20	30	40	10	20	30	40	

CENTRAL EARTH
ENGINEERING

647 Welham Road, Unit 14
Barrie, Ontario
L4N 0B7
T : (705) 719-7994
W : www.centralearth.com

Groundwater depth encountered on completion of drilling: **Dry**

Groundwater depth observed on **Feb. 13/19** at a depth of: **Dry**

Cave depth after auger removal: **Open**

Observed on **Mar. 7/19** at a depth of: **Dry**


Borehole details presented do not constitute a thorough understanding of all potential conditions present and require interpretative assistance from a qualified geotechnical engineer. Also, borehole information should be read in conjunction with the geotechnical report for which it was commissioned and the accompanying 'Explanation of Boring Log'.

Scale: **1 : 50**

Page: **1 of 1**

Appendix B – **GEOTECHNICAL LABORATORY DATA**

UNIFIED SOIL CLASSIFICATION SYSTEM

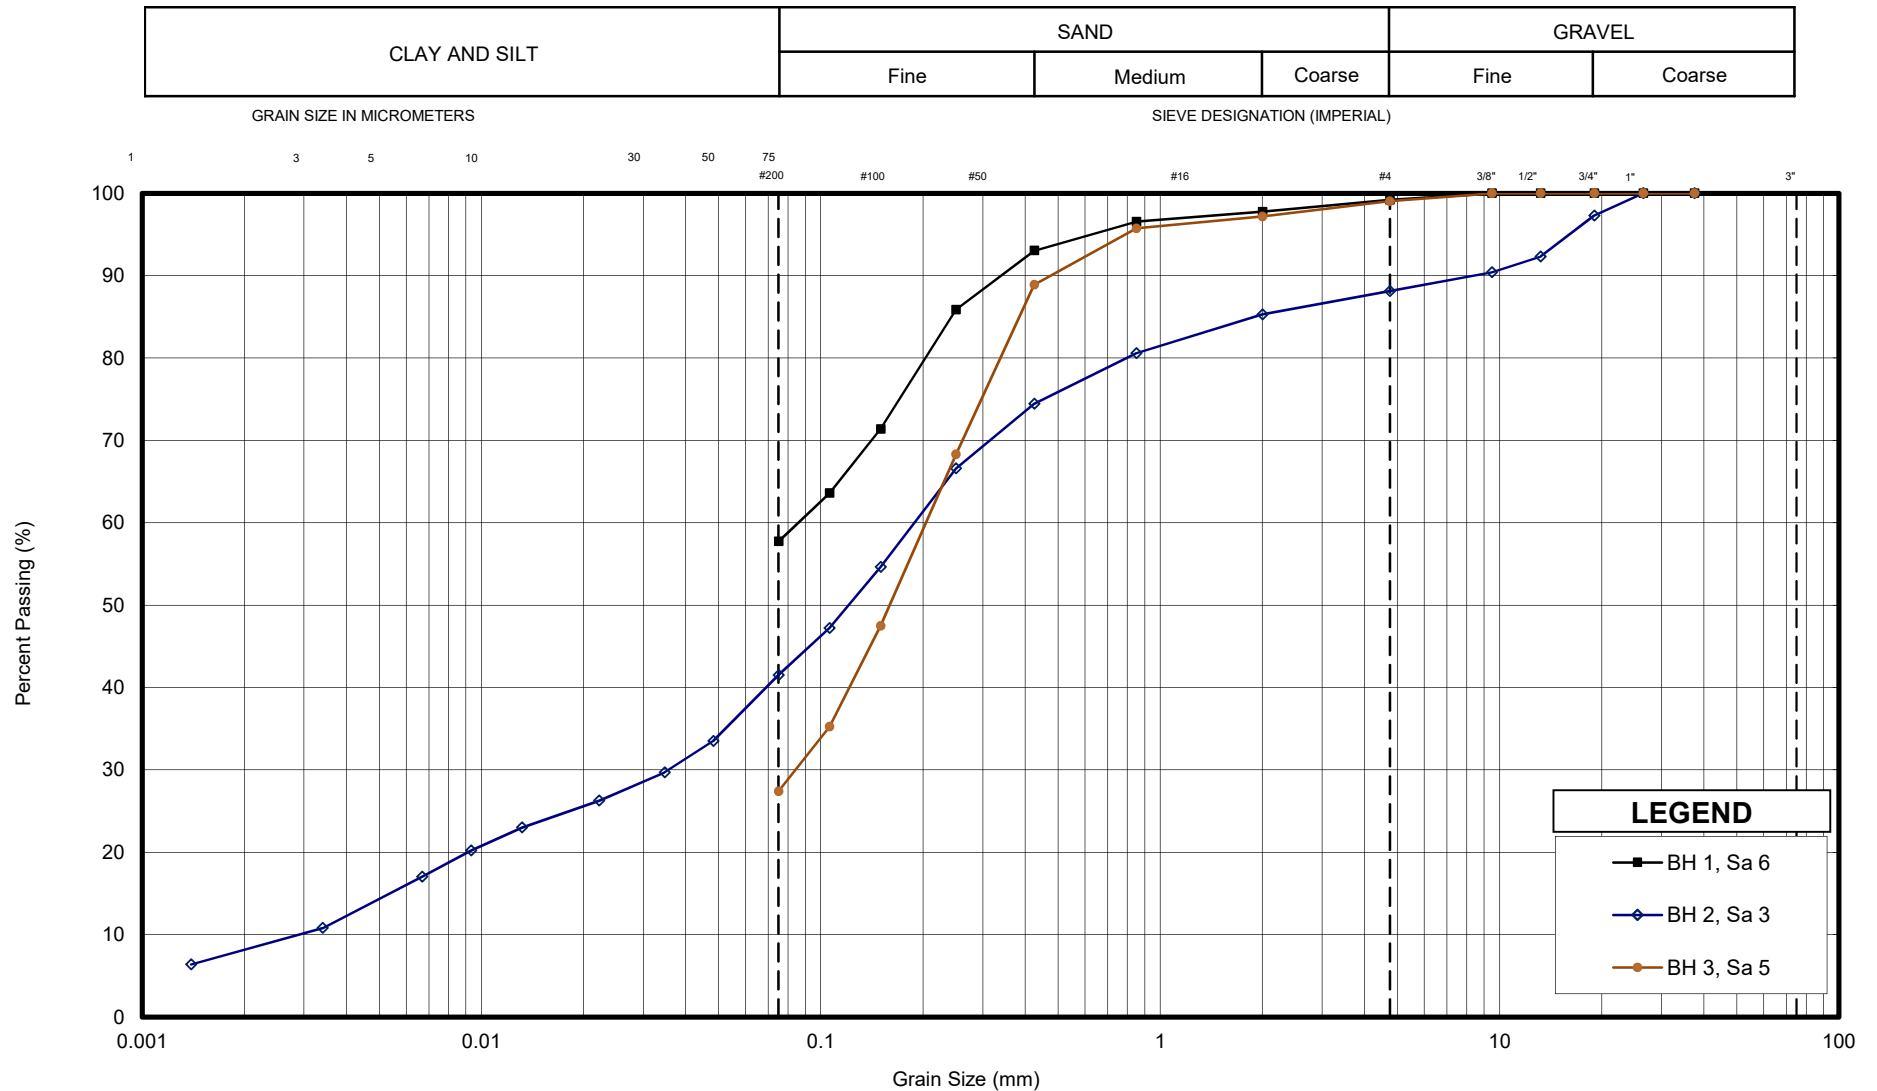

GRAIN SIZE DISTRIBUTION
910 Veteran's Drive, Barrie

FIGURE No. B1

REF. No. 19-1004A

DATE March 2019

Appendix C –
GOLDER BOREHOLE LOGS

PROJECT: 1546595 (2000)

LOCATION: See Figure 1


RECORD OF BOREHOLE: BH16-4

BORING DATE: January 6, 2016

SHEET 1 OF 1

DATUM: Geodetic

SPT/DCPT HAMMER: MASS, 64kg; DROP, 760mm

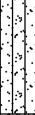DEPTH SCALE METRES	BORING METHOD	SOIL PROFILE			SAMPLES			DYNAMIC PENETRATION RESISTANCE, BLOWS/0.3m				HYDRAULIC CONDUCTIVITY, k, cm/s				ADDITIONAL LAB. TESTING	PIEZOMETER OR STANDPIPE INSTALLATION	
		DESCRIPTION	STRATA PLOT	ELEV. DEPTH (m)	NUMBER	TYPE	BLOWS/0.3m											
								SHEAR STRENGTH Cu, kPa				WATER CONTENT PERCENT						
												Wp — W — Wi						
		GROUND SURFACE						20	40	60	80	10 ⁻⁶	10 ⁻⁵	10 ⁻⁴	10 ⁻³			
0	CME 75 Hollow Stem Auger with SPT Sampling	TOPSOIL		0.00														
		(SM) SILTY SAND; brown; non-cohesive, moist, loose		0.20	1	DO	7											
1					2	DO	8											
		(CL) SILTY CLAY; grey; cohesive, w-PL, hard		1.37														
2					3	DO	33											
		(SM) SILTY SAND to SAND, trace gravel; brown; non-cohesive, moist, very dense		2.13														
3					4	DO	72											
					5	DO	121											
4					6	DO	129											
					7	DO	110											
5																		
6				8	DO	145												
7																		
8				9	DO	157												
9				10	DO	163												
10																		
11		End of Borehole		10.97	11	DO	172											
12		NOTE: 1. Borehole dry upon completion of drilling January 6, 2016. 2. Monitoring well dry on May 4, 2016.																
13																		
14																		
15																		

DEPTH SCALE

1 : 75



LOGGED: DD

CHECKED: NL

GTA-BHS 001 S:\CLIENTS\GREAT SUMMIT INVESTMENTS\MCKAY ROAD BARRIE\02 DATA\GINT\1546595_2000_GA_2016.GPJ GAL-MIS.GDT 7-18-16 STB

PROJECT: 1546595 (2000)

LOCATION: See Figure 1

RECORD OF BOREHOLE: BH16-14

BORING DATE: January 5, 2016

SHEET 1 OF 1

DATUM: Geodetic

SPT/DCPT HAMMER: MASS, 64kg; DROP, 760mm

DEPTH SCALE METRES	BORING METHOD	SOIL PROFILE		SAMPLES		DYNAMIC PENETRATION RESISTANCE, BLOWS/0.3m				HYDRAULIC CONDUCTIVITY, k, cm/s				ADDITIONAL LAB. TESTING	PIEZOMETER OR STANDPIPE INSTALLATION
		DESCRIPTION	STRATA PLOT	ELEV. DEPTH (m)	NUMBER	TYPE	BLOWS/0.3m	SHEAR STRENGTH Cu, kPa		WATER CONTENT PERCENT					
								20	40	60	80	10 ⁻⁶	10 ⁻⁵		
0		GROUND SURFACE													
		TOPSOIL		0.00											
		(SM) SILTY SAND, trace clay; brown; non-cohesive, moist, loose		0.15	1	DO	6								
		(SM/ML) SILT and SAND, trace gravel, low plasticity; brown, (TILL); cohesive, w~PL, very stiff to hard		0.69	2	DO	23								
1															
2					3	DO	36								
3					4	DO	47								
4					5	DO	51								
5					6	DO	54								
6					7	DO	26								
5		End of Borehole		5.03											
6		NOTE: 1. Borehole dry upon completion of drilling January 5, 2016.													
7															
8															
9															
10															
11															
12															
13															
14															
15															

DEPTH SCALE

1 : 75



LOGGED: DD

CHECKED: NL

GTA-BHS 001 S:\CLIENTS\GREAT SUMMIT INVESTMENTS\MCKAY ROAD BARRIE\02 DATA\GINT\1546595_2000_GA_2016.GPJ GAL-MIS.GDT 7-18-16 STB

PROJECT: 1546595 (2000)

LOCATION: See Figure 1

RECORD OF BOREHOLE: BH16-16

BORING DATE: January 6, 2016

SHEET 1 OF 1

DATUM: Geodetic

SPT/DCPT HAMMER: MASS, 64kg; DROP, 760mm

DEPTH SCALE METRES	BORING METHOD	SOIL PROFILE			SAMPLES			DYNAMIC PENETRATION RESISTANCE, BLOWS/0.3m				HYDRAULIC CONDUCTIVITY, k, cm/s				ADDITIONAL LAB. TESTING	PIEZOMETER OR STANDPIPE INSTALLATION
		DESCRIPTION	STRATA PLOT	ELEV. DEPTH (m)	NUMBER	TYPE	BLOWS/0.3m										
								SHEAR STRENGTH Cu, kPa				WATER CONTENT PERCENT					
								20	40	60	80	10 ⁻⁶	10 ⁻⁵	10 ⁻⁴	10 ⁻³		
								nat V. +		Q - ●		Wp — W — Wi					
								rem V. ⊕		U - ○							
								20	40	60	80	10	20	30	40		
0		GROUND SURFACE															
	CME 75 Solid Stem Auger with SPT Sampling	TOPSOIL		0.00													
		(SM) SILTY SAND, trace clay; brown; non-cohesive, moist, loose to very dense		0.13	1	DO	10										
1					2	DO	16						○				
2					3	DO	6										
3					4	DO	108						○				
4					5	DO	118										
5					6	DO	155						○				
					7	DO	132										
5		End of Borehole		5.03													
6		NOTE:															
7		1. Borehole dry upon completion of drilling January 6, 2016.															
8		2. Monitoring well dry on May 4, 2016.															
9																	
10																	
11																	
12																	
13																	
14																	
15																	

Hole Plug

Silica Sand

10 Slot PVC Screen

DEPTH SCALE

1 : 75



LOGGED: DD

CHECKED: NL

GTA-BHS 001 S:\CLIENTS\GREAT SUMMIT INVESTMENTS\MCKAY ROAD_BARRIER\02 DATA\GINT\1546595_2000_GA_2016.GPJ GAL-MIS.GDT 7-18-16 STB

Appendix D –
MOECC WATER WELL RECORDS

UTM 1172604180E


SR 4906760N

Elev. SR 1020

Basin 22



The Ontario Water Resources Commission Act, 1957

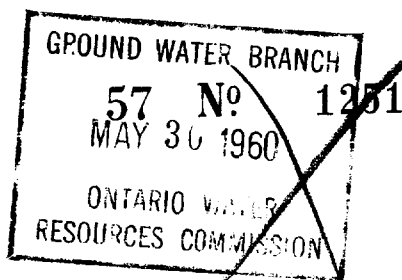

WATER WELL RECORD

County or District Lincoln

Township, Village, Town or City Cornhill

Date completed 4 April 1960

Address RR#5 Barrie

Casing and Screen Record

Inside diameter of casing 4"
Total length of casing 125'
Type of screen #8 Johnston
Length of screen 5'
Depth to top of screen 125'
Diameter of finished hole 4"

Pumping Test

Static level 104'
Test-pumping rate 7 1/2 G.P.M.
Pumping level 116'
Duration of test pumping 1 HR.
Water clear or cloudy at end of test Clear
Recommended pumping rate 3 G.P.M.
with pumping level of 110'

Well Log

Water Record

Overburden and Bedrock Record	From ft.	To ft.	Depth(s) at which water(s) found	No. of feet water rises	Kind of water (fresh, salty, sulphur)
Clay hardpan	0	50	129'	25'	Fresh
Clay & fine sandy layers	50	62			
Quick sand	62	90			
Coarse sand & layers clay	90	120			
Med. coarse sand	120	129			

For what purpose(s) is the water to be used?

Household

Is well on upland, in valley, or on hillside?

Drilling Firm M. Coupland

Address RR#2 Barrie

Licence Number 689

Name of Driller T. Coupland


Address Barrie

Date Nov 26/60


Member Coupland
(Signature of Licensed Drilling Contractor)

Location of Well

In diagram below show distances of well from road and lot line. Indicate north by arrow.

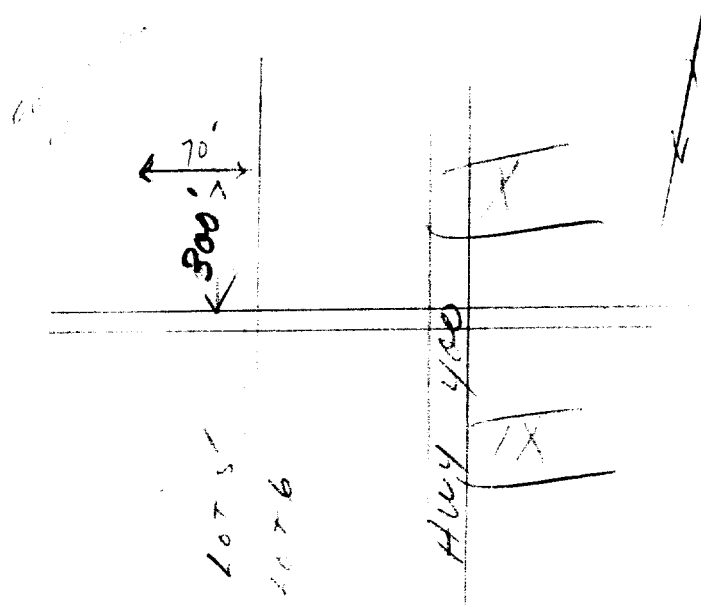

UTM 17Z 604102E

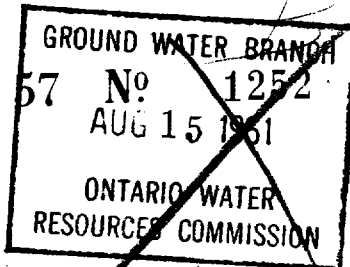

BR 4907076N

The Ontario Water Resources Commission Act

Elev. 150.10

WATER WELL RECORD

Basin 22 Simcoe

Township, Village, Town or City INNEFIL

Con 10 Lot 5

Date completed 3 June 1961
(day month year)

Address P.H. 2 ST. ROAD

Casing and Screen Record

Inside diameter of casing 6 1/4
 Total length of casing 128 Feet
 Type of screen COOKS (slot 1/4)
 Length of screen 3 Feet
 Depth to top of screen 138
 Diameter of finished hole 6 1/4

Pumping Test

Static level 102
 Test-pumping rate 15 G.P.M.
 Pumping level 160
 Duration of test pumping 2 hrs
 Water clear or cloudy at end of test CLEAR
 Recommended pumping rate 2 G.P.M.
 with pump setting of 135 feet below ground surface

Well Log

Water Record

Overburden and Bedrock Record

	From ft.	To ft.	Depth(s) at which water(s) found	Kind of water (fresh, salty, sulphur)
top soil	0	1		
SAND	1	6		
SAND gravel clay	6	42		
Sand	42	131		
CLAY SAND GRAVEL	131	178		
Medium SAND	178	191	188	FRESH

For what purpose(s) is the water to be used?

Domestic

Is well on upland, in valley, or on hillside? upland

Drilling or Boring Firm Henry Hammers

Address 103 Coddington st
Barrie ont

Licence Number 95

Name of Driller or Borer Henry Hammers


Address Barrie ont

Date August 10 1961

Henry Hammers
(Signature of Licensed Drilling or Boring Contractor)

Location of Well

In diagram below show distances of well from road and lot line. Indicate north by arrow.

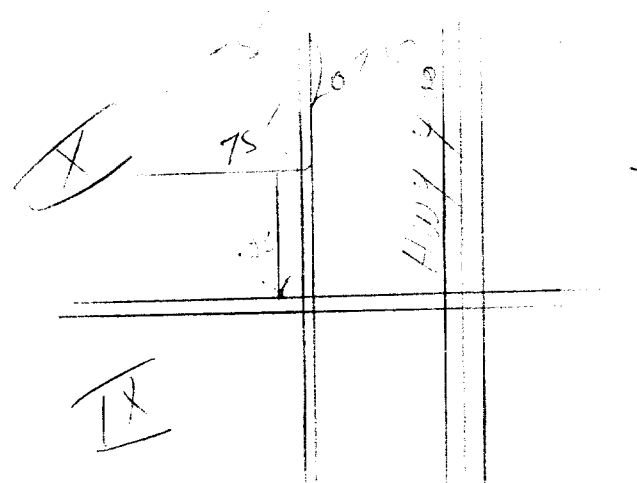

UTM 17 Z 604365 E

9^R 4906772^N

Elev. 9 R 1 0 1 5

Başın 22

Con X

10 + 6



ONTARIO

The Water-well Drillers Act, 1954

Department of Mines

Water-Well Record

Innistil

County or Territorial District.....SIMCOE.....Township, Village, Town or City.....~~MISSISSAUGA~~.....

Village, Town or City)

Address ~~THOMAS J. BART~~

Date completed
(day) (month) (year)

Pipe and Casing Record

Pumping Test

Casing diameter(s) 4"

Length (s) 140

Type of screen

Length of screen

Static level

Pumping rate

Pumping level

Duration of test

Well Log

Water Record

[illegible]

For what purpose(s) is the water to be used?

Is water clear or cloudy?.....

Is well on upland, in valley, or on hillside?.....

..... UPLAND

Drilling firm F. WRIGHT & SON

Address R. R. # 2

COLLINGWOOD.

Name of Driller G. R. WRIGHT

Address R.R. #2

COLLEGEWOOD

Licence Number.....150-.....


I certify that the foregoing
statements of fact are true.

Date. Dec 14/54 G.K. Wright

Signature of Licensee

Location of Well

In diagram below show distances of well from road and lot line. Indicate north by arrow.

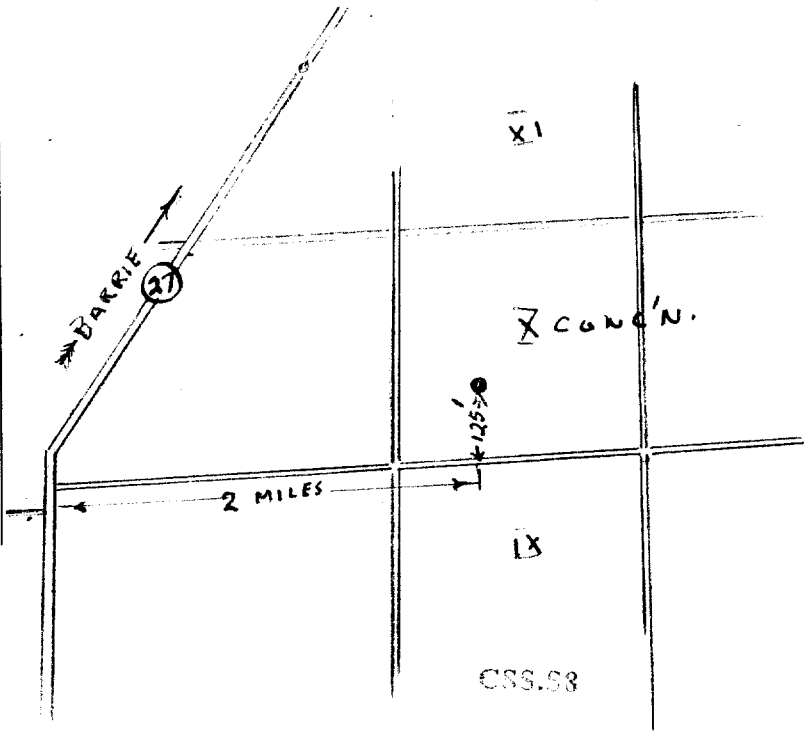

Y.H.
UTM 1726044115E



GROUND WATER BRANCH
57 No. 1254
SEP 26 1962
ONTARIO WATER RESOURCES COMMISSION

SR 4906757N

Elev. SR 4015

Basin 22
County or District Simcoe

Con. X Lot 1

WATER WELL RECORD

Township, Village, Town or City Innesfil
Date completed 17 Sept 1962
(day month year)

Address RR#5 BARRIE

Casing and Screen Record

Inside diameter of casing 6 1/4 inch
Total length of casing 137 feet
Type of screen JOHNSONS
Length of screen 3 Feet (slot 20)
Depth to top of screen 138
Diameter of finished hole 6 1/4 inch

Pumping Test

Static level 105
Test-pumping rate 7 G.P.M.
Pumping level 135
Duration of test pumping 12 hrs
Water clear or cloudy at end of test clear
Recommended pumping rate 6 G.P.M.
with pump setting of 135 feet below ground surface

Well Log

Overburden and Bedrock Record

dug well
dry sand
soft blue clay
CO4A sand

From ft.

To ft.

Depth(s) at which water(s) found

Kind of water (fresh, salty, sulphur)

0 20
20 100
100 134
134 141

138 FRESH

For what purpose(s) is the water to be used? Domestic

Is well on upland, in valley, or on hillside? Chouse.

Drilling or Boring Firm Henry Hammers

Address RR#3 BARRIE ONT

Licence Number 573

Name of Driller or Borer AL. HAMMERS

Address RR#5 BARRIE


Date Sept 17 / 62

Henry Hammers

(Signature of Licensed Drilling or Boring Contractor)

Location of Well

In diagram below show distances of well from road and lot line. Indicate north by arrow.

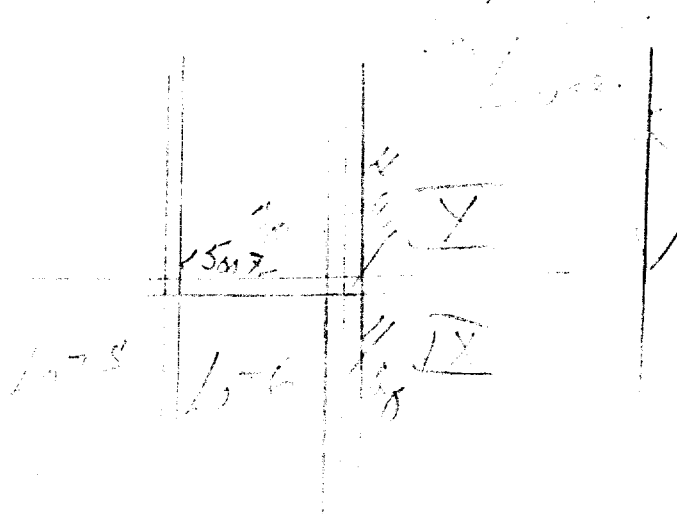

UTM 17Z 604 156 E



57 No 1255

 S13 R 408 728 1N
 Elev. 5 R 100 5

The Ontario Water Resources Commission Act

WATER WELL RECORD

Basin 22 County or District Simcoe

Con. 10

Lot 6

Township, Village, Town or City Innisfil

Date completed 11 Aug. 1967

Address RR#5 BARRIE ONT

Casing and Screen Record

 Inside diameter of casing 6 1/4"
 Total length of casing 120 ft.
 Type of screen 6" Johnson S.S. slot 18
 Length of screen 3 ft.
 Depth to top of screen 130
 Diameter of finished hole 6 1/4"

Pumping Test

 Static level 114 ft.
 Test-pumping rate 9 G.P.M.
 Pumping level 124
 Duration of test pumping 2 hr.
 Water clear or cloudy at end of test clear
 Recommended pumping rate 7 G.P.M.
 with pump setting of 121 feet below ground surface

Well Log

Overburden and Bedrock Record

 dug hole
 coarse sand, some clay, boulders
 blue clay
 fine sand with a little clay
 dry sand
 brown clay, sand, gravel
 blue clay
 brown sandy clay
 medium to coarse yellow sand

From ft.

To ft.

Depth(s) at which water(s) found

Kind of water (fresh, salty, sulphur)

0

6

6

32

32

48

48

50

50

58

58

65

65

76

76

82

82

134

114-134 fresh

For what purpose(s) is the water to be used? house

Is well on upland, in valley, or on hillside? upland

Drilling or Boring Firm H. Hammers

Well Driller

Address RR#3 Barrie, Ont.

Licence Number 2570

Name of Driller or Borer A. Hammers

Address 90 Cumberland St., Barrie

Date AUGUST 18/67


Henry Hammers

(Signature of Licensed Drilling or Boring Contractor)

Location of Well

In diagram below show distances of well from road and lot line. Indicate north by arrow.

37'

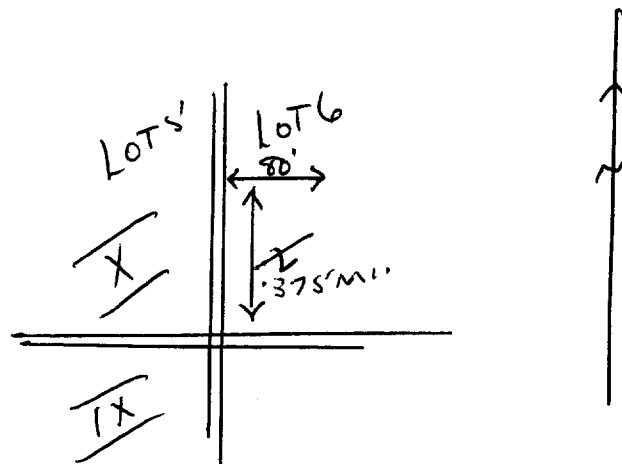



WATER WELL RECORD

Water management in Ontario

1. PRINT ONLY IN SPACES PROVIDED

2. CHECK ☒ CORRECT BOX WHERE APPLICABLE

11 5705928

MUNICIP.

CON.

57005

CAN

COUNTY OR DISTRICT

Simcoe

TOWNSHIP, BOROUGH, CITY, TOWN, VILLAGE

Innisfield Twp.

CON., BLOCK, TRACT, SURVEY, ETC.

10 X

LOT

25-27

005

R. R. 1 Thornton Ont.

DATE COMPLETED

03 DAY 19 MO. Mar. YR. 70

LOG OF OVERBURDEN AND BEDROCK MATERIALS (SEE INSTRUCTIONS)

GENERAL COLOUR	MOST COMMON MATERIAL	OTHER MATERIALS	GENERAL DESCRIPTION	DEPTH - FEET	
				FROM	TO
Black	Topsoil		Organic Material	0	18"
Brown	Sandy clay			18"	28
Brown	Sand		Med. coarse	28	58
Grey	Sand		Very fine	58	77
Grey	Sand		Fine	77	105
Brown	Sand		Med. fine	105	145
Grey	Sand		Fine Water bearing	145	148
Grey	Sand	Silt	Fine	148	160
Brown	Sand		Water Bearing	160	187
Grey	Sand		Water Bearing	187	192

31	0002802	002860509	0058610	0105208	0145609	0148208	1
32	016020800	0187609	0192209				

WATER RECORD	
WATER FOUND AT - FEET	KIND OF WATER
10-13	☒ FRESH ☐ SALTY ☐ SULPHUR ☐ MINERAL
15-18	☒ FRESH ☐ SALTY ☐ SULPHUR ☐ MINERAL
20-23	☐ FRESH ☐ SALTY ☐ SULPHUR ☐ MINERAL
25-28	☐ FRESH ☐ SALTY ☐ SULPHUR ☐ MINERAL
30-33	☐ FRESH ☐ SALTY ☐ SULPHUR ☐ MINERAL

CASING & OPEN HOLE RECORD			
INSIDE DIA. INCHES	MATERIAL	WALL THICKNESS INCHES	DEPTH - FEET
10-11	☒ STEEL ☐ GALVANIZED ☐ CONCRETE ☐ OPEN HOLE		FROM TO
06		.188	0 0108
17-18	☒ STEEL ☐ GALVANIZED ☐ CONCRETE ☐ OPEN HOLE		FROM TO
05"		.244	0 0186
24-25	☐ STEEL ☐ GALVANIZED ☐ CONCRETE ☐ OPEN HOLE		FROM TO

PLUGGING & SEALING RECORD	
DEPTH SET AT - FEET	MATERIAL AND TYPE (CEMENT GROUT, LEAD PACKER, ETC.)
10-13	
18-21	
26-29	Rubber X packer

PUMPING TEST METHOD		PUMPING RATE		DURATION OF PUMPING	
☒ PUMP ☐ BAILER		0007	GPM.	03	HOURS 00 MINS.
STATIC LEVEL	WATER LEVEL END OF PUMPING	WATER LEVELS DURING			
19-21	22-24	15 MINUTES	30 MINUTES	45 MINUTES	60 MINUTES
104	120	120	120	120	120
IF FLOWING, GIVE RATE		PUMP INTAKE SET AT			
		160			
RECOMMENDED PUMP TYPE		RECOMMENDED PUMP SETTING			
☐ SHALLOW ☒ DEEP		160			
50-53		000.4 GPM./FT. SPECIFIC CAPACITY			

FINAL STATUS OF WELL	
☒ WATER SUPPLY ☐ OBSERVATION WELL ☐ TEST HOLE ☐ RECHARGE WELL	☐ ABANDONED, INSUFFICIENT SUPPLY ☐ ABANDONED, POOR QUALITY ☐ UNFINISHED
WATER USE	
☒ DOMESTIC ☐ STOCK ☐ IRRIGATION ☐ INDUSTRIAL ☐ OTHER	☐ COMMERCIAL ☐ MUNICIPAL ☐ PUBLIC SUPPLY ☐ COOLING OR AIR CONDITIONING ☐ NOT USED
METHOD OF DRILLING	
☒ CABLE TOOL ☐ ROTARY (CONVENTIONAL) ☐ ROTARY (REVERSE) ☐ ROTARY (AIR) ☐ AIR PERCUSSION	☐ BORING ☐ DIAMOND ☐ JETTING ☐ DRIVING

LOCATION OF WELL	
IN DIAGRAM BELOW SHOW DISTANCES OF WELL FROM ROAD AND LOT LINE. INDICATE NORTH BY ARROW.	
DRILLERS REMARKS:	

CONTRACTOR	
NAME OF WELL CONTRACTOR	LICENCE NUMBER
Eric March Well Drilling	3645
ADDRESS	
P.O. Box 77 Cookstown	
NAME OF DRILLER OR OPERATOR	LICENCE NUMBER
Eric March	3645
SIGNATURE OF CONTRACTOR	SUBMISSION DATE
	DAY MO. YR.

OFFICE USE ONLY	
DATA SOURCE	CONTRACTOR
1	3645
DATE OF INSPECTION	DATE RECEIVED
30/6/70	230470
REMARKS:	
P/L	
J.B.	

WATER WELL RECORD

Water management in Ontario

1. PRINT ONLY IN SPACES PROVIDED

2. CHECK ☒ CORRECT BOX WHERE APPLICABLE

11

5707034-

MUNICIP

CO

551

110

COUNTY OR DISTRICT SIMCOE		TOWNSHIP, BOROUGH, CITY, TOWN, VILLAGE T.W.P. INNISFIL.		CON., BLOCK, TRACT, SURVEY, ETC. 10		LOT 25-27	
OWNER (SURNAME FIRST) 28-47		ADDRESS Pleasant Blvd. TORONTO, ONT.		DATE COMPLETED DAY 21 MO. Nov. YR. 69			
RC. 4		ELEVATION 102.0		RC. 5		BASIN CODE 22	

LOG OF OVERBURDEN AND BEDROCK MATERIALS (SEE INSTRUCTIONS)[illegible]

31	0002 02	0026 0509	0041 30509	0043 09		
32	10 14 15	21	22	23		

WATER RECORD

WATER FOUND AT — FEET		KIND OF WATER	
10-13	☒ FRESH ☐ SALTY	☐ SULPHUR ☐ MINERAL	14
15-18	☐ FRESH ☐ SALTY	☐ SULPHUR ☐ MINERAL	19
20-23	☐ FRESH ☐ SALTY	☐ SULPHUR ☐ MINERAL	24
25-28	☐ FRESH ☐ SALTY	☐ SULPHUR ☐ MINERAL	29
30-33	☐ FRESH ☐ SALTY	☐ SULPHUR ☐ MINERAL	34

51 CASING & OPEN HOLE RECORD

INSIDE DIAM. INCHES		MATERIAL	WALL THICKNESS INCHES	DEPTH — FEET	
				FROM	TO
10-11	☐ STEEL ☐ GALVANIZED ☒ CONCRETE ☐ OPEN HOLE	12		13-14	
30		3	0	0043 43	
17-18	☐ STEEL ☐ GALVANIZED ☐ CONCRETE ☐ OPEN HOLE	19		20-23	
24-25	☐ STEEL ☐ GALVANIZED ☐ CONCRETE ☐ OPEN HOLE	26		27-30	

SCREEN	SIZE(S) OF OPENING (SLOT NO.)	DIAMETER	LENGTH
	INCHES		
MATERIAL AND TYPE	DEPTH TO TOP OF SCREEN	FEET	


61 PLUGGING & SEALING RECORD

DEPTH SET AT - FEET		MATERIAL AND TYPE (CEMENT GROUT, LEAD PACKER, ETC.)
FROM	TO	
10-13	14-17	
18-21	22-25	
26-29	30-33	80

71	PUMPING TEST METHOD		10	PUMPING RATE		11-14	DURATION OF PUMPING	
	☐ PUMP ☐ BAILER					GPM	15-16 HOURS	17-18 MINS.
	STATIC LEVEL		WATER LEVEL END OF PUMPING		25		☐ PUMPING ☐ RECOVERY	
	19-21		22-24		15 MINUTES 25-28		30 MINUTES 29-31	
	45 MINUTES 32-34		60 MINUTES 35-37		WATER LEVELS DURING			
IF FLOWING, GIVE RATE		PUMP INTAKE SET AT		WATER AT END OF TEST		☐ CLEAR ☐ CLOUDY		
RECOMMENDED PUMP TYPE		RECOMMENDED PUMP SETTING		RECOMMENDED PUMPING RATE		50-53		
☐ SHALLOW ☒ DEEP		040		0002		50-53		
50-53		GPM. / FT. SPECIFIC CAPACITY		50-53		50-53		

LOCATION OF WELL

IN DIAGRAM BELOW SHOW DISTANCES OF WELL FROM ROAD AND LOT LINE. INDICATE NORTH BY ARROW.

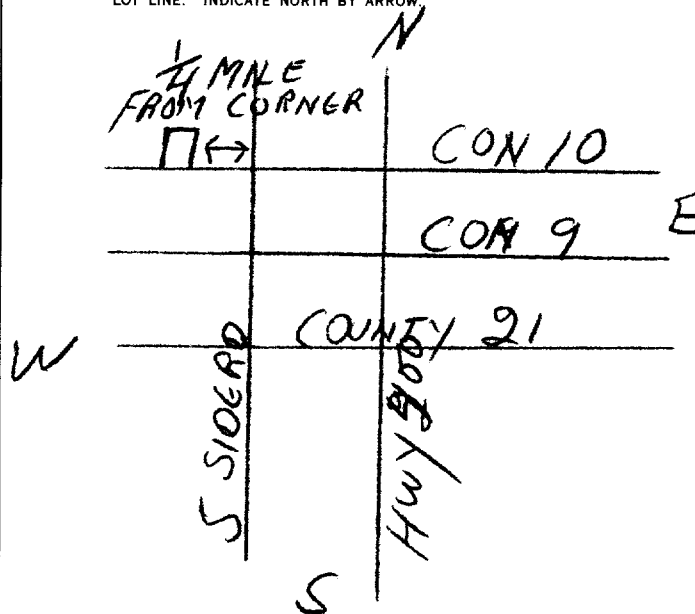

DRILLERS REMARKS:

FINAL STATUS OF WELL	54 1 ☒ WATER SUPPLY 2 ☐ OBSERVATION WELL 3 ☐ TEST HOLE 4 ☐ RECHARGE WELL	5 ☐ ABANDONED, INSUFFICIENT SUPPLY 6 ☐ ABANDONED, POOR QUALITY 7 ☐ UNFINISHED
WATER USE 01	55-56 1 ☒ DOMESTIC 2 ☐ STOCK 3 ☐ IRRIGATION 4 ☐ INDUSTRIAL ☐ OTHER _____	5 ☐ COMMERCIAL 6 ☐ MUNICIPAL 7 ☐ PUBLIC SUPPLY 8 ☐ COOLING OR AIR CONDITIONING 9 ☐ NOT USED
METHOD OF DRILLING	57 1 ☐ CABLE TOOL 2 ☐ ROTARY (CONVENTIONAL) 3 ☐ ROTARY (REVERSE) 4 ☐ ROTARY (AIR) 5 ☐ AIR PERCUSSION	☒ BORING 7 ☐ DIAMOND 8 ☐ JETTING 9 ☐ DRIVING

CONTRACTOR	NAME OF WELL CONTRACTOR	LICENCE NUMBER
	J.F. KITCHING & SON LTD.	179
	ADDRESS	
	HOLLAND LANDING, ONT.	
	NAME OF WELLER OR BORER	LICENCE NUMBER
	DAVE DRAPER	
	SIGNATURE OF CONTRACTOR	SUBMISSION DATE
		DAY 9 MO. Feb. YR 70

OFFICE USE ONLY	DRILLERS' REMARKS:						
	DATA SOURCE	58	CONTRACTOR	59-62	DATE RECEIVED	63-68	69
	1		3109		130270		
	DATE OF INSPECTION		INSPECTOR				
REMARKS:							
 							

OWRC COPY

16

r/R

Appendix E – **WATER BALANCE ANALYSIS**

MONTHLY AND YEARLY WATER BALANCE COMPONENTS														
		JAN	FEB	MAR	APR	MAY	JUN	JUL	AUG	SEP	OCT	NOV	DEC	YEAR
Potential Evapotranspiration Calculation	Average Temperature: T (°C)	-7.7	-6.6	-2.1	5.6	12.3	17.9	20.8	19.7	15.3	18.7	2.7	-3.5	7.8
	Heat Index: $i=(T/5)^{1.514}$	0.00	0.00	0.00	1.19	3.91	6.90	8.66	7.97	5.44	7.37	0.39	0.00	41.8
	Unadjusted Daily Potential Evapotranspiration: U (mm)	0.0	0.0	0.0	22.4	55.7	86.0	102.3	96.0	71.7	90.4	9.6	0.0	534.2
	Adjusting Factor for U (Latitude 44°)	0.81	0.82	1.02	1.12	1.26	1.28	1.29	1.20	1.04	0.95	0.81	0.77	-
	Adjusted Potential Evapotranspiration - PET (mm)	0.0	0.0	0.0	25.1	70.2	110.0	131.9	115.2	74.6	85.9	7.8	0.0	620.8
Pervious Components	Precipitation: P (mm)	82.5	61.8	58.1	62.2	82.4	84.8	77.2	89.9	94.0	77.5	88.9	73.6	932.9
	Adjusted Potential Evapotranspiration: PET (mm)	0.0	0.0	0.0	25.1	70.2	110.0	131.9	115.2	74.6	85.9	7.8	0.0	620.8
	P - PET	82.5	61.8	58.1	37.1	12.2	-25.2	-54.7	-25.3	19.4	-8.4	81.1	73.6	312.1
	Change in Soil Moisture Storage (mm)	0.0	0.0	0.0	0.0	0.0	-25.2	-54.7	-25.3	19.4	-8.4	81.1	0.0	-
	Water Holding Capacity (max. 150 mm)	150.0	150.0	150.0	150.0	150.0	124.8	70.0	44.7	64.1	55.7	136.8	150.0	-
	Water Surplus Available for Infiltration or Runoff	82.5	61.8	58.1	37.1	12.2	0.0	0.0	0.0	0.0	0.0	0.0	60.4	312.1
	Potential Infiltration based on MOECC Infiltration Factor (mm)	66.0	49.4	46.5	29.7	9.8	0.0	0.0	0.0	0.0	0.0	0.0	48.3	249.7
	Potential Surface Water Runoff (mm)	16.5	12.4	11.6	7.4	2.4	0.0	0.0	0.0	0.0	0.0	0.0	12.1	62.4
Impervious Components	Precipitation: P (mm)	-												932.9
	Potential Evaporation: PE (mm), Assume 15%	-												139.9
	Potential Surface Water Runoff: P - PE (mm)	-												793.0

PRE- AND POST-DEVELOPMENT WATER BALANCE (NO LOW IMPACT DEVELOPMENT MEASURES IN PLACE)							
		Total Land Area (m ²)	Est. Fraction of Land	Est. Land Area (m ²)	Runoff (m ³ /annum)	Infiltration (m ³ /annum)	% Runoff Change Pre to Post
Existing Land Use (Pre-Development)	Pervious Area	7350.0	95%	6982.5	435.9	1743.5	691%
	Impervious Area		5%	367.5	291.4	0.0	% Infiltration Change Pre to Post
	TOTAL	-	100%	7350.0	727.3	1743.5	16%
Proposed Land Use (Post-Development)	Pervious Area	7350.0	15%	1102.5	68.8	275.3	Infiltration Required to Meet Pre-Development Conditions (m ³)
	Impervious Area		85%	6247.5	4954.0	0.0	
	TOTAL	-	100%	7350.0	5022.9	275.3	1468

Notes

- Both potential infiltration and surface water runoff are independent of temperature
- Assumption is in January maximum soil moisture storage value is present (150mm)
- Water Holding Capacity & Infiltration Factors taken from Table 3.1 of MOE SWMPDM, 2003
- Average Temperature and Precipitation taken from Barrie WPCC between 1981 and 2010
- Adjusting Factor for U based on Lorente, 1961

Infiltration Criteria

Topography
Soils
Cover

Site Description

Flat Land - Average Slope Less Than 0.6 m/km
Open Sandy Loam
Cultivated Land

Infiltration Factor

0.3
0.4
0.1
0.8

Sum of Infiltration Factors